

The City of Caldwell Kansas 14 W Central Ave. Caldwell, KS 67022 620.845.6514

BID FOR: 223 N Webb, Caldwell KS

The undersigned hereby agrees to rehabilitate 223 N Webb, Caldwell, Kansas according to the specifications listed and price shown. Amounts are to be shown in both words and figures. In case of discrepancy, the amount shown in words will govern.

Bids are to be returned to the City Hall, 14 W Central Ave., Caldwell, Kansas 67022, in a sealed envelope marked "223 N Webb" no later than <u>11:00 am</u> on the 1st day of November, <u>2022</u>. Sending bids by delivery service is not recommended due to non-consistent delivery service. Bids may be hand delivered to bid opening.

Bids will be opened and read in the Caldwell Chamber Room at 113 S Main St, Caldwell, KS.

11am, November 1, 2022

Address all questions to:	
City of Caldwell	Ranson Financial (Grant Administrators)
Leah Sommerhoff	Crystal Hinnen
Kristen Sandoval	Rose Mary Saunders
620.845.6514	316.264.3400
Name of Bidding Company	y:
Authorized Signature & Tit	le:
Business Address:	

Arcine Thompson 223 N. Webb Caldwell, Kansas

Exterior: LSWP Wap the beam for the front porch roof with metal coil and install vinyl on the fort porch ceiling. Cost written in word: Exterior: LSWP Replace all desironated wood windows on the house with vinyl replacement windows. SExterior: LSWP Replace all desironated wood windows on the house with vinyl replacement windows. SExterior: LSWP Replace all desironated wood windows on the house with vinyl replacement windows. SExterior: LSWP Replace front door with insulated steel door and self-storing storm door; Install self-storing storm door; and beach Cost written in word: SExterior: Install and and on both self-sol of stains on front porch. Install handrail on the side porch on South side of house. Cost written in word: SEXTERIOR COST w	Description	Cost written in numbers
Cost written in word: Exterior: ISWP Replace from Loor with insulated steed door and self-storing storm door. Install self-atoning storm doors on side and beak Cost written in word: Exterior: IssWP Replace from Loor with insulated steed door and self-storing storm door. Install self-atoning storm doors on side and beak Cost written in word: Exterior: Install a handraid on both sets of stairs on front porch. Install handraid on the sede porch on South side of house. Cost written in word: Exterior: Install guitoring on the side porch on South side of house. Cost written in word: Exterior: Install guitoring on the side porch on South side of house. Cost written in word: Install and switches are working as designed. All recipts within six feet of valer source must have GFCI protection. Any OPEN ground outlets need to be grounded, or switched back to two prong outlets, or GFCI protected. Cover all open J-Boxes in aftic and basement. Install andraid on to ps section of stairs to the upper level. Install handraid on stair going the basement. Cost written in word: Self-plumbing: Replace gas water heater with electric 40 gal. water heater Cost written in word: Total of Part 1 Section written in word: Section written in word: Total of Part 1 Section word: Total of Part 2 Cost written in word: Section written in word: Total of Part 2 Cost written in word: Section written in word: Total of Part 2 Cost written in word: Date: Cost written in word: Date: Contact Phone:	Exterior: LSWP Wrap the beam for the front porch roof with metal coil and install vinyl on the front porch ceiling.	
Exterior: ISWP Replace all deteriorated wood windows on the house with winyl replacement windows. Cost written in word: Exterior: ISWP Replace from door with insulated steel door and self-storing storm door. Install self-storing storm doors on side and back Cost written in word: Exterior: Issual and		\$
Exterior: ISSIVP Replace from to door with insulated steel door and self-storing storm door. Install self-storing storm doors on side and back Cost written in word: Exterior: Install a handraid on both sets of stairs on front porch. Install handrail on the side porch on South side of house. Cost written in word: Setterior: Install a handraid on both sets of stairs on front porch. Install handrail on the side porch on South side of house. Cost written in word: Setterior: Install self-write set Diggrade panel to 150 amp box. Secure any loose fixtures or recepts. Eliminate any wiring hazards. Make sure all recepts and switters are working as designed. All recepts within six feet of water source must have CFCI protection. Any OPEN ground outles are working as designed. All recepts within a keep of water source must have CFCI protection. Any OPEN ground outles land to be sent on who and seeing the first own of the state of the sent and besement. Install a make decide to sin accordance with local codes. Cost written in word: Setterior: Install fact in word: Setterior: Install	Exterior: LSWP Replace all deteriorated wood windows on the house with vinyl replacement windows.	
Exterior: ISSIVP Replace from to door with insulated steel door and self-storing storm door. Install self-storing storm doors on side and back Cost written in word: Exterior: Install a handraid on both sets of stairs on front porch. Install handrail on the side porch on South side of house. Cost written in word: Setterior: Install a handraid on both sets of stairs on front porch. Install handrail on the side porch on South side of house. Cost written in word: Setterior: Install self-write set Diggrade panel to 150 amp box. Secure any loose fixtures or recepts. Eliminate any wiring hazards. Make sure all recepts and switters are working as designed. All recepts within six feet of water source must have CFCI protection. Any OPEN ground outles are working as designed. All recepts within a keep of water source must have CFCI protection. Any OPEN ground outles land to be sent on who and seeing the first own of the state of the sent and besement. Install a make decide to sin accordance with local codes. Cost written in word: Setterior: Install fact in word: Setterior: Install	Cost written in word:	\$
Exterior: Install a handral on both sets of stairs on front porch. Install handral on the side porch on South side of house. Cost written in word: Cost written in word: S	Exterior: LSWP Replace front door with insulated steel door and self-storing storm door. Install self-storing storm doors on side and back	<u> </u>
Cost written in word: Exterior: Install guitering on the side porch on South side of house. Cost written in word: Sterior: Deletrical: Upgrade panel to 150 amp box. Secure any loose fixures or recepts. Eliminate any wiring hazards. Make sure all recepts and within 50 amp box. Secure any loose fixures or recepts. Eliminate any wiring hazards. Make sure all recepts and within 50 amp box. Secure any loose fixures or recepts. Eliminate any wiring hazards. Make sure all recepts and within 50 amp box. Secure any loose fixures or recepts. Eliminate any wiring hazards. Make sure all recepts and substitute of a wirth 50 amp box. Secure any loose fixures or recepts. Eliminate any wiring hazards. Make sure all recepts and substitute of a wirth 50 amp box. Secure any loose fixures or recepts. Eliminate any wiring hazards. Make sure all recepts and substitute of a wirth 50 amp box. Secure any loose fixures or recepts. Eliminate any wiring hazards. Make sure all recepts and substitute and basement. Install and basement. Install and basement. Install and basement. Cost written in word: Social written in word: Social written in word: Total of Part 1 Social written in word: Social written in word: Social written in word: Total of Part 2 Social written in word: Social written in word: Total of Part 1 and 2 Social written in word: Cost w	Cost written in word:	\$
Exterior: Install guttering on the side porch on South side of house. Cost written in word: Interior Electrical Ugrade panel to 150 amp box. Secure any loose fixtures or recepts. Eliminate any wiring hazards. Make sure all recepts and switches are working as designed. All recepts within six feet of water source must have GFCI protection. Any OPEN ground outlets need to be grounded, or switched back to two prong outlets, or GFCI protected. Cover all open J-Boxes in attic and basement. Install a smoke detectors in accordance with local codes. Cost written in word: S Interior: Install Anadralia not posection of stairs to the upper level. Install handrall on stair going the basement. Cost written in word: S Mechanicat: Install new 3.5 ton 14 SEER A/C with new coil and line set. Cost written in word: S Cost written in word: Total of Part 1 S Cost written in word: D Cost written in word: Cost written in word: Cost written in word: D Cost written in word: Cost written in word: Cost written in word: Cost written in word: D Cost written in word: Cost written in word: Cost written in word: D Cost written in word: Cost written in word: D Cost written in word: Cost written in word: D Cost written in word: Cost written in word: Cost written in word: D Cost written in word: Cost written in word: D Cost written in word: Cost written in word: D	Exterior: Install a handrail on both sets of stairs on front porch. Install handrail on the side porch on South side of house.	·
Cost written in word: Interior Electrical: Upgrade panel to 150 amp box. Secure any loose fixtures or recepts. Eliminate any wiring hazards. Make sure all recepts and wishinds are working as designed. All recepts within six feet of water source must have GFCI protection. Any OPEN ground outlets need to be grounded, or switched back to two prong outlets, or GFCI protected. Cover all open J-Boxes in attic and basement. Install a smoke defloctors in accordance with local codes. Cost written in word: Cost written in word: Substitute in word: Cost written in word: Cost written in word: Cost written in word: Substitution in word: Cost written in word: Cost written in word: Cost written in word: Substitution in word: Cost written in word: Cost written in word: Substitution in word: Cost written in word: Cost written in word: Substitution in word: Cost written in word: Double Electrical Covers and passement. Cost written in word: Cost wr	Cost written in word:	\$
Interior Electrical: Upgrade panel to 150 amp box. Secure any loose fictures or recepts. Eliminate any wining hazards. Make sure all recepts and without sar working a designed. All recepts within six feet of water source unstanded or switched back to two prong outlets or GFCI protected. Cover all open J-Boxes in attic and basement. Install a smoke detectors in accordance with look todes. Cost written in word: Cost written in word: Cost written in word: Selection in secure and the secure of the sec	Exterior: Install guttering on the side porch on South side of house.	
Interior Electrical: Upgrade panel to 150 amp box. Secure any loose fictures or recepts. Eliminate any wining hazards. Make sure all recepts and without sar working a designed. All recepts within six feet of water source unstanded or switched back to two prong outlets or GFCI protected. Cover all open J-Boxes in attic and basement. Install a smoke detectors in accordance with look todes. Cost written in word: Cost written in word: Cost written in word: Selection in secure and the secure of the sec	Cost written in word:	\$
Interior: Install handrail on top section of stairs to the upper level. Install handrail on stair going the basement. Cost written in word: Cost written in word: S Mechanical: Install new 3.5 ton 14 SEER A/C with new coil and line set. Cost written in word: S Total of Part 1 Cost written in word: S Cost written in word: Cost written in word: S Cost written in word: Cost written in word: S Cost written in word: S Cost written in word: Cost written in word: S Cost written in word: Conpany Name: Company Name: Contact Name: Contact Phone: Contact Phone: Contact Email Authorized Signature: Date:	Interior Electrical: Upgrade panel to 150 amp box. Secure any loose fixtures or recepts. Eliminate any wiring hazards. Make sure all recepts and switches are working as designed. All recepts within six feet of water source must have GFCI protection. Any OPEN ground outlets need to be grounded, or switched back to two prong outlets, or GFCI protected. Cover all open J-Boxes in attic and basement. Install a smoke detectors in accordance with local codes.	·
Cost written in word: Plumbing: Replace gas water heater with electric 40 gal. water heater	Cost written in word:	\$
Plumbing: Replace gas water heater with electric 40 gal. water heater Cost written in word: Cost written in word: S Total of Part 1 Cost written in word: Part 2 Lead Activities Cost written in word: Cost written in word: S Cost written in word: Cost written in word: S Cost written in word: Cost written in word: S Cost written in word: S Cost written in word: Cost written in word: S Cost written in word: Cost written in word: S Cost written in word: Cost written in word: S Cost written in word: Cost written in word: Cost written in word: Cost written in word: Double S Cost written in word: Cost written in word: Double S Cost written in word: Cost written in word: Date:	Interior: Install handrail on top section of stairs to the upper level. Install handrail on stair going the basement.	
Cost written in word: Mechanical: Install new 3.5 ton 14 SEER AIC with new coil and line set. Cost written in word: Total of Part 1 Cost written in word: Part 2 Lead Activities Cost or preparing for clearance. Cost written in word: Scost written in word: Total of Part 2 Scost written in word: Total of Part 1 and 2 Cost written in word: Cost written in word: Total of Part 1 and 2 Cost written in word: Cost written in word: Date: Authorized Signature: Date:	Cost written in word:	\$
Mechanical: Install new 3.5 ton 14 SEER A/C with new coil and line set. Cost written in word: Total of Part 1 S Cost written in word: Part 2 Lead Activities Cost for using lead safe work practices. Cost written in word: S Cost written in word: Date:	Plumbing: Replace gas water heater with electric 40 gal. water heater	
Cost written in word: Total of Part 1 \$	Cost written in word:	\$
Total of Part 1 \$ Cost written in word: Part 2 Lead Activities Costs for using lead safe work practices. Cost written in word: \$ Cost written in word: \$ Total of Part 2 \$ Cost written in word: Total of Part 2 \$ Cost written in word: Total of Part 1 and 2 \$ Cost written in word: Company Name: Company Address: Contact Name: Contact Phone: Contact Email Authorized Signature: Date:	Mechanical: Install new 3.5 ton 14 SEER A/C with new coil and line set.	
Total of Part 1 \$ Cost written in word: Part 2 Lead Activities Costs for using lead safe work practices. Cost written in word: \$ Cost written in word: \$ Total of Part 2 \$ Cost written in word: Total of Part 2 \$ Cost written in word: Total of Part 1 and 2 \$ Cost written in word: Company Name: Company Address: Contact Name: Contact Phone: Contact Email Authorized Signature: Date:	Cost written in word:	\$
Cost written in word: Part 2 Lead Activities Cost for using lead safe work practices. Cost written in word: S Cost written in word: S Cost written in word: Total of Part 2 Cost written in word: Total of Part 1 and 2 S Cost written in word: Company Name: Company Address: Contact Name: Contact Phone: Contact Email Authorized Signature: Date:	Total of Part 1	· ·
Costs for using lead safe work practices. Cost written in word: Cost written in word: S Cost written in word: Cost written in word: S Cost written in word: Total of Part 2 S Cost written in word: Total of Part 1 and 2 S Cost written in word: Company Name: Company Address: Contact Name: Contact Phone: Contact Email Authorized Signature: Date:		Ψ
Costs for using lead safe work practices. Cost written in word: Cost written in word: S Cost written in word: Total of Part 2 S Cost written in word: Total of Part 1 and 2 S Cost written in word: Company Name: Company Address: Contact Name: Contact Phone: Contact Email Authorized Signature: Date:		_
Cost written in word: Cost for preparing for clearance. Cost written in word: Total of Part 2 Cost written in word: Total of Part 1 and 2 Cost written in word: Company Name: Company Address: Contact Name: Contact Phone: Contact Email Authorized Signature: Date:	Part 2 Lead Activities	
Cost written in word: Cost for preparing for clearance. Cost written in word: Total of Part 2 Cost written in word: Total of Part 1 and 2 Cost written in word: Company Name: Company Address: Contact Name: Contact Phone: Contact Email Authorized Signature: Date:	Costs for using lead safe work practices.	
Cost written in word: Total of Part 2 Cost written in word: Total of Part 1 and 2 Cost written in word: Total of Part 1 and 2 Cost written in word: Company Name: Company Address: Contact Name: Contact Phone: Contact Email Authorized Signature: Date:		\$
Cost written in word: Total of Part 2 Cost written in word: Total of Part 1 and 2 Cost written in word: Company Name: Company Address: Contact Name: Contact Phone: Contact Email Authorized Signature: Date:		Ψ
Total of Part 2 \$ Cost written in word: Total of Part 1 and 2 \$ Cost written in word: Company Name: Company Address: Contact Name: Contact Phone: Contact Email Authorized Signature: Date:	Cost to proparing to stock and the	¢.
Cost written in word: Total of Part 1 and 2 Cost written in word: Company Name: Company Address: Contact Name: Contact Phone: Contact Email Authorized Signature: Date:	Cost written in word:	Þ
Cost written in word: Total of Part 1 and 2 Cost written in word: Company Name: Company Address: Contact Name: Contact Phone: Contact Email Authorized Signature: Date:		
Total of Part 1 and 2 \$ Cost written in word: Company Name: Company Address: Contact Name: Contact Phone: Contact Email Authorized Signature: Date:	Total of Part 2	\$
Total of Part 1 and 2 \$ Cost written in word: Company Name: Company Address: Contact Name: Contact Phone: Contact Email Authorized Signature: Date:	Coot written in word:	
Company Name: Company Address: Contact Name: Contact Phone: Contact Email Authorized Signature: Date:	Cost written in word:	_
Company Name: Company Address: Contact Name: Contact Phone: Contact Email Authorized Signature: Date:		
Company Name: Company Name: Company Address: Contact Name: Contact Phone: Contact Email Authorized Signature: Date:	Total of Part 1 and 2	8
Company Address: Contact Name: Contact Phone: Contact Email Authorized Signature: Date:	Cost written in word:	*
Company Address: Contact Name: Contact Phone: Contact Email Authorized Signature: Date:		_
Company Address: Contact Name: Contact Phone: Contact Email Authorized Signature: Date:		-
Company Address: Contact Name: Contact Phone: Contact Email Authorized Signature: Date:	Company Name:	
Contact Name: Contact Phone: Contact Email Authorized Signature: Date:	• •	
Contact Phone: Contact Email Authorized Signature: Date:	· •	
Contact Email Authorized Signature: Date:		
Authorized Signature: Date:		
	Contact Email	
Authorized Printed Name:	Authorized Signature: Date:	
	Authorized Printed Name:	



BOSWELL HOME IMPROVEMENT BRETT A BOSWELL 1903 TUMBLEWEED DR HUTCHINSON KS 67502
 REPORT NUMBER
 REPORT DATE

 6329909:1
 09/21/2022

 REPORT PAGE
 PRINT DATE

 REPORT PAGE
 PRINT DATE

 1 of 2
 09/21/2022

OWN ID

N/A BY

David Smith Radon Supplies, Inc.

REPORT RECEIVER(S)

David@DavidSmithRadonSupplies.com BOSWELL HOME IMPROVEMENT

RADON MONITORING REPORT

Description of the measurement

The measurement was performed with an Activated Charcoal Adsorption detector (QuickScreen) and was analyzed by Alpha Energy Laboratories (NRPP ID: 101132 AL).

The detector(s) arrived to Alpha Energy Laboratories, Inc. 09/19/2022. They were measured 09/19/2022.

The detectors were deployed by BRETT A BOSWELL, Certification license no: KS-MS-0396 and retrieved by BRETT A BOSWELL, Certification license no: KS-MS-0396

Property data and address

MEASURE SITE ADDRESS
TAMMY THOMPSON
223 NORTH WEBB
CALDWELL KS 67022

BUILDING ID

TYPE OF BUILDING:SF Detached

BUILDING YEAR:

1900

FOUNDATION TYPE:

Crawl space

PURPOSE OF TEST:Primary Screening

Test results

DETECTOR	MEASUREMENT PERIOD	DESCRIPTION / LOCATION	ROOM TYPE	FLOOR	RADON RESULT
RK111551 [QuickScreen]	09/13/2022 03:30 PM - 09/15/2022 03:45 PM		Living room	First	< 0.7 pCi/L

Comment to the results

Tryggve Rönnqvist (Electronically signed)

Signature Radonova Laboratories Laboratory Measurement Specialist

This report may only be reproduced in full, unless issuing laboratory has given prior written approval.

DISCLAIMER

Radonova Inc. makes no warranty of any kind, express or implied, as regard to the use, operation or analysis of any Radonova Inc. monitor. Radonova Inc. specifically disclaims implied warranties of merchantability and fitness for a particular purpose. Radonova Inc. is not responsible for any damage, including consequential damages, to persons or property resulting from the use of the monitor or the resulting data.

RADONOVA INC.

1 EAST 22nd STREET, SUITE 200 LOMBARD, IL 60148 331.814.2200, help@radonova.com

Lead-Based Paint Hazard Risk Assessment Report

For The Dwelling Located At: 223 N Webb Caldwell, Ks



Prepared For Owner(s):
Arcine &Tammy Thompson
223 N. Webb
Caldwell, KS
620-213-0014

Report Prepared By: Jeremy Bullins, Kansas Certified Risk Assessor

Risk Assessor Signature

SCKEDD

9730 East 50th Street North Bel Aire, Kansas 67226 Ph 316-262-7035 Fax 316-262-7062

Kansas Risk Assessor Certification #: KS19-14629 Kansas Lead Activity Firm License #: KS01-1050

REPORT DATE:-08-25-2022

Table of -Contents

Contents	<u>Page</u>
Lead Hazard Evaluation Notice	3
Identified Lead Hazards	4
Identifying Information	5
Summary of Results Dust Hazards Paint Hazards Soil Hazards	5 5 6 7
Recommendations Hazard Reduction options	7 7
Resident Questionnaire	7
Building Condition Visual Observation Form Resident Notification Re-evaluation and Monitoring Schedule	8 9 9
Conditions and Limitations	10
Future Remodeling Precautions	10
Disclosure Regulations	10
Appendix Dust Wipe Analytical Results Lead Based Paint Testing (XRF) Results Floor Plan and Sample Map Preliminary Rehabilitation work write-up Certifications	11
SCKEDD Lead Activity Firm License SCKEDD Radioactivity Material License Risk Assessor Certification for Kansas Risk Assessor XRF Training Certificate NLLAP Laboratory Accreditation XRF Performance Characteristic Sheet Data Library of Specifications from the National Center for Health	y Housing

SINGLE FAMILY LEAD HAZARD EVALUATION NOTICE

To: Arcine &Tammy Thompson 223 N. webb Caldwell

Type of Evaluation Completed: Risk Assessment

Date of On-Site Lead Hazard Risk Assessment: August 22, 2022

Date of Lead Hazard Risk Assessment Report: August 25, 2022

Summary of Results:

Lead-based paint hazards above the de-minimus were found.

De minimis Levels— the following levels which are used to determine whether deteriorated paint is a hazard that must be addressed:

• 20 square feet (2 square meters) on exterior surfaces

• 2 square feet (0.2 square meters) in any one interior room or space; or

• 10 percent of the total surface area on an interior or exterior type of component with a small surface area. e.g. window sills, baseboards, and trim

Lead-based paint means paint or other surface coatings that contain lead equal to or exceeding 1.0 milligram per square centimeter or 0.5 percent by weight or 5,000 parts per million (ppm) by weight.

Lead-based paint hazard means any condition that causes exposure to lead from dust-lead hazards, soil-lead hazards, or lead-based paint that is deteriorated or present in chewable surfaces, friction surfaces, or impact surfaces, and that would result in adverse human health effects.

Lead-contaminated Dust- means surface dust in residential dwellings or child-occupied facilities that contain an area or mass concentration of lead at, or in excess 10 μ g/sq.ft. on an interior floor, 100 μ g/sq.ft. on an interior windowsill, and 400 g/sq. ft. on an interior window trough. Lead dust forms when lead-based paint is dry scraped, dry sanded, or heated (vapor). Dust also forms when painted surfaces bump or rub together. Lead chips and dust can get on surfaces and objects that people touch. Settled lead dust can re-enter the air when people vacuum, sweep, or walk through it.

Lead-contaminated Soil- means bare soil on residential real property and on the property of a child-occupied facility that contains lead at, or in excess of 400 ppm for play areas and 1200 ppm for all other areas.

Summary of severity, types, and locations of lead-based paint hazards. List the dust-lead locations, and/or building components (including type of room or space and the material underneath the paint), and types of lead-based paint hazards found:

Lead Dust Location	Identified Hazards
Floors: No	Lead in dust levels at/or exceeding 10 μg/sq.ft. on interior floor
Sills: Yes- main bath sill	Lead in dust levels at/or exceeding 100 μg/sq.ft. on interior window sill

Identified Lead Hazards -

	Component	Substrate	Color	Condition	Hazard
Location					
Exterior					
2	Door trim	Wood	white	fair	Deteriorated Lead Based Paint
	Window components	Wood	White	Fair	Deteriorated Lead Based Paint
	Porch post ,floor &ceiling	wood	White	fair	Deteriorated Lead Based Paint
	Soffit and fascia	wood	white	fair	Deteriorated Lead Based Paint
Interior	Upstairs Door and Trim and wood lap	Wood	White	Fair	Deteriorated Lead Based Paint
	Utility room Jam	Wood	Grey	Fair	Deteriorated Lead Based Paint

Lead based paint was identified to be present on the following components:

- **Exterior Door and window components**
- Interior door and jam
- Porch post and header
- Soffit and fascia

The condition of the paint is fair and therefore does not pose a hazard at this time. Lead safe work practices should be used if any of the above listed components are disturbed. Monitoring for paint deterioration should be performed frequently on the above components by the property owner(s).

Contact person for more information about the risk assessment:

Printed name: Jeremy Bullins

Signature:

Muller Kansas Risk Assessor Certification #: KS19-14629

Date of Report: August 25, 2022

Organization: South Central Kansas Economic Development District (SCKEDD)

Kansas Lead Activity Firm License #: KS01-1050

Street: 9730 East 50th Street North City & State: Bel Aire, Kansas

Zip: 67226

Phone #: 316-262-7035

Identifying Information

A lead-based paint hazard risk assessment (risk assessment) was conducted on August 22 2022, of the single family detached home located at 223 Webb, Caldwell Ks, to evaluate the presence of lead-based paint hazards inside and outside of the residence prior to a planned rehabilitation project. The assessment was conducted by Jeremy Bullins, a Certified Risk Assessor, Kansas Department of Health and Environment certification number KS19-14629.

The general scope of the risk assessment involved a visual survey of the site, exterior and interior of the structure, dust wipe sampling was performed on a variety of interior surfaces. Painted and varnished surfaces were tested using an X-ray Fluorescence Analyzer (XRF). Surfaces tested through the use of the XRF include friction and impact surfaces and surfaces showing deterioration along with surfaces to be disturbed by the planned renovation. Soil samples are collected and analyzed when bare soil is identified.

No known lead inspection or risk assessment has been conducted at this residence prior to this risk assessment.

1. Summary of Visual Inspection Results

The structure was built in or around 1905 based on information provided by the Sumner County Appraiser website. The dwelling was found to be in structurally sound condition. The house has wood siding. The doors and windows are deteriorated and should be replaced. The porch ceiling, facia and sofit have

deteriated lead base paint and should be wrapped. The XRF testing results showed that lead-based paint hazards (as defined in Title X of the 1992 Housing and Community Development Act) exist in the following locations:

2. Identified Hazards

A. Priority 1 - Dust Hazards

Leaded dust at or above HUD limits of: $10 \,\mu\text{g/ft}^2$ for floors, $100 \,\mu\text{g/ft}^2$ for interior windowsills and $400 \,\mu\text{g/ft}^2$ for exterior window troughs are considered hazardous. Using these criteria the analysis showed dust **hazards** were found in the following area(s):

Room	Location	Surface	Reading
Main Dining room window	sill	wood	119 μg/ft²
Main Den Window	Sill	Wood	1740 μg/ft ²
Upper Bed Room window 1	Sill	Wood	130 μg/ft²
Upper Bedroom window 3	Sill	Wood	641 μg/ft ²
Upper Storage room floor	Floor	Wood	32.6 μg/ft²
Basement Window	Sill	Concrete	3990 μg/ft ²

All other areas that were tested for leaded dust were found to be <u>below</u> the HUD/EPA/KDHE limit.

B. Priority 2 – Interior Paint Hazards / Priority 3 – Exterior Paint Hazards Lead-Based Paint is any paint or other surface coatings that contains lead equal to or exceeding 1.0 milligram per square centimeter or 0.5 percent by weight or 5,000 parts per million (ppm) by weight.

Location	Component	Substrate	Color	Condition	Hazard
Exterior					
	Door trim and Jam	Wood	White	fair	Deteriorated Lead Based Paint

	Window wood	Wood	White	Fair	Deteriorated Lead Based Paint
	Porch ceiling	wood	white	fair	Deteriorated Lead Based Paint
	Soffit and fascia	wood	white	fair	Deteriorated Lead Based Paint
Interior	Utillity room /kitchen Jam	Wood	Grey	Fair	Deteriorated Lead Based Paint
	Upstairs door surfaces	Wood	White/s tain	Fair	Deteriorated Lead Based Paint
	Wood Lap	Wood	White	Fair	Deteriorated Lead Based Paint

Lead safe work practices should be used if any of the above listed components are disturbed. Monitoring for paint deterioration should be performed frequently on the above components by the property owner(s).

B. Priority 4 - Soil Hazards

Current KDHE, EPA and HUD Guidance for soil are 400 ppm for bare play area and 1,200 ppm for other areas. In an effort to be more protective of children, SCKEDD has adopted a soil lead standard of 400 ppm for all areas of the property. Lab results which detail soil lead levels over 5,000 ppm must be abated.

3. Recommendations

A. Hazard Reduction

Acceptable Interim Control Specifications

The following hazard reduction treatments selected from the National Center for Lead-Safe Housing's Library of Specifications are acceptable ways to address the identified hazards. The number refers to the spec number of the scope of work in the NCLSH data base.

General Requirements:

9030 - Clearance Report 9122 - Ground Containment 9057 – Worker Training

9640-Enclose Barrier/vinyl siding

9129 - Final Clean - All floors, walls, window sills and troughs

B. Relocation

 No lead-based paint hazards will be addressed as part of the interior renovation of this dwelling, therefore relocation is not required.
 Clearance will have to be achieved at the completion of all work activity.

Resident Questionnaire

- 1. (a) Do children live in your home? yes
 - (b) If yes, how many? 1 Ages? 17
 - (c) Record blood lead levels, if known:
 - (d) Does a pregnant woman live in your home? NO

IF NO CHILDREN, SKIP TO 05

2. Locate the rooms / areas where each child under the age of 72 months sleeps, eats and plays.

Name of child	Location of Bedroom	Location of all rooms where child eats	Primary location where child plays indoors	Primary location where child plays - outdoors

- 3. Where are toys stored / kept? N/A
- 4. Is there any visible evidence of chewed or peeling paint on the woodwork, furniture, or toys? No

Family Use Patterns

- 5. Which entrances are used most frequently? Both
- 6. Which windows are opened most frequently? None
- 7. Is there a window A/C? No If yes, where?
- 8. Is there a household garden? No If yes, where?
- 9. Are any landscaping activities planned? No If yes, where?
- 10. How often is the house cleaned? Weekly
- 11. What cleaning methods are used? Dust mop/wet mop/vacuum/dusting
- 12. Were there any building renovation completed recently? No If yes, where?
- 13. Where was the building debris stored? N/A
- 13. Are building renovations planned for this residence? Yes If yes see work-write-up attached.
- 14. Do any of the household work in a lead-related industry? No

If yes – where are dirty clothes placed & cleaned?

Form 5.1 **Building Condition Visual Observation Form**

Condition	Yes	No
Roof missing parts of surfaces (tiles, boards, shakes, etc.)		X
Roof has holes or large cracks (evidence of leaks)		X
Gutter or downspouts broken or missing		X
Chimney masonry cracked, bricks loose or missing, obviously out of plumb		X
Exterior or interior wall have obvious large cracks or holes, requiring more than routine painting		X
Exterior siding has missing boards or shingles		X
Water stains on interior walls or ceilings		X
Plaster walls or ceilings deteriorated		X
Two or more windows or doors broken, missing, or boarded up		X
Porch or steps have major elements broken, missing or boarded up		X
Foundation has major cracks, missing material, structural leans, or visibly unsound		X
Total Number	0	

If "yes" column has 2 or more checks, the dwelling is considered to be in poor condition. Less than 2 checks in the "yes" column means that the dwelling appears to be well maintained and the Standard Reevaluation Schedule does not need to be revised. Only buildings in "good" condition are eligible for the Lead Hazard Screen.

Resident Notification:

A copy of this lead assessment is being provided to the property owner. After the rehabilitation work is completed and clearance established a combination Clearance and Notice of Lead Hazard Reduction will be sent to the property owner.

SCKEDD will provide a copy of the EPA pamphlet, entitled "Protect Your Family from Lead in Your Home". The renovator hired by the City or County will provide the owner, and tenants (if applicable) a copy of the EPA pamphlet "The Lead-Safe Certified Guide to Renovate Right" in person prior to the start of work, or by mail at least seven days prior to work. This pamphlet will be provided no more than 60 days prior to the start of work.

These documents meet the Resident Notification requirements of KDHE/EPA/HUD.

Re- evaluation and Monitoring Schedule – The resident should visually monitor the condition of the paint annually. The normal re-evaluation schedule for paint film stabilization is 12 months. The residence should be professionally re-evaluated 12 months from the completion of the rehabilitation project.

Conditions and Limitations

Sampling and testing results are limited in that they represent existing concentration of lead in soil, paint and dust at the time of collection only. Changes in ventilation, occupancy, equipment, sources, and products used and other conditions may cause variations in anticipated concentrations.

Future Remodeling Precautions

The lead paint assessment of this property tested a limited number of areas for the presence of lead based paint (LBP). All LBP, dust and soil hazards that were identified are addressed in this report. However, LBP, dust lead hazards and/or soil lead hazards may be present at other locations of the property. For additional guidance, prior to any repairing or remodeling that will disturb painted surfaces, lead containing materials or soil, obtain a copy of the HUD publication entitled: "Lead Paint Safety -a Field Guide for Painting, Home Maintenance, and Renovation Work" (1999) by calling HUD @ 1-800-424-5323 and request the booklet or download the booklet from the HUD website @ www.hud/gov/offices/lead/communityinformation

Disclosure Regulations

A copy of this complete report must be made available to new tenants (lessees) and/or must be provided to purchasers of this property under Federal laws before they become obligated under a lease or sales contract (24 CFR part 35 and 40 CFR Part 745). Landlords (lessors) and /or sellers are also required to distribute an educational pamphlet approved by the U.S. Environmental Protection Agency and include standard warning language in their leases or sales contracts to ensure that parents have the information they need to protect their children from lead-based paint.

Signatures (Owner and Risk Assessor and Renter)

Owner

Date

08/29/2022

Kańsas Certified Risk Assessor

Date

Appendix -

Lead Based Paint Testing (XRF) Results
Floor Plan and Sample Map
Preliminary Rehabilitation work write-up
Certifications
SCKEDD Lead Activity Firm License

SCKEDD Lead Activity Firm License SCKEDD Radioactivity Material License Risk Assessor Certification for Kansas Risk Assessor XRF Training Certificate NLLAP Laboratory Accreditation

XRF Performance Characteristic Sheet Data Library of Specifications from the National Center for Healthy Housing



SCHNEIDER LABORATORIES GLOBAL, INC.

2512 West Cary Street, Richmond, Virginia 23220-5117 804-353-6778 • 800-785-LABS (5227) • Fax 804-359-1475 www.siabinc.com • info@slabinc.com

SEE WAST	SUREDO				□-YES □ NO	
	our voi		Kunsu			
			276 Email 1/ //		316 833 14	45
Project Name	1 1-11 0-7	77		ns @ Schedo	1.005	
Project Location	727 116	& Caldery	Special Instructions:			
Project Number	(NED)	O Caldley	Special Instructions:			
Collected By		R III				
Conected by	Jeveny	Dalling				
						2.5
☐ 2 Hour *	☐ Air	Asbestos in Bulk	Metals Total	TCLP	Microbiolog	v
☐ Same day *	☐ Paint	☐ PLM	Lead	☐ Lead	☐ BACT (MPN/PA)	
1 business day	□ Soil	☐ PLM Qualitative	☐ RCRA 8 Metals	☐ RCRA 8 Metals	☐ Mold Direct Exam	
2 business days	☑ Wipe	☐ 400 Point Count	☐ Chromium VI	☐ Full TCLP	☐ Allergens	
☐ 3 business days	□ Bulk	☐ 1000 Point Count	☐ Mercury	(w/ organics 10 Day)	Sub-Contrac	t
☐ 5 business days	☐ Waste Water	☐ Gravimetric Prep			☐ TEM Chatfield	
* not available for all tests	☐ Ground Water	Asbestos in Air	Gravimetric	Miscellaneous	☐ TEM AHERA	
** past 3 PM the TAT will begin next business day	☐ Drinking Water	□ PCM	☐ Total Dust NIOSH 0500	☐ Silica FTIR (7602)	☐ TEM 7402	
Please schedule rush tests in advance	☐ TSP / PM10	☐ PCM-B Rules	Resp. Dust NIOSH 0600		☐ Siliça XRD (7500)	
in dovance						
				NAME AND ADDRESS OF THE OWNER, WHEN PERSON NAMED IN		
		Sample Identifica (Employee, Bldg, Materia	THE RESERVE OF THE PARTY OF THE			Total Air ⁴
MUR	V12472 9!30	(Employee, Bldg, Materia	al, Type ²)			Total Air ⁴
MKF	V22/22 9!30	(Employee, Bldg, Materia	al, Type ²)			Total Air ⁴
	V12/12 9!30	Muin Utilly 1 Main Kitcher	Floor 1.054			Total Air ⁴
MKF	V12/12 9!30	Main Utilly 1 Main Kitchen 11	Flor 1.05gH Window 0,255gg			Total Air ⁴
MKF MKW	422/22 9!30	Main Utilly 1 Main Kitchen 11 Buth	Floor 1:0 Sape			Total Air ⁴
MKF MKW MBF	422/22 9!30	(Employee, Bldg. Materia Main Utility) Main Kitchen 11 Buth 11 Dindy	Floor 1.0 Sape Floor 1.0 Sape Floor 1.0 Sape Floor 1.0 Sape			Total Air ⁴
MKF MKW MBF MDF	422/22 9!30	(Employee, Bldg. Materia Main Utility) Main Kitchen 11 11 Dinaly 11 Dinaly 11 Dinaly	Floor 1.05gf Floor 1.05gf Window 0.255gf Floor 1.05gf Uindow 0.255gf Uindow 0.255gf			Total Air ⁴
MKF MKW MBF MDF	422/22 9!30	(Employee, Bldg. Materia Main Utility) Main Kitchen 11 11 Dinaly 11 Dinaly 11 Dinaly	Floor 1.0 Sape Floor 1.0 Sape Floor 1.0 Sape Floor 1.0 Sape			Total Air ⁴
MKF MKW MBP MDF MDW MLF	422/22 9!30	(Employee, Bldg, Materia Main Utility) Main Kitch en 11 Dinning 11 Dinning 11 Livery	Floor 1.05gf Floor 1.05gf Window 0.255gf Floor 1.05gf Uindow 0.255gf Uindow 0.255gf			Total Air ⁴
MKF MKW MBP MDF MDW MLF	V22/22 9!30	(Employee, Bldg, Materia Main Utility) Main Kitch en 11 Dindy 11 Dinnin, 11 Livry 11 11	Floor 1.05gf Floor 1.05gf Window 0.255gf Floor 1.05gf Uindow 0.255gf Uindow 0.255gf			Total Air ⁴
MKF MKW MBP MDF MDF MDF MLF MLF MLW MAP MJW	For Aqu	(Employee, Bldg. Materia Main Cutility) Main Kitch or II Buth II Dindy II Dinnin II Livry II II II Den Command of the command of the command could be command to b	Floor 1.05g/r Floor 1.05g/r Floor 1.05g/r Floor 1.05g/r Floor 1.05g/r Vindou 0.255g/r Floor 1.05g/r			Total Air ⁴
MKF MKW MBP MDF MDF MDF MLF MLF MLW MAP MJW		(Employee, Bldg. Materia Main Cutility) Main Kitch or II Buth II Dindy II Dinnin II Livry II II II Den Command of the command of the command could be command to b	Floor 1.05 str Floor 1.05 str Window 0:25 sylor Floor 1:05 sylor	plicate and spike analysis	h min × flow in L/min]	Total Air ⁴
MKF MKW MBP MDF MDF MDF MLF MLF MLW MAP MJW	For Aqu	(Employee, Bldg. Materia Main Cutility) Main Kitch or II Buth II Dindy II Dinnin II Livry II II II Den Command of the command of the command could be command to b	Floor 1.05gts Floor 1.05gts Window 0.255gts Floor 1.05gts	plicate and spike analysis	to the man × flow in L/min]	Total Air ⁴



SCHNEIDER LABORATORIES GLOBAL, INC.

2512 West Cary Street, Richmond, Virginia 23220-5117 804-353-6778 • 800-785-LABS (5227) • Fax 804-359-1475 www.slabinc.com • info@slabinc.com

建建设	SUREDA		11	u.sa s	D-YES D NO
				767 Phone	
			Email 1/	(1) (a) () ()	316 833 1445
Project Name	Accine & Tun	Thomas a	PO#	ullins (a) Schedo	- 05
Project Location	Arcine & Tun 223 Webb	Caldwall	Special Instruction	is:	
Project Number	1000				
Collected By	Jeruny 1	Lullins			
2 Hour *	☐ Air	Asbestos in Bulk	Metals Tota	TCLP	Microbiology
☐ Same day *	☐ Paint	□ PLM	☐ Lead	☐ Lead	☐ BACT (MPN/PA)
1 business day	□ Soll	☐ PLM Qualitative	☐ RCRA 8 Metal	s RCRA 8 Metals	☐ Mold Direct Exam
2 business days	Ø Wipe	☐ 400 Point Count	☐ Chromium VI	☐ Full TCLP	☐ Allergens
☐ 3 business days	☐ Bulk	☐ 1000 Point Count	☐ Mercury	(w/ organics 10 Day)	Sub-Contract
5 business days	☐ Waste Water	☐ Gravimetric Prep	0		☐ TEM Chatfield
* not available for all tests * past 3 PM the TAT will begin	☐ Ground Water	Asbestos in Air	Gravimetric	Miscellaneous	☐ TEM AHERA
next business day	□ Drinking water	☐ PCM	☐ Total Dust NIOSH 0500	☐ Silica FTIR (7602)	☐ TEM 7402 ·
Please schedule rush tests In advance	☐ TSP / PM10	☐ PCM-B Rules	Resp. Dust NIOSH 0600	0	☐ Silica XRD (7500)
				II .	
	VENEZANICH PARTIE TERMINA				
		Sample Identifica (Employae, Bldg, Materi			Total Air ⁴
US P	8/22/22 9/30	(Employae, Bldg, Materi	ai, Type ¹ }		Total Air ⁴
US F UH F	8/22/22 9:30	(Employae, Bldg, Materia Upper Stass F	1641 105g		Total Air ⁴
	8/22/22 9:30	Comployee, Bldg, Materia Upper Stass F LC Hall F	Tour 1.0 Sq Tour 1.0 Sq	10	Total Air ⁴
U4F	8/22/22 9:30	Comployee, Bldg, Materia Upper Stass F 11 Hall f 11 Beeth	Tour 1.059 Tour 1.059 Tour 1.05	Art .	Total Air ⁴
UHF UBF UBW	8/22/22 9:30	(Employee, Bldg, Materia Upper Staff F 11 Hall f 11 Beeth	Floor 1.05 Floor 1.05 Floor 1.05 Window 0.25	gy - Syl	Total Air ⁴
UHF UBF UB W	8/22/22 9/30	Comployue, Bldg, Materia Upper Stair F 11 Hall t 11 Beeth 11 Bedroom	Floor 1.05 Vinden 0.25 Ploor 1.05 Vinden 0.25	gy - Syl	Total Air ⁴
UHF UBF UBIF	8/22/22 9/30	(Employee, Bldg, Materia Upper Stass F 11 Hall f 11 Buth 11 Buth 11 II Buth	Floor 1.05 Floor 1.05 Plan 1.05 Vinden 0.25 Plan 1.002 Vinden 0.25	gy - Syl	Total Air ⁴
UHF UBF UBIV UBIW		(Employee, Bldg, Materia Upper Stair F 11 Hall f 11 Buth 11 Buth 11 II Buth 11 Dul 2	Floor 1.05 Plan 1.05 Plan 1.05 Vinden 0.25 Plan 1.005 Plan 1.005 Plan 1.005	gy - Syl	Total Air ⁴
UHF UBF UBIF UBIW UBZF		(Employae, Bldg, Materia Upper Stair F 11 Hall f 11 Beth 11 II bedroom 11 II bed 2 11 II 2	Floor 1.05 Floor 1.05 Window 0.25 Floor 1.05 Window 0.25 Floor 1.05 Chinday 0.25 Chinday 0.25 Chinday 0.25 Chinday 0.25	gy - Syl	Total Air ⁴
UHF UBF UBIF UBIW UBZF		(Employae, Bldg, Materia Upper Stair F 11 Hall f 11 Beth 11 II bedroom 11 II bed 2 11 II 2	Floor 1.05 Floor 1.05 Floor 1.05 Floor 1.05 Floor 1.005 Floor 1.05 Floor 1.05 Floor 1.05	gy - Syl	Total Air ⁴
UHF UBF UBIF UBIW UBZF UBZW UBZF UBZW	For Aqu	(Employae, Bldg, Materia Upper Stass F 11 Hall f 11 Beeth 11 11 Bed room 1 11 Oct 2 11 11 2 11 11 3 11 11 3	Floor 1.05 Floor 1.05 Floor 1.05 Vindous 0.25 Floor 1.05 Vindous 0.25 Floor 1.05 Vindous 0.25 Floor 1.05 Windows 0.25 Floor 1.05 Windows 0.15	Sylven Sy	Total Air ⁴
UHF UBF UBIF UBIW UBZF UBZ W UBZ W		(Employae, Bldg, Materia Upper Stass F 11 Hall f 11 Beeth 11 11 Bed room 1 11 Oct 2 11 11 2 11 11 3 11 11 3	Floor 1.05 Floor 1.05 Floor 1.05 Window 0.25 Floor 1.05 Clin 0.25 Floor 1.05 Window 0.25 Clin 0.25 Clin 0.25 Clin 0.25 Clin 0.25 Clin 0.25	Sylvesty Sylvesty Sylves and splice analysis.	Total Air ⁴
UHF UBF UBIW UBIW UBZF UBZW UBZW	For Aqu	(Employae, Bldg, Materia Upper Stass F 11 Hall f 11 Beeth 11 11 Bed room 1 11 Oct 2 11 11 2 11 11 3 11 11 3	Floor 1.05 Floor 1.05 Floor 1.05 Vindous 0.25 Floor 1.05 Vindous 0.25 Floor 1.05 Vindous 0.25 Floor 1.05 Windows 0.25 Floor 1.05 Windows 0.15	Sylvesty Sylvesty Sylves and splice analysis.	



SCHNEIDER LABORATORIES GLOBAL, INC.

2512 West Cary Street, Richmond, Virginia 23220-5117 804-353-6778 • 800-785-LABS (5227) • Fax 804-359-1475 www.slabinc.com • Info@slabinc.com

PANEL STATE	1111100	4(13)	In the second second	TOD POLYMEN		
	SUREDD		Kous	25	Q-YES ONO	
			276	7 Phone	316 833 144	15
	T		Email 164//	ins @ Solledd	. 0.00	
Project Name	Accine o	Lalderell	PO#		\sim	
Project Location	223 Uz6	6 Caldwell	Special Instructions:			
Project Number			-			
Collected By	Jereny Du	llins				
		A THE SECTION ASSESSMENT				
□ 2 Hour*	☐ Air	Asbestos in Bulk	Metals Total	TCLP	Microbiology	
☐ Same day *	☐ Paint	☐ PLM	Lead	□ Lead	☐ BACT (MPN/PA)	
1 business day	☐ Soil	☐ PLM Qualitative	☐ RCRA 8 Metals	☐ RCRA 8 Metals	☐ Mold Direct Exam	
2 business days	ZT Wipe	☐ 400 Point Count	☐ Chromium Vi	☐ Full TCLP	☐ Allergens	
3 business days	['] □ Bulk	☐ 1000 Point Count	☐ Mercury	(w/ organics 10 Day)	Sub-Contract	1997
☐ 5 business days	☐ Waste Water	☐ Gravimetric Prep	0		☐ TEM Chatfield	
• not available for all tests	☐ Ground Water	Asbestos in Air	Gravimetric	Miscellaneous	☐ TEM AHERA	
** pest 3 PM the TAT will begin next business day	☐ Drinking Water	□ PCM	Total Dust NIOSH 0500	☐ Silica FTIR (7602)	☐ TEM 7402	
Please schedule rush tests	☐ TSP / PM10	☐ PCM-B Rules	Resp. Dust NIOSH 0600		☐ Silica XRD (7500)	
in advance			WOOD! 6000			
						- 1
		Sample Identifica (Employee, Bidg, Materic				Total Air ⁴
					(1) (1) (1) (1) (1)	Fotal Air ⁴
	0852422 9130	(Employee, Bidg, Materia				Cotal Air ⁴
	0852422 9130		Flory 10545			otal Air ⁴
USGR USGR	082212 9130	Upper Storage	Floor 1.05y/s			Cotal Air ^A
USSP UBY F UBY W	082212-9130	Upper Storage 15 Bed 4	Floor 1.05aft Floor 1.05aft County 0.25 Saft			Total Air ^A
USGR UBY F UBY W QPS R	082422 9130	Upper Storage	Floor 1.05aft Floor 1.05aft County 0.25 Saft			Cotal Air ^A
USSP UBY F UBY W		Upper Storage 10 Bed 4 11 11 4 Besen of Stad	Floor 1.05gfr Winds 0.25 Soft			Cotal Air ^A
USSP UBY F UBY W QPS F BB F		Upper Storage 10 Bed 4 11 11 4 Besen of Stad	Floor 1.05gfr Winds 0.25 Soft			Total Air ^A
USGR UBY F UBY W QPS R		1. Bet 4 11 11 4 Bessen of Stad Bastment Bastment	Floor 1.054/= Floor 1.054/= Floor 1.054/= Coindo 0.255gf Ploor 1.054/= Floor 1.054/= Cindo 0.255att			Total Air ^A
USSP UBY F UBY W QPS F BB F		Upper Storage 10 Bed 4 11 11 4 Besen of Stad	Floor 1.054/= Floor 1.054/= Floor 1.054/= Coindo 0.255gf Ploor 1.054/= Floor 1.054/= Cindo 0.255att			Fotal Air ^A
USSP UBY F UBY W QPS F BB F		1. Bet 4 11 11 4 Bessen of Stad Bastment Bastment	Floor 1.054/= Floor 1.054/= Floor 1.054/= Coindo 0.255gf Ploor 1.054/= Floor 1.054/= Cindo 0.255att			Total Air ^A
USSP UBY F UBY W QPS F BB F		1. Bet 4 11 11 4 Bessen of Stad Bastment Bastment	Floor 1.054/= Floor 1.054/= Floor 1.054/= Coindo 0.255gf Ploor 1.054/= Floor 1.054/= Cindo 0.255att			Fotal Air ^A
USSP USY F USY W QPS F BB W F	For Aqui	Comployee, Bidg. Materia Upper Storage Is Bad 4 II II 4 Beson of Stad Basement Casemin 1 Furnin 1	Floor 1.054/7 Floor 1.054/7 Cointy 0.25 Saft Floor 1.0 Saft Floor 1.0 Saft Clon 1.0 Saft Clon 1.0 Saft Clon 1.0 Saft	plicate and spike analysis		Total Air ^A
USSP USY F USY W QPS F BB W F		Comployee, Bidg. Materia Upper Storage Is Bad 4 II II 4 Beson of Stad Basement Casemin 1 Furnin 1	Floor 105g/F Floor 1.05g/F Coindo 025 Safe Place 1.0 Safe Floor 1.0 Safe Floor 1.0 Safe Clon 1.0 Safe		e in min × flow in L/min]	Total Air ^A
USGR UBY F UBY W QPS R BB W F	For Aqui	Comployee, Bidg. Materia Upper Storage Is Bad 4 II II 4 Beson of Stad Basement Casemin 1 Furnin 1	Floor 1.05 aft Floor 1.05 aft Co.info 0.25 Saft Floor 1.0 Saft Floor 1.0 Saft Clon 0.25 Saft Clon 1.0 Saft Clon 1.0 Saft			Total Air ^A

LGISVS



1 of 5

SUMNER COUNTY KANSAS

Report for Parcel No. 096-321-02-0-20-16-001.00-0

Property Physical (Situs) Address

223 N WEBB ST, Caldwell, KS 67022

THOMPSON, ARCINE R & TAMMY R - (P) Owner(s)

Owner Mailing Address CALDWELL, KS 67022 223 N WEBB ST

Topography	Property Factors Level - 1
Utilities	All Public - 1
Access	Paved Road - 1 Alley - 7
Fronting	Residential Street - 4
Location	Neighborhood or Spot - 6
Parking Type	On and Off Street - 3
Parking Quantity	Adequate - 2
Parking Proximity	On Site - 3
Covered Parking	Not Available
Uncovered Parking	Not Available

(Quick Ref. ID R17051)

Generated: 8/18/2022 2:28:30 PM

NEW CALDWELL, BLK 110-131, S02, T35, R03W, BLOCK 119, LTS 41,43,45,47 Tract (Legal) Description

经上线	Land-Based Classification
Function	Single family residence (detached)
Activity	Household activities
Ownership	Private-fee simple
Site	Developed site - with buildings
Ge	General Property Information
Property Class	Residential - R
Living Units	1
Zoning	Not Available
Neighborhood	170
Tax Unit Group	003

Appraisal Information

Tax Year 2022

Tax Year 2021

M Aumentum

2 of 5

Land Building Total Class Land Building Total	64 980 70 860	5,880 6	70	73,400	67,280	6,120 67,280	R
	ilding Total	Land B ₁	Class	Total	Building	Land	Class

Deed Information

0627	Book 1
0142	Page 1
	Book 2
	Page 2
	Book 3
	Page 3
	Book 4
-	Pag

Building Permit Information

99999	Permit Number
1- (/) 	Amount
08/15/2016	Issue Date
DWELLING REMODEL	Description

Market Land Information

Sqft	Method
Primary Site - 1	Туре
13997.0 0	AC/SF
	EffFF
	Depth DFact Inf 1
	Fact 1 Inf 2 Fact 2 O
6,120	Ovrd Class Value Est.

Dwelling Information

Dwelling No. 1

Quality	Res Type	
AV	Single-family Residence	Genera
Upper Fir. Living	Main Flr. Living	Information
102	977	

Arc	
Arch Style	2
	in P
OG O	Sales
Old Style	

Bsmnt. Type

Partial - 3



3 of 5

Calc. Area	Tot. Living Area	No. of Units	LBCS Struct.	MS Style	Eff. Year	Year Built	SUN
1,974	- Appendix		Detached SFR unit	Two Story		1905	UMNER COUNTY KANSAS
MU CIs/Pct.	Assessment Class	Percent Complete	Remodel	Ovr Pct. Gd./RCN	Phys/Func/Econ	CDU	VITY KANSAS
			2016	/204,108	FR	AV	SAN THE SAN TH
Foundation	Garage Cap	Half Baths	Full Baths	Family Rooms	Bedrooms	Tot. Rooms	Ge
Block - 3	0	0	2	Jun a	ω	9	Generated: 8/18/2022 2:28:30 PM

Foundation	Garage Cap	Half Baths	Full Baths	Family Rooms	Bedrooms	Tot. Rooms
Block - 3	0	0	2	-	ω	9

5
*
œ
2
Q
_
-
Ω
0
Ĭ
류
×
One
7
12
=
W
_
3
nfo
0

Wood Deck (SF) with Roof	Galvanized Metal	Wood Deck (SF)	Open Slab Porch (SF)	Open Slab Porch (SF)	Automatic Floor Cover Allowance	Plumbing Rough-ins (#)	Plumbing Fixtures (#)	Heat Pump	Raised Subfloor (% or SF)	Total Basement Area (SF)	Composition Shingle	Frame, Siding, Vinyl	Wood Deck (SF) with Roof	Code	
342		32	216	336		1	œ		1,974	482			112	Units	The state of the s
	и							100			95	100		Pct.	Policine Tillo
		ω												Quality	
		1990												Year	

LOIS

M Aumentum

Generated: 8/18/2022 2:28:30 PM

4 of 5

SUMNER COUNTY KANSAS MILLION

Dwelling 1 / Building Improvements Info.

	07	t	ē
	Farm Implement Building	Site Improvements	Occupancy
	טי	C	MSQs
	2.00	2,00	Range
		-	ş
	1980	1990	Yr Bit
	768	384	Eff Yr LBCS Area
	112		Perin
	D O	00	五
	32 X 24	32 X 12	Dim.
1		-	Storries
	u	w	tories Phys
•	J.	ω	Funct Econ OVR Run
14.	=	4,1	Σ Ω
11,000		4,308	2
Ļ	3	16	ğ
2,000	2 000	690	Y Silve

SUMNER COUNTY KANSAS THE STATE OF THE SUMMER COUNTY KANSAS

Lais



5 of 5

Generated: 8/18/2022 2:28:30 PM



SCHNEIDER LABORATORIES GLOBAL

2512 West Cary Street, Richmond, Virginia 23220-5: 804-353-6778 • 800-785-LABS (5227) • Fax 804-359-1 www.slabinc.com • info@slabinc.com

	SUREM					Exterior: I SWP W/
				Konsa		Exterior: LSWP Wrap the beam for the fro ceiling.
				2767		Exterior: LSWP Replace all deteriorated wo
roject Name	17		Email	bulling	<i>(a)</i>	
roject Location	Arcine &	Lummy Thompson	PO#		A 1000	Exterior: Replace front door with insulated son side and back doors.
oject Number	1000 Web	Caldwell	Special Instr	ictions:		Exterior: Install a hand rail on both sets of st
						110000,
lected By	Jeruny	Bullins				Exterior: Install guttering on the side porch of
						Interior Electrical: Secure any loose fixture switches are working as designed. All Recepts
2 Hour *	POWER SHEET	Asbeito in Ball	Mayer A	AND NA		DPEN ground outlets need to be grounded, or pen J-Boxes in attic and basement. Install a
Same day *	☐ Paint	. 🗆 PLM	Ze leid		Lead	in allo and pasement. Install a
1 business day	☐ Soll	PLM Qualitative	☐ RCRA 8 N			terior: Install handrail on top section of stair
2 business days	Z Wipe	□ 400 Point Count	☐ Chromiur	n VI	Enth	
3 bsisiness days	□ Bulk	1000 Point Count	. C Mercury	(w/	organic In	terior: Remove Vermiculite insulation in attic
5 business days	☐ Waste Water	Gravimetric Prep			A	echanical: Replace deteriorated furnace with C with new coil and line set.
ot available for all tests	Ground Water	ZASUSSION IN ALT	MATERIAL		(Lists	and the set
t 3 PM the TAT will begin next bininess day.	Drinking Water	☐ PCM	Total Dus NIOSH 05	00 10	Silic	
la schedule rush tests In advance	TSP/PM10	☐ PCM-B Rules	Resp. Dus NIGSH 06	oo 🗆 🗆	101	al of Part 1
					Par	2 Lead Activities
		Sample identifica (Employee, Aldg. Materia	tion		Cos	s for using lead safe work practices.
SE	1242 9/30	· 1985年 - 1985年 - 1985年	387 TO 961	ing Angle	ÇUS	for preparing for clearance.
	7170		104/ /10	Sep	Tota	of Part 2
4 5		11 Hall t	00 V /1	Sit	Total	
DP		11 Bath 1	GOC 1.	Salve	Total	of part 1 and 2
B W		111		555/		
IF		11 11	Cr.		7	
R 1-61		Des more	(1)	0 29/	-	
N2 C		11 1 1 5	nday ()	8 547	Compa	nny
n o II		1 val C	1000 1.0	59/		
J L W		11 11 6	In O.	2559	Contac	1
		" " 3	Floor 110	Saft		
037		THE RESERVE OF THE PARTY OF THE	11.1 1 A 78.00	1		
53 F	$V \mid V \mid$	" " 3	Wink O.	25 5015	Signatu	re e
03 W	For Adu	eous and solid samples ensure	Gradia Or enough sample la	25 Soft	Signatu	e



SCHNEIDER LABORATORIES GLOBAL, INC.
2512: West Cary Street, Richmond, Virginia 23220-5117
804-353-6778 • 800-785-LABS (5227) • Fax 804-359-1475
Www.slabinc.com • Info@slabinc.com

	Ko	nsa s		□-YES	□ NO
52. 424 v · · · · · · · · · · · · · · · · · ·	2		Phone	316 8	33 1445
	Email 16		Schedo	1.000	
& Tenmy Thompson		_1		~	
of Coldwell	Special Instructions				× ×
		·			
lling					
Aspestos in Boile	a Andrews		1.4	M	crobiology
D PLM	Lead	Z Lead			
☐ PLM Qualitative					
☐ 400 Point Count				Laure Laurence	Commence of the Commence of th
	☐ 'Mercury	(M) oranics :	(All All All All All All All All All Al	-	b-Contract
	Accel PATE CONTR	2423 8050°57°50608°	94-00 9-0 00 8-00		
	2021 17 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	- Table 1			
	NIOSH 0500		11K (7002)	7.1	2. 4
Ti reast-p viriles	NIOSH 0600		****		D (1000)
Sample identifica	ition				
[1] J. J. J. G. W. M. Martin, Phys. Rev. B 58 (1995)	The second secon		14 40	45	Total Air
			,	4	
Unes Storme	How losu				
16 B. 1 4	0.4	17			
11 11 4	O		-		
R		011			
Basement	Ploof 1.05	pt			
Baskant	W.W/4 0.25-Se	for			
Farnon 1	Floor 1.05	11			
	2 M				
	# 1403 NO. 10 A. W. T. W. T.		alled han allede	Augustation for	N. West 201
		CARRE BARRIES	CONTRACTOR CONTRACTOR	or the factor of the same of t	
Aqueous and Solid samples one na), E=Excursion ² Beginning/E	nd of Sample Period	Iters/Minute Vo	ume in Liters (t	lme in min × flow	in L/min]
	Asbestos in Bulk PLM PLM Qualitative 400 Point Count Gravimetric Prep Abjestos in Alf PCM PCM-B Rules Sample identifica (Employee, Bidg Materia Ligan Strong Sal Y II I Y Bussem T. Stal Bassement Cassement Cassement	Asbestos in Bulk Special Instructions	Asbestos in Bulk Metals Total Lead Lead PLM Qualitative RCRA 8 Metals RCRA 1 1000 Point Count Chromium VI Full TO (W/ originis 1) PCM PCM Rose R	Email: 16ulling @ Scilled @ Special Instructions: Aspestos in Bulk	Email Souther (a) Sciled of Sole of

223 N Webb Caldwell ks

					_	- 1					
Reading N	ShutterCal	83.83 cps	Component NA	NA Substrate	Condition	Color	Results	Depth Inde	Action Levi PbC		
	Paint	1.04 mg/cm ^2	Calibration	Card	Fair	white	Nagative	1	1	0.03	0.03 Calibration
	Paint	0.42 mg / cm ^2	Calibration	Card	Fair	Yellow	Positive	1.19	1	1.4	1.4
	Paint	5.23 mg / cm *2	Calibration	Card	Fair	Red	Positive	1.11	1	0.1	0.1
5	Paint	1.05 mg/cm *2	Utility Exterior Door	wood	Fair	grey	Negative	1	3	0.03	0.03 Interior
6	Pains	6.84 mg/cm ^2	Utility Closet Door	wood	Fair	BERN	Negative	1	1	0.03	0.03
7	Paint	1.05 mg/cm ^2	Uttility Closet Shelf	wood	Fair	white	Negative	1	1	0.03	0.03
	Paint	1.04 mg/cm ^2	Uttility Closet Paneling	wood	Fair	grey/white	Negative	1	1	0.03	0.03
	Paint	1.04 mg/cm ^2	Utility Trins	wood	Fair	stain	Negative	1	1	0.03	0.03
	Paint	1.04 mg/cm ^2	Utility Cabnet Orop seling track	metal	Fair Fair	stain white	Negative Negative	1	1	0.03	0.03
1.0	Paint	0.84 mg / cm ^2	Utillity/Kitchen Jam	wood	fair	grey	Positive	6.19	1	6.15	6.03 6.15
	Paint	1.04 mg/cm ^2	kitchen trim	wood	Fair	dock stain	Negative	1	1	0.03	0.03
34	Paint	1.05 mg/cm ^2	Kitchen sanaling	wood	Fair	white	Negative	1	1	0.03	0.03
	Paint	1.04 mg/cm 42	Upper Cabanits	wood	Fair	dark stain	Negative	1	3.	0.03	0.03
	Paint	1.04 mg / cm *2	lower Calenits	Wood	Fale	dark stain	Negative	1	1	0.03	0.03
	Paint	1.05 mg / cm ^2	Otchen window	wood	Fatr	dark stain	Negative	1	1	0.03	0.08
	Paint	1.05 mg / cm ⁴ 2	Drop celing track kitchen	metel	Fair	Grey	Negative	1	1	0.03	0.03
	Paint	1.05 mg/sm ^2 1.05 mg/cm ^2	Bath Door Stair Door	wood	Fair Fair	Grey	Magative	1	1	60.0	0.03
	Paint Paint	1.04 mg/cm ^2	Stair Door Trim	wood	Fair	Brown	Negative Negative	1.72	1	0.18	0.18
	Paint	1.05 mg/cm ^2	Sath Jam	wood	Fair	utula	Negative	1	1	0.03	0.03
	Paint	0.62 mg/cm ^2	Bath Door Trim	Wood	Fair	stain	Null	1	1	0.07	0.07
	Paint	1.05 mg / cm ^2	Tin Tiles Drop ceiling	metel	Fale	170°	Hingstive	1	1	0.03	0.03
25	Paint	1.04 mg/cm ^2	Medicine Cabnet	wood	Fair	Red	Negative	1.46	1	0.08	0.08
26	Paint	1.26 mg / cm ^2	Wall Kitchen	sheetrock	Fair	White	Negative	1	X.	0.03	0.03
	Paint	1.06 mg / cm *2	Living room Trim	wood	Fair	brown	Negative	1.56	1	0.14	0.14
	Paint	1.05 mg/cm ^2	Living room/Kitchen Jam	wood	Fair	Brown	Negative	1.93	1	0.17	0.17
	Paint Brint	1.04 rag / cm ^2 1.04 rag / cm ^2	Living room Floor Trim Living room/Door Jam	boow	Fair	Brown	Negative	3.59	2	0.25	0.25
	Paint Paint	1.05 mg/cm *2	Uving Room /Dining Floor	wood	Fair	Brown Stain	Negative Negative	2	1	0.07	0.07
	Paint	1.05 mg/cm ^2	Living Room/Window Sill	wood	fair	Brown	Negative	2.69	1	0.22	0.03 0.22
	Paint	1.05 mg / cm ^2	Living Room/Window Sash	wood	Fair	Brown	Negative	1.89	1	0.18	6.18
	Paint	1.05 mg / cm *2	Living Room/Window Sash	Wood	Fair	Brawn	Negative	2.86	1	6.56	0.56
35	Pairst	1.05 mg/cm ^2	Living Room/Window Trim	boow	Fair	Brawn	Negative	2	1	0.22	0.22
36	Paint	1.05 mg/cm *2	Living Room/Window Sash	wood	fair	Brown	Negative	2.1	1	0.12	0.12
	Paint	1.05 mg/cm ^2	Living Room/Window Trim	Wood	Fair	Brown	Negative	1.97	1	0.16	0.16
	Paint	1.04 mg/cm ^2	Den window Trins	wood	Fair	Stain	Negative	1	1	0.11	0.12
	Paint Paint	3.13 mg/cm *2 1.05 mg/cm *2	Den Window Sash Den Window Frim	wood	fair Fair	stain	Negative Negative	1.64	1	0.12	0.1
	Puist	1.04 mg/cm *2	Den Window Sash	wood	fair	stan	Negative	1.6	1	0.18	0.12
	Paint	1.04 mg / cm *2	Den Wood Trim	wood	Fair	State	Nagativa	1.27	1	0.17	0.17
43	Paint		Living room Exter Door	wood	Fuir	Brown	Negative	1.36	1	0.1	0.1
44	Paint	0.42 mg/cm ^2	Living room Exter Door Jam	wood	Deterioated	White	Positive	2.38	1	11.4	11.4
45	Paint	0.21 mg/cm^2	Living room Exter window	boow	Deterioated	white	Positive	2.13	1	10.2	10.2
	Paint		Living room/Kitchen Trim	wood	fair	white	Negative	1.45	1	0.12	0.12
	Paint.		Stali up banister	wood	Fair	Brown	Megative	2.7	1	0.23	0.23
	Paint Paint		Stair up mullion Stair Tred	wood	fair fair	brown	Negative Negative	5.06	1	6.35	0.35
	Paint		Stair Riser	wood	fair	white	Negative	1.55	9	0.12	0.12 0.16
	Paint	4	Stair Panesaling	wood	fair	Seige	Negative	1	1	6.03	0.03
5.2	Paint	1.05 mg / cm *2	Ceiling	sheetrock	Fair	white	Negative	1	1	9.93	0.02
53	Paint	1.04 mg/cm ^2	Hall Trim	wood	Fair	staln	Negative	1	2	0.1	0.1
	Paint		Half Jam	wood	fair	staln	Negative	1	1	0.1	0.1
	Paint		Hall floor	wood	feir	stain	Negative	3.4	1	0.17	0.17
	Paint Paint		Bedroom 4 Door Bedroom closet door	wood	fair fair	stain	Negative	1.2	1	0.14	0.14
	Paint	-	Sedmon closet shelfs	wood	fair	stain	Negative	1	1	0.09	0.09
	Paint		Storage Closet	wood	fair	white	Positive	1.91	1	1	0.03
	Paint		Storage Closet Trim	wood	fair	white	Positive	2.57	1	3	3
	Paint		Attic hatch	wood	fair	white	Nagative	1	1	0.03	0.03
62	Paint	1.05 mg / cm *2	Door Trim	wood	fair	brown	Regutivo	2.47	1	0.31	0.31
63	Paint	1.04 mg/cm *2	Door Trim	wead	fair	brewn	Negative	1.63	1	0.2	6.2
	Paint		up steir bath Meical cabnet			STain	Negative	1.72		0.17	0.17
	Paint		Basement Door Jamb	wood	fair	stoin	Negativa	1.14		0.12	0.12
	Paint Paint		Wood Stairs Sides Wooden Work bench	wood	Pinir	stain	Negative	1		0.03	9.03
	Paint Paint	and the same of th	Wall basement	wood concrete	gair poor	stain white	Negative	1		0.03 0.03	0.03
	Paint		Siding	wood	fair	white	Negative	1		0.03	0.03 Exterior
	Paint	-		wood	fair	brown	Negative	3		0.03	0.03
	Paint				fair	Brawn	Negative	1		6.03	0.03
72 1	Paint	1.05 mg/cm *2	Porch Bannister	wood	tali	stain	Negative	1		0.03	0.03
	Paint	40.0		wood	Deterioated	white	Positive	1.9	1	1.9	1.9
	Paint				Deterioated		Positive	2.49	å	5.6	5.6
	Paint				Deterioated		Positive	3.43		13.5	13.5
70 1	Paint	erner milit tem 7	Calibration	card	Fastr	white	Negative	1	1	8.03	0.03

223 N Webb Caldwell ks

77 Paint 0.21 mg/cm ⁶2 Calibration Card Fair yellow Positive 1.34 1 3.45 3.45 78 Paint 5.86 mg/cm ⁸2 Calibration eard Fair Red Negative 1.04 1 0.1 0.1

Kansas Department of Health and Environment State of Kansas

Expires on July 26, 2023

Be it known, that having filed an application with the Kansas Department of Health and Environment,

SOUTH CENTRAL KANSAS ECONOMIC DEVELOPMENT

is hereby licensed as a

LEAD ACTIVITY-FIRM

Issued on July 26, 2021

Name

SOUTH CENTRAL KANSAS ECONOMIC DEVELOPMENT DISTRICT

License Number

Secretary of the Kansas Department of Health and Environment Lee A-Norman, M.D.

Radioactive Materials License

Supplementary Sheet

License Number: 22-B827 Amendment No. 9

12. Radioactive material listed in Item 6 above is authorized for use by individuals for the materials and uses described as follows:

Radioactive material shall be used by, or under the supervision and in the physical presence of an individual listed below or an individual who has completed training provided by a person specifically authorized by the department, USNRC or another Agreement State to provide such training and approved by the radiation safety officer.

Mike Shivers

Subitem(s) A

- The licensee shall perform testing for leakage or contamination of sealed sources in accordance with K.A.R. 28-35-216a.
- 14. Scaled sources containing radioactive material shall not be opened or removed from their respective source holders by the licensee.
- 15. The licensee shall conduct a physical inventory every six (6) months to account for all sealed sources received and possessed under the license. The records of the inventories shall be maintained for two years from the date of the inventory for inspection by the department, and shall include the quantities and kinds of radioactive material, location of sealed sources and the date of the inventory.
- 16. The licensee may transport radioactive material or deliver radioactive material to a carrier for transport, in accordance with the provisions of K.A.R. 28-35-196a, "Preparation of Radioactive Material for Transport".
- 17. The licensee shall comply with the provisions of Kansas Radiation Protection Regulations, Part 4, "Standards for Protection Against Radiation" and Part 10, "Notices, Instructions and Reports to Workers; Inspections."
- 18. The licensee shall possess and use radioactive material described in Items 6, 7 and 8 of this license according to the most restrictive of; the Kansas Radiation Protection Regulations, this license or statements, representations, and procedures contained in the following documents.
 - The application received December 12, 2016, signed by Micheal Shivers, with attachments.

FOR THE STATE DEPARTMENT OF HEALTH AND ENVIRONMENT

Date February 8, 2017

By:

Jason Barney, RRFT Radiation Control Program

Kansas Department of Health and Environment State of Kansas

Expires on September 23, 2023

Be it known, that having filed an application with the Kansas Copartment of Health and Environment.

JEREMY BULLINS

is hereby certified as a

RISK ASSESSOR

Issued on September 23, 202

Name

WEREMY BULLINS

Certification Number

Secretary of the Kansas Department of Health and Environment ... Lee As Norman, M.D.



Performance Characteristic Sheet

FFECTIVE DATE:

September 24, 2004

EDITIONNO .: 1

MANUFACTURER AND MODEL:

Make:

Milon LLC

Tested Model: XLp 300 Source:

Note:

This PCS is also applicable to the equivalent model varietions indicated below, for the Lead-In-Paint K+L variable reading time mode, in the XLI and

XLp series:

XLI 300A, XLI 301A, XLI 302A and XLI 303A. XLp 300A, XLp 301A, XLp 302A and XLp 303A. XL1700A, XL1701A, XL1702A and XL1703A. XLp 700A, XLp 701A, XLp 702A, and XLp 708A.

Note: The XLI and XLp versions refer to the shape of the handle part of the instrument. The differences in the model numbers reflect other modes available, in addition to Lead-in-Paint modes. The manufacturer states that specifications for these instruments are identical for the source, detector, and detector electronics relative to the Lead-in-Paint mode.

FIELD OPERATION GUIDANCE

OPERATING PARAMETERS:

Lead-in-Paint K+L variable reading time mode.

XRF CALIBRATION CHECK LIMITS:

0.8 to 1.2 mg/cm² (inclusive) The collaration of the XRF instrument should be checked using the point film nearest 1.0 mg/cm² in its NIST Standard Reference Material (SRM) used (e.g., for NIST SRM 2579, use the 1.02 mg/cm² film).

If readings are outside the acceptable calibration check range, follow the manufacturer's instructions is bring the instruments into control before XRF testing proceeds.

SUBSTRATE CORRECTION:

For XRF results using Lead-in-Paint K+L variable reading time mode, substrate correction is not needed for: Brick, Concrete, Drywall, Metal, Plaeter, and Wood

Results not corrected for substrate bias on any concrete substrate bias on any concrete substrate bias on any substrate bias on any concrete substrate bias on any substrate bias on any concrete substrate bias on any substrate bias on any substrate bias on any concrete substrate bias on any concrete substrate bias on any sub	INCONCLUSIVE RANGE OR THRESHOLD: K+L MODE	SUBSTRATE	THRESHOLD (mg/cm²)
	Results and corrected for substrate bias on any	Concrete Drywall Metal Plaster	1.0 1.0 1.0

	w			

BACKGROUND INFORMATION

EVALUATION DATA SOURCE AND DATE:

This sheet is supplemental information to be used in conjunction with Chapter 7 of the HUD Guidelines for the Evaluation and Control of Lead-Based Paint Hezards in Housing ("HUD Guidelines"). Performance parameters shown on this sheet are calculated from the EPA/HUD evaluation using archived building components. Testing was conducted in August 2004 on 133 testing combinations. The instruments that were used to perform the testing had new sources; one instrument's was installed in November 2003 with 40 mCl initial strength, and the other's was installed June 2004 with 40 mCl initial strength.

OPERATING PARAMETERS:

Performance parameters shown in this sheet are applicable only when properly operating the instrument using the manufacturer's instructions and procedures described in Chapter 7 of the HUD Guidelines.

SUBSTRATE CORRECTION VALUE COMPUTATION:

Substrate correction is not needed for brick, concrete, drywall, metal, plaster or wood when using lead-in-Paint K+L variable reading time mode, the normal operating mode for these instruments. If abstrate correction is desired, refer to Chapter 7 of the HUD Guidelines for guidance on correcting XRF results for substrate blas.

EVALUATING THE QUALITY OF XRF TESTING:

Randomly select ten testing combinations for retesting from each house or from two randomly selected units in multifamily housing. Use the K+L variable time mode readings.

Conduct XRF retesting at the ten testing combinations extected for retesting.

Determine if the XRF testing in the units or house passed or failed the test by applying the steps blow.

Compute the Retest Tolerance Limit by the following sleps:

Determine XRF results for the original and retest XRF readings. Do not consci the original or retest results for substrate bias. In single-family housing a result is defined as the average of three readings. In multifamily housing, a result is a single reading. Therefore, there will be ten original and ten retest XRF results for each house or for the two selected units.

Calculate the average of the original XRF result and retest XRF result for each testing combination.

Square the average for each testing combination.

Add the ten squared averages together. Call this quantity C.

Multiply the number C by 0.0072. Call this quantity D.

Add the number 0.032 to D. Call this quantity E.

Take the square root of E. Call this quantity F.

Multiply F by 1.645. The result is the Refeat Tolerance Limit.

Compute the average of all ten original XRF results.

Compute the average of all ten re-test XRF results.

Find the absolute difference of the two averages.

	•		

If the difference is less than the Retest Tolerance Limit, the inspection has passed the stest. If the difference of the overall everages equals or exceeds the Retest Tolerance Limit, this procedure should be repeated with ten new testing combinations. If the difference of the overall averages is equal to or greater than the Retest Tolerance Limit a second time, than the hapection should be considered deficient.

Use of this procedure is estimated to produce a spurious result approximately 1% of the time. That is, results of this procedure will call for further examination when no examination is warranted in approximately 1 out of 100 dwelling units tested.

TESTING TIMES:

For the Laud-in-Paint K+L variable reading time mode, the instrument continues to read until it is moved away from the testing surface, terminated by the user, or the instrument software indicates the reading is complete. The following table provides testing time information for this testing mode. The time have been adjusted for source decay, normalized to the initial source strengths as noted above. Source strength and type of substrate will affect actual testing times. At the time of testing, the instruments had source strengths of 28.6 and 36.6 mCL.

		All Date		ng Mode (Seconds) Median for laboratory-messured leafleve (mg/cm²)			
Substrate	25 th Percentile	Median	75 th Percentile	Pb < 0.25	0.25 ≤ Pb<1.0	1.0 <pb< th=""></pb<>	
Wood Drywali	4	11	19	11	15	11	
Metal	4	12	18	9	12	и	
Brick Concrete Pleater	8	16	22	15	18	16	

CLASSIFICATION RESULTS:

XRF results are classified as positive if they are greater than or equal to the threshold, and negtive if they are less than the threshold.

DOCUMENTATION:

A document titled Methodology for XRF Performance Characteristic Sheets provides an explanation of the statistical methodology used to construct the data in the sheets, and provides empirical results from using the recommended inconclusive ranges or thresholds for specific XRF instruments. For a copy of this document call the National Lead Information Center Clearinghouse at 1-800-424-LEAD.

This XRF Performance Characteristic Sheet was developed by the Midwast Research Institute (MRI) and QuanTech, Inc., under a contract between MRI and the XRF manufacturer. HUD has determined that the Information provided here is acceptable when used as guidance in conjunction with Chapter 7, Lead-Based Paint Inspection, of HUD's Guidelines for the Evaluation and Control of Lead-Based Paint Hazards in Housing.



Laboratory Accreditation Programs, LLG

AIHA Laboratory Accreditation Programs, LLC 2512 West Cary Street, Richmond, VA 23220-5117 Schneider Laboratories Global Laboratory ID: LAP-100527 acknowledges that

along with all premises from which key activities are performed, as listed above, has fulfilled the requirements of the AIHA Laboratory Accreditation Programs (AIHA-LAP), LLC accreditation to the ISO/IEC 17025.2017 international standard, General Requirements for the Competence of Testing and Calibration Laboratories in the following:

LABORATORY ACCREDITATION PROGRAMS

INDUSTRIAL HYGIENE

ENVIRONMENTAL LEAD

Accreditation Expirer, July 01, 2023 Accreditation Expires: July 01, 2023

ENVIRONMENTAL MICROBIOLOGY Accreditation Expires. July 01, 2023

Accreditation Expires:

Accreditation Expires:

UNIQUE SCOPIES

FOOD

Specific Field(s) of Testing (FoT)/Method(s) within each Accreditation Program for which the above named laboratory maintains accreditation is outlined on the attached Scope of Accreditation. Continued accreditation is cartingent upon successful on-going compliance with ISO/IEC 17025;2017 and AHA-LAP, LLC requirements. This certificate is not valid without the attached Scope of Accreditation. Please review the AHA-1.AP, LLC website (www.gihancereditedlabs.org) for the most current Scope.

Chuye of Charten

Cheryi O Morton

Managing Director, AIIIA Laboratory Accreditation Programs, LLC

Date Issued: 07/01/2021

Revision 19: 09/01/2021

		<u>\$</u>			
				·	

-

Addendum 8 to Chapter 4

Library Specifications National Center for Healthy Housing (Formerly National Center for Lead-Safe Housing)

Spec Number: Unit of Measure:

Total Unit Cost: 0.00

Spec Title: Spec:

LEAD GENERAL REQUIREMENTS

Spec Number: Unit of Mossure: DU Total Unit Cost: 0.00

Spen Title: Spec

LEAD HAZARD DEFINITIONS

Adhesions the ability of an encapsulant to attach to or remain fixed on a surface without blistering, flaking, cracking or being removed by tape.

CFR. - The Code of Federal Regulations: The basic component of the Federal Register publication system. The CFR is a codification of the regulations of the various Federal Agencies.

HEPA - High Efficiency Particulate Air: A filter capable of filtering out particles of 0.3 missons or greater from a body of air at 99.97% efficiency or greater;

pg - Micrograms: The praise "micro" means "1/1,000,000 of" (one millionth of). A microgram is 1/1,000,000 of a gram;

Work Area: The area where lead-based point shatement or related work is performed which is defined and/or isolated to prevent the spread of lead dust or debris and entry by unauthorized personnel.

Spec Number: Unit of Measure: Total Unit Cost: 0.00 Spec Title: Spec;

9003

9001

9002

LEAD ABATEMENT STANDARDS & GUIDELINES

The execution of this work shall comply with all applicable state, federal and local host, rules regulations and guidelines for lead dust environments. Some of these standards include: OSHA 29 CFR 1926-Construction Industry Standards, 29 CFR 1926.62 Construction Industry Lead Standard, 29 CFR 1910. 1200-Herard Communication, 40 CFR Part 261-EPA Regulations, HUD Title X parts 1012-1013.

Spec Number: Unit of Measure: EA Total Unit Cost: 0.00 Spec Title: Spac:

S.W.P. - PROHIBITED TECHNIQUES

The following paint removal techniques are prohibited on all HUD-funded projects:

Open flamefulgh heat paint removal;

Power sanding or grinding without HEPA dust collections;

Uncontained water or abrasive blasting:

Day scraping or day sanding in excess of 2 sq. ft per room.

Spec Number: Unit of Measure: AL Total Unit Cost: 0.00 Spec Title:

HISTORIC STRUCTURE

Spect

This structure must be addressed in strict conformance to the "Guidelines for Rehabilitating Buildings." Lead hazard reduction techniques that damage, replace or enciose historic features are not permitted.

Spec Number: Unit of Measure: AL Total Unit Cost: 0.00

9006

Spec Title: Speci

REQUIRED SUBMITTALS .

Provide the following Contractor Submittals prior to the Presonstruction Conference: Copies of individual approved lead training certifications for workers and supervisors (Both EPA required training and OSHA required training);

2 Copies of the State Land Hazard Remediation Program Registration for

individuals and company; Copy of the written Occupant Protection Plan as required by 40 CFR Part 745 3, Subpert; Employee medical surveillance information; List of subcontractors;

Site specific General Liability and Lead Liability insurance certificates with the property owners listed as the certificate holder and the Agency names as Additionally insured;

7.

Worker's Componentian insurance cartificate; 100% Labor and Materials Payment Bond and Performance Bond (optimal 8.

dependent on size of project);
Any applicable parmin (including construction permits for window/door 9. replacements), licenses, cir.;

10. Any product data for materials or equipment to be used on the project.

11. Copy of valid Builder's License.

Spec Number: Unit of Measure: DU Total Unit Cost: 0.00 Spec Title:

Spec:

9007

FINAL ACCEPTANCE

Prior to final acceptance of the lead hazard reduction work, the property shall be visually inspected and if acceptable, random dust wips testing performed on floors, window sike and exterior window troughs. The contractor shall re-clean all components and pay for all additional clearance testing if test results exceed the thresholds of 40µg/SF for floor; 250 mg/SP for sills and 800 mg/SP for troughs.

Spec Number: Unit of Measure: AL Total Unit Cost: 0.00

Spec Tide: Spec:

OWNER'S RESPONSIBILITIES

The owner shall provide:

1. Utilities and sentary facilities;

2. All pecking of breakable and valuable items;

Fire incurance.

Spec Number: Unit of Measure: EA Total Unit Cost: 25.00 Spec Title: Spec:

9010

FLOOR PLAN REQUIREMENT

Provide the owner and this agency with the original and 4 copies of a 1/4" to 1 foot sale floor plan efectch using standard architectural symbols identifying all lead painted areas and components encapsulated or enclosed during this intervention.

Spec Number: Unit of Measure: EA 9011

Total Unit Cost: 0.00

Spoc Title:

LEAD FINES

Speci

The contractor agrees to incur and pay within 30 days the cost of all fines and work requirements resulting from regulatory noncompliance as fested by federal, state and local agencies.

Spec Number:

Unit of Measure: RA Total Unit Cust: 0.00 9012

9015

Spec Tide Speci

HAZARD EVALUATION - LEAD

Spec Number: Unk of Measure: EA

Total Unit Cost: 375.00 Spac Title:

XRF TESTING -< \$5,000

Field evaluate all painted components to be disturbed during the maintenance or resovation work. Provide the owner with tests results and a "Notice of Lead Hazard Evaluation" in accordance with the 1012-1013 Regulation Addenda. XRF must not

sequire substrate correction.

Spec Number:

Unit of Measure: DU Total Unit Cost: 500.00 Spec Title:

Spec:

TEST AND RISK ASSESSMENT

XRP evaluate all deteriorated paint areas and painted components to be disturbed during the removation work. Randomly salect 2 floors, 2 alls, 2 troughs and 1 other location to dust wips test per HUD Guidelines. Collect composits soil samples from bure soil at building perimeter and children's play area. Submit a dust wipe blank and other samples to a NLLAP approved lab. Prepare a risk assessment report isoluding both interim central and shatement options for each hazard and a "Notice of Lead Hazard Evaluation" per the 1012-1013 Regulation Addanda.

Spee Number:

Unit of Messure: EA Total Unit Cost: 275.00

Spec Title: Spec

CLEARANCE REPORT

After completion of all renovation that disturbs lead sorfaces, visually inspect all interior and exterior work to verify all work is completed and no lead, thing, visual dust or starie remains on alts. Rendomly select 2 floors, 2 sills, 2 troughe and 1 other location to fast wipe test per the BUD Guidelines. Suboult a field blank and tests to a NLLAP-approved lab. Prepare a clearance report per the 1012-1013 Appendix.

Spec Number: Unit of Meanure:

Total Unit Cost: 0.09

Spec Title:

PERFORMANCE GUARANTEES - LEAD

Spec Number:

9043

Unit of Measure: K Total Unit Cost: 90.00

Spec Title:

Spec

HAZMAT LIABILITY INSURANCE

Purchase and provide owner with certificates of specialized liability insurance for lead hazard reduction in an amount of at least \$1 million per occurrence, and \$5 million

ounual maximum.

Spec Number: Unit of Measure: M

9044

Total Unit Cost: 150.00 Spec Title:

Spec:

PAYMENT AND PERPORMANCE BONDS

Purchase from an U.S. Surety approved by the Treasury Department performance and payment bands using the ABC or AIA form in su amount of 100 % of the contract num.

Spec Number: Unit of Measure: AL

Total Unit Cost: 0.00 Spec Title:

Spec:

ABATEMENT CERTIFICATION

All contractors performing shatement on work over \$25,000 per unit hard cost shall provide a copy of their EPA certification and state license for the designated abatement supervisor and all abatement workers prior to commencement of work.

Spec Number:

Unit of Measure: Total Unit Cost: 0.00 Spec Title

Spec:

WORKER PROTECTION - LEAD

Spec Number: Unit of Measure: DU

Total Unit Cost: 275.00 Spec Title:

Spec:

LEAD WORKER - PROTECTION

Persons carrying out had hazard control scrivities must comply with all applicable faderal, sints, local laws and regulations related to safety in the workplace including tespinstory protection program, personal protection found in the OSHA Construction Standard (29 CFR 1926.62).

9054

9055

9053

Spet Number: Unit of Measure: EA Total Unit Cost: 25.00

Spec Title: Spect

EYE WASH REQUIREMENT

During all operations using caustic or volatile paint removal products, an emergency eye wash station meeting ANSI 2358.1-1990 standard rated at 15 minutes of flow must be placed on this work site.

Spec Number: Unit of Measure: AL

Total Unit Cost: 0.00 Spec Title:

Spec:

S.W.P. - PROHIBITED ACTIVITIES To misimize the potential for worker exposure to lead dust, the following activities are never permitted in any lead work area:

I. No eating No drinking 2.

No chawing gum, tobacco
 No smoking

No applying commetics

Post so OSHA compliance notice to workers as follows: Warning Lead Work Area - Poison - No Smoking or Eating

Spac Number: Unit of Measure: EA Total Unit Cost: 2.00

Spec Title:

PROTECTIVE CLOTHING

Speci

Each worker shall be provided with disposable, hooded, footed overalls during demolition, surface preparation, and paint removal activities. Impervious rubber book, gloves, fine shield, and chemical resistant overalls must be provided when dangerous chemicals are much.

Spec Number:

Unit of Measure: AL Total Unit Cost: 45.00 9057

Spec Title:

Spec

Worker training – interim controls

All permes carrying out lead hazard reduction activities must either be supervised by an EPA abstement supervisor or provide proof of completion of HUD-approved worker training course in lead bazard awareness, self protection and safe work practices prior to commencement of work.

Spec Number: Unit of Measurer EA Total Unit Cost: 0.00

9039

Spec Title: Spec:

S.W.P. - GROUND FAULT REQUIRED

Due to the requirement to work "wet," all electric circuits and extension cords in use

must be protected by GPCI with integral test buttons.

Spec Number:

Unit of Mensure: WK. Total Unit Cost: 22.00 9062

Spec Title:

Spec:

RESPIRATOR PROGRAM

All employees shall be fit tested and provided with personal respirators and filters as appropriate to task under a respirator program in accordance with 29 CFR 1910.134 and 29 CFR 1926.62

Spec Number: Unit of Measure: DY

Total Unit Cost: 400,00 Spec Title:

9063

Spec:

LEAD EXPOSURE MONITORING

Whenver Class I Tests (manual demolition, manual scraping or sanding, using heat gun or power tool with HEPA filter) are specified, contractor must provide full worker protection or exposure monitoring data. Contracton shall hire an outside firm to perior a determination of worker exposures using personal air sampling at a nominal flow rate of 2 liters per minute and a sampling train consisting of a 0.5u pore size filter housed in a closed-face 37mm cassette. Alternately, contractors may use data from provious jois that are similar in objective data, as specified in the OSHA standard to establish the personal protective equipment requirement.

Spec Number: Unit of Measure:

Total Unit Cost: 0.00 Spec Title:

OCCUPANT EDUCATION - LEAD

Spec:

Spec Number: Unit of Measure: EA

9076

Total Unit Cost: 35.00 Spec Title:

Spec:

OCCUPANT MAINTENANCE KIT

Provide occupant with: cleaning equipment, places to purchase refills and instruction in the use of the following equipment to combat lead dust hazards: 2.5 gallon, 2-sided bucket, sponge mop with 2 replacement heads, 3 packs of disposable sponges, liquid detergent, 2 sets of gloves and one vacuum cleaner exhaust filter.

Spec Number.

9077

Unit of Measure: DU Total Unit Cost: 21,00

Spec Title: Spec:

NUTRITIONAL PACKET AND VITAMINS

learned ecoupant in multiforal practices to alleviate lead polyening, e.g., avoid farty floods and sont high calcium sources like milk and figs. Provide a 60 day starter supply of chouselde, invenile, amhipie vitamins containing calcium and Vitamin C for each child

9078

Spec Number:

Unit of Measure: BA Total Unit Cost: 60.00

Spen Title: Spec:

OCCUPANT TRAINING - ON SITE

Schedule and deliver a 1.5 hour training session for both adult and child occupants covering the dangers of lead paint, blood mating opportunities, nutritional defenses and

cleaning protocols.

Spec Mamber:

Speci

Spen:

Spec:

9079

Unit of Messure: EA Total Unit Cost: 25.00

Spec Title:

OCCUPANT TRAINING - CLASSROOM

Substitute and deliver a 2 hour group training seasion for both adult and juvenile occupants. Materials should cover the dangers of lead paint, dust, soil, blood testing opportunities, nutritional defeases and cleaning protocols.

Spec Number:

Unit of Measure: EA Total Unit Cost: 22.00

Spec Title:

CHILD EDUCATION PACKET

Provide such child under age 10 with a lead activity packet appropriate to their age that might include: coloring books, stickers, pacifiers, pacifier clips and calendars.

Spec Number:

Unit of Meanire; EA

9083

Total Unit Cost: 15.00

Spec Title:

OWNER'S EDUCATION KIT

Provide the property owner of rental stock with an information packet that includes: current sity, state, federal statutes, a discussion of owner's liability, options to meet the HUD requirements and financing sources for lead basard reduction.

Spec Number: Unit of Measure:

Total Unit Cost: 0.00

WORK SITE PREPARATION

Spec Title:

Spec.

Spec Number: 9019

Unit of Measure: DY Total Unit Cost: 65.00

Spec Title: Spec:

DAILY RELOCATION

All occupents and pels must leave the dwelling each day prior to the start of work and only return after a therough HEPA vacuum of all areas involving work or worker

entrance

Spec Number. Unit of Measure: DY

9090

		*		

Total Unit Cost: 145.00

Succ Title:

TEMPORARY RELOCATION

Spec:

All occupants must be out of the work area while lead hazard reduction is underway. Children and program woman are specifically prohibind from entering the dwelling or any time during the reduction process, including times when work is not in progress. Provide moving and packing services to and from temperary housing unit. Pay all utility hooloup feet for both moves as well as dally rental costs.

Spec Number: 9103

Unit of Measure: AL Total Unit Cost: 0.00

Spec Title: Spec:

SECURE SITE

After the relocation of the eccupants, the contractor shall assume responsibility for

securing the site against that, vandalism, fire and other dangers.

Spec Number:

9104

Unit of Measure: RM Total Unit Cost: 235,00

Spec Title:

STORE FURNITURE

Spec: .

After owner removes and packs all valuable and breakable items, contractor shall pay for and arrange the removal and safe storage of all famishings, decorations and familian for duration of job in a boaded warehouse. After charance, replace furniture in original

position,

Spec Number:

Unit of Measure: EA Total Unit Cost: 195,00

Spec Title: Spec:

MINI CONTAINMENT

Construct a dest-tight space surrounding the work area with 6 mil. polyethylene and 2" tape. HEPA vacuum all visible work and containment surfaces after work is completed. Create 5' x 6' walk off mat at the work site exit with 2 layers of 6 mil. plastic.

Spec Number:

Unit of Meanire: RM Total Unit Cost: 45.00

Spec Title:

SET UP INTERIOR CONTAINMENT

Spec:

Make applicable natifications to state or local agencies, post job site signage and scare lead bezard reduction rites. Pre-clean floors, window sills, troughs and other areas of dust buildup with a HEPA vacuum. Scal all floors with two continuous layers of 6 mil. polyethylene taped to baseboard and 4" beyond door openings with 2" wide, easy alease masking tape. Close and seal HVAC registers. Wrap all built-in furniture, makingly and

fixed appliances with polyethylone and tape to create an airtight scal.

Spec Number:

9118

Unit of Measure: EA Total Unit Cost: 600.00

Spec Title:

ENTRANCE WITH WATER

Spec:

Construct a dust-tight, 8 x 8 x 8, job sutrance structure containing: a beach, first aid kit. HEPA vacuum, dispusable personal cleaning cloths, disposable abox covers, respirator storage, electrolytic drinks, a container for contaminated clothing and a shower will

filtered waste water.

Spec Number:

9120

Unit of Measure: EL

Total Unit Cost: 400.00 Spec Title:

EXTERIOR VERTICAL CONTAINMENT

Spec:

After installation of ground containment, hang a dispossible reinforced plastic sheet from 3' above the highest proposed weakstation on metal tube scaffolding secured to withsend a 40 mph gust. Meintain containment until elements impaction approval. Croste an outer barrier of fings or plantic tape 3' on center, 20' from work site. Close and look all windows and doors on work site elevation. Remove and replace daily.

Spen Number: Unk of Messure: DA

Total Unit Cost: 250.00 Spec Title:

Spec

GROUND CONTAINMENT

Attack two layers of 1.2' wide 6 mil polyathylane to the building perimeter with staples or fairing strips extending 10' past week station. Consensation a work size perimeter out of 4 x 4 timbers wrapped under the containment. Create an outer barrier of flags or playie tape 3' on center, 20' from work site. Close and lock all windows and doors on work site elevation. Remove and replace daily.

Spec Number:

Unit of Mountre: EA Total Unit Cost: 150.00

Spec Title: Spec:

CONTAINMENT ENTRANCE/EXIT

Create an 8" x 8" scaled off space adjustment to work area containing: a banch, first sidhit, HEPA vacuum, disposable personal cisming cloths, disposable thos covers, respirate storage, electrolytic drinks and a comminer for contaminated clothing. All access to job shall be through this area.

Spec Number: Unit of Messure: Total Unit Cost: 0.00

Spec Tida: Spec;

9125

9172

9123

HYDROBLASTING CONTADMENT After installation of granted containment, hang a disposable minimped plastic sheet from

3' above the highest proposed workstation to the ground on scattledding secured to withstand a 40 mph gust. Maintain containment until clearance inspection approval. Collect water and paint chips in plastic prior to filtering chips with landscape cloth.

Dispose of water per local requirements.

Spec Number: Unit of Measure: SF Total Unit Cost: .75

Spec Title: Bosc:

9120

FINAL CLEAN

After completion of all lead hazard reduction, feld, remove and wet mist all containment plastic, floors last. HEPA vacuum all visible surfaces including clothing, furniture, wile, floors and estings from the top down. Detergent scrub all horizontal surfaces in small sections using a 3 backet system changing rinso water every 250 sq. ft. Completely rise with elean water and new equipment. After surface is dry, HRPA vacuum all visible

surfaces except aciling.

Spec Number: Unit of Measure: RM Total Unit Cost: 65.00

Spen Title: Spec

STEAM CLEAN CARPET

Pre-clean carpet with a HEPA vacuum using a beater has at 4 min. per 10 sq. ft. Using a truck mounted stems generator, clean carpet using the steam extraction method. HEPA

vacuum after carpet drice at 1 minute per 10 ac. ft.

Spec Number: Unit of Messure: PR Total Unit Cost: 45.00

9132

Spec Title:

COMMERCIAL CLEAN CURTAINS

Spec:

Remove, package and send curtains to cleaning plant for removal of all surface dist and dust, Reinstell after clearance approval.

Spec Number:

Unit of Messure: EA Total Unit Cost: 20.00

Spec Title: Spec:

Furnace filter - replace

Dispuse of filter. HEPA vacuum rolum grill and hoveing and visible dust. Replace with high efficiency filter after completion of all lead reduction week.

Spec Number: Unit of Measure: Total Unit Cost: 0.00

Spec Title: Spec:

LEAD WASTE DISPOSAL

Spec Number:

Unit of Messure: BA Total Unit Cost: 75.00 9144

9143

Spec Title:

TCLP TEST

Span

Conduct a TCLP test on a sample of waste as per EPA protocol. The contractor and fie owner are judgity responsible for ensuring that all waste abstrated as becardous (graser than 5 ppm) is transported, manifested and delivered by Recased transporters to Recased

treatment, storage and disposal facilities.

Spec Number: Unit of Measures. DU Total Unit Cost: 200,00

Spec Title:

9147

Spec:

LEAD WASTE DISPOSAL

Wrap all architectural components in plastic to prevent dust ralease during transport Separate Category I and nonhazardous wasta. Essure that all waste both hazardous and nonhazardous is managed in accordance with state regulation. The contracter and the owner are jointly responsible for ensuring waste classified as passadons is transposed munifested and delivered by licensed transporters.

Spec Number:

Unit of Messure: CY Total Unit Cost: 400.00 9149

Spec Title: Spac:

SOLID WASTE DISPOSAL - HAZMAT

Dispuse of all Category I waste (paint chips, stripping sindge, HEPA debris and water filtrate) in compliance with state regulations. Store and secure waste in 6 mil bags or 55 gallon drums marked "Contains Lead - Systemic Pelson." Provide owner with a completed manifest verifying final waste disposition by a licensed hazardous material waste described as bezandous is transported, manifested and delivered by licensed

transporters to licensed treatment, storage and disposal facilities.

Spec Number: Unit of Meanure: Dil

9150

Total Unit Cost: 0.00

DAILY CLEANLID

Spec Title: Spec:

At the end of each work shift, remove all large debnis to the designated storage area Mist small debris and awarp to disposal baga. Mist and fold exterior ground containment prior to storage or disposal.

Spec Number:

9154

Unit of Measure: Total Unit Cost: 0,00 Spec Title:

Spec Title:

WALL & CEILING TREATMENTS

Spec Number: Unit of Measure: SF

Total Unit Cost: .35 Space Title:

Spec

REPAIR PAINT

After establishing my required floor containment, wet sorape all defective paint and apply a cost of acrylic latex paint per manufacturer's most current instructions.

Spee Number: Unit of Measure: SF Total Unit Cost: 1.20

Spec Title; Spec:

STABILIZATION — LIMITED SURFACE
Mist defective paint with eleaning solution to the point of saturation without dripping on
floor, Aggressively scrape all loose paint, walkaper and plaster with a draw scraper.
Feather edges with a 100 get sponge stading blook. Thoroughly rises and allow to dy.
HEPA vacuum. Spet prime and apply a premium scrylio later top coat per

manufacturer's instructions.

Spec Number: Unit of Measure: SF

Total Unit Cost: 0,50 Spac Tille;

Spec:

STABILIZE WALL, AND TRIM
Aggressively wet screpe all loose paint, wallpaper and plaster with a draw scraper.
Peather edges with a 100 goit sponge canding block. Detergent wash, rims and HEPA vacuum all visible chips and dust, Allow surface to day, spot prime and dry coat with premium actylic latest paint per manufacturer's instructions.

Spec Number:

Unit of Measure: SF Total Unit Cost: 0.60

Spec Title: Spec: 9163

9161

STABILIZE CEILING

Aggressively wet surspe all loose paint, wallpaper and plaster with a draw scraper. Feather edges with a 100 grit sponge studing block. Detergent wash, rings and HEPA vacuum all visible chips and dust. Allow surface to dry, apot prime and dry coat with premium acrylic later, point per manufacturer's instructions.

Spec Number: Unit of Measure: BA Total Unit Cost: 20,00

Spec Title:

Spec:

TEST PATCH ENCAPSULANT

Prepare surface, degreese and de-gloss; apply any recommended primer and encapsulate a 6" x 6" surface in accommon with manufacturer's specifications. After the

recommended curing period, test adhesion by cuting an "X" and attempting to lift, pact or test surface. If more than a 1/2" x 1/2" section is removed, the component must not be treated with the encapsulant. Request alternative treatment from avver/dealgner.

Spec Number: Unit of Messure: SF Total Unit Cost: 0.97

Spen Title:

Spec:

9174

ELASTOMERIC ENCAPSULANT

Prepare surface; degreese and de-gloss; apply any recommended primer and encaprolate surface to create a continuous sual over the surface in accordance with menufactural's

			*

tpacifications. Use the required number of costs and coverage rate of Education or to guarentes a manimum 20 year menufacturer's warranty.

Spec Number: Unit of Measure: SF Total Unit Cost: 2.25

9179

Spec Title: Spec

REDIFORCED BLASTOMERIC

Prepare surface; apply best cost with a M4" nap roller. Embed a reinforcing much in last cost, trin seems and edges. Apply the top cost in accordance with manufacturer's specifications. Use a Fiberment reinforced clastomeric.

Spec Number: Unit of Measure: &F Total Unit Cost: 1.95

Spec Title: Spen:

EPOXY ENCAPSULANT

Prepare surface, degreese and de-gloss. Apply any recommended primer and encapsular surface to create a continuous real over the surface in accordance with the manufacture's specifications. Use the number of costs and coverage rates of polyamida epocy to guarantee a minimum 20 year manufacturer's warranty.

Spec Number: Unit of Measure: SF Total Unit Cost: 2.26

Spec Title: Spac:

CEMENTITIOUS PLASTER

Propare surface; apply recommended primer and encapsulate surface in accordance with manufacturer's specifications. Use a camentitious plaster.

Spec Number: Unit of Measure: SF Total Unit Cost: 1.10

Spec Title: Врас;

VINYL WALLPAPER

Wet scrape all loose paint, planter and walkpaper. HEPA vacuum all visible chips. Mak or stonell "Land Paint" at 4' intervals. Spot paich irregularities. Install a Type I or II visyl wallpaper with manufacturer's recommended premixed adherive. Color and pattern chaise by owner from in-stock selections with a \$20 per double roll allowance.

Spec Number: Unit of Mensure: 8F

Total Unit Cost: 0.90 Spac Title:

WALL MAT - GYPSUM BASED

Spec:

Wet strape surface by continuously misting surface while scraping all loose paint, plater and wall covering. HEPA vocuum all visible chips. Mark or stencil "Lead Paint" at 4" intervals. Spot patch irregularities and feather edges by wet sanding. Apply gyptumbusined canvas or burisp in accordance with manufacturer's specifications.

Spec Number: Unit of Measure: Total Unit Cost:

9195

Spec Tide: Spen:

ENCLOSURES

Spec Number: Unit of Measure: EA 9197

Total Unit Cost: 1.10

LAMINATE 3/8" GREENBOARD

Spec Title: Spec:

Stenell "Lead Paint" at 4" intervals. Hung, tape and akin coat plaster finish 3/8" greenboard over surface using screws 8" on center. Remove/relustall all electrical

components as required. Scal all penalrations with alliconized acrylic canlle. Prime and top cost with skyd enamel paint.

Spec Number: Unit of Measure: SF Total Unit Cost: 1.00 Spac Title

LAMINATE 3/8" GYPSUM Remove and dispose of lead-containing raush or oges base molding. Mark or stencil "Lead Paint" at 4' intervals. Hang, tape and 3-cost finish 3/8" gypsum over surface using screws 8" on center and 1/4" adhesive beads 16" on center. Run gypsum horizontal. Caulk all penstrations and butt suems at door and window casing and base molding with elliconized scrylic. Install 2/1" oges at baseboard. Prime with gypsum primer and a premium scrylio latex topogat.

Spec Number: Unit of Measure: SF Total Unit Cost: 1.00

9199

Spec Title: Spec:

Snec

Laminate 1/2" Gypsum

Hang, tape and 3-coat finish 1/2" gypsum over surface using screws 8" on center and adheaive heads 16" on center. Remove and dispose of lead-containing ranch or oges here modding, Music "Load Paint" at 4' intervals on leaded surface. Run gypsum horizond.

Caulk all prostrations and butt seems at door and window casing and buse molding with silicunized sprylic. Install 3/8" ogec at baseboard.

Spee Number: Unit of Measure: SP Total Unit Cost: 1.95

Spec Title:

fur, hang, tape, finish gypsum

Spen:

Level surface with 1" x 3" wood or metal fluring stripe 16" on center, Hang, tape and 3must finish 1/2" gypeum using adheaive heads and surews 8" on center after clearly maticing wall with "Leaf Paint" svery 4 first, fixtend switches, fixtures and outlets. Sal all penetrations in gyptum surface with siliconized anytic or polyurethane from scaled. Prime and top coal with acrylic latex.

Spec Number: Unit of Measure: SF Total Unit Cost: 1.00

9205

Spec Title: Spec:

PLYWOOD WAINSCOT

Mark "Lead Paint" at 4" intervals. Hang 1.4" BCK plywood with finish screws and achesive beads 16" an scalar. Remove and dispose of lead-containing reach or ogeo lase molding. Run continuous 144" beads of adherive at perimeter. Trim all top edges with chair rail, bottom with ogue and extensor corners with 1" corner.

Spec Number: Unit of Measure: SF Total Unit Cost: 1.75

9206

Spec Title: Spac:

PANELING - PUR & HANG

Level surface with 1" x 3" wood or metal faming strips, 16" on center screwed to stud. Mark "Lead Paint" on well every 4. Hang 1/4" physicod or composition paneling using 1/4" adhesive beads at all panel edges and ring shank paneling brads. Extend switches fixtures and outlets. Seal all penetrations with brown siliconized acrylic caulk. Apply comer, cove and base molding.

Spac Number: Unit of Measure: SF Total Unit Cost: 2.00 Spec Titles

9207

LAMINATE MASONITE

Speci

Wet scrape deteriorated paint, planter and/or wall covering. Repair demaged areas larger then 3" x 3". Mark walls every 4" "Lead Paint." Extend electrical switches, fixtures and outlets. Laminate mylar-faced massesite with a 1/4" band of 12" O.C. adhesive and this units. Cover seems and edges with motohing trim material.

Spea Number: Unit of Messure: SF Total Unit Cost: 1.90

9212

Spec Title: Spect

CEILING TILES - FIBERGLASS

Wet scrape to remove all loose and puning paint, wallpaper and plaster, Mark "Leed Paint" at 4' intervals. Install a 2' x 2' T-bar suspended coiling grid with main runners perpendicular to calling joints with hanger acrews at least 24" on center. Install a \$4" vinyi-faced fiberglass drip-in tile.

Spec Number: Unit of Measure: SF Total Unit Cost: 3.49

Spec Title: Spec:

CEILING TILES - OYPSUM

Wet scraps to remove all loose and peeling paint, walkaper and planter. Mark "Lest Paint" at 4" intervals. Install a 2" x 2" T-ber suspended colling grid with mein remosa perpendicular to celling joists with banger screws at least 24" on center. Install a 1/2" type X, gypsum selling file.

Spec Number: Unit of Measure: SF Total Unit Cost: 2.10 9215

Spec Tide: Spac:

CEILING FUR HANG FINISH GYPSUM

Level surface with 1" x 3" wood or metal faring strips 16" on center. Hang, tape and 3cont finish, 1/2" gypnum using adhesive bends and screws 5" on center after clearly marking "Lead Paint" every 4'. Extend or remount light fintures with siliconized acylic or polymethane form scalent. Frim and top cost with acrylic latex.

Spec Number: Unit of Measure: EF

Total Unit Cost: 1.00 Spec Title: Spec:

REMOVE PAINT - HEAT GUN

Spread a non-flammable, disposable drop cloth over the floor or ground containment. Workers must wear at least a half face respirator with HEPA and organic filter carbifges. Use a best gun with a 1,100° F ment, temperature to soften paint. Draw corape to ben substrate using sharpened tools. Package paint residue as becardous waste. Wesh suftees with a detergent solution, rinse, allow to dry and prime and paint with accylic lates.

Spec Number: Unit of Measure: SF Total Unit Cost: 4.00

Spec Title: Spec:

REMOVE PAINT - CAUSTIC

Workers must wear protective gloves, disposable full body protective elething and fice shield. Protect all areas not to be stripped. Apply caustic past and any recommended cover sheet in accordance with manufacturer's specifications. Collect residue and then water in 55 gal. pleatic or plantic-lined drums compatible with caustic. Neutralize suface to below a P of 6.5 per a limms paper use, following a west detergent wash, riuse with clear water. Allow surface to dry and prime with anylic lases.

Spec Number: Unit of Measure: SF Total Unit Cost: 4.00 Spec Title:

0223

REMOVE PAINT - ORGANIC SOLVENTS

			ĺ

Spec:

Submit product data and use manufacturer's instructions for each chemical stripping agent. Workers must wear protective gloves, disposable full bodysuits and fince shields. Protect all adjacent areas not to be stripped. Apply any recommended cover sheet, desargent wash and rings in accordance with manufacturer's specifications. Collect residue and tines: water in 15 gal drums. Apply acrylic latex primer and top coat.

Spec Number: Unit of Measure: SF Total Unit Cost: 1.90

Spar Titla: Spec:

REMOVE PAINT - POWER SANDER

Ramove paint from fist surfaces using a finity shrouded power sunder with a HEPA

vacuum athehmeni per manufacturar's most recent recommendations.

Spec Number: Unit of Measurer

Total Unit Cost: 0.00 Spac Title:

Spec:

CONTAMINATE DISPOSAL

Spec Number: Unit of Measure: SP

Total Unit Cost: 2.50

Spec Title: Spece

DISPOSE OF LEAD WALL/CEILING

Establish pissife lined walk to track or dompster. Remove wall or ceiling in as largets practical places while protecting floor containment with plywood. Mist small debris with weter. Transport debris to dumpster in sealed container or by sealed chuts to a covered dempster.

9341

9336

9337

Spec Numbers Unit of Measure:

Total Unit Cost: 0.00 Spec Title:

Spec:

FLOOR/TREATMENTS

Spec Number: Unit of Measure: SF Total Unit Cost: 2.50

9345

9351

Spec Title: Spect

VINYL TILE REPAIR Remove all damaged floor tiles, clean adhesive from deck. Install replacement tiles using manufacturer's adhesive and specifications to create a cleanable surface. Match existing

tile, size, color and style as closely as possible.

Spec Number: Unit of Measure: SP Total Unit Cost: 0.75

Spec Tkle: Spec:

DISPOSE OF CARPET After occupant removes breakable personal items, move furniture. Wet carpet with detergent solution. Cut carpet into 6' x 6" sections. Roll and wrap each carpet section in 6

rull poly and remove. HEPA vacuum and wat mop bare floor.

Spec Number: Unit of Measure: SF Total Unit Cost: 0.55

9355

Spec Title:

STABILIZE FLOOR ACRYLIC

Spec:

Renail all loase floor boards and fill holes. Wet scrape or west huff the entire floor date. including closes with 80 gris, nonwoven 16" floor buffer pads. HEPA vectum, de-glas

	•		_

and mop with a detergent wash. Rince, HRPA vacuum, and tack rag surface. Apply two coats of acrylic latex deck enumel per manufacturer's specifications.

Spec Number: Unit of Measure: SF Total Unit Cost: 1.00 Spec Title:

9357

STABILIZE FLOOR - CLEAR VARNISH

Spec:

Revall all loose floorboards, fill holes. Wet scrape or wet floor buil the entire floor including closet with 80 grit, nonwoven, 16" floor buffer pads. HEPA various and sup with a detergent solution. Ringe, HEPA vacuum and tank rage surface. Prime and apply 2 costs of high gloss polymentane.

Spec Number: Unit of Measure: SF

9364

Total Unit Cost: 1.25 Spec Title:

ENCLOSE UNDERLAYMENT

Spec;

Mark "Lead Paint" at 4' intervals. Remove, package and dispose of any finish flooring and shoe molding. Mark floor "Lead Paint" at 4' intervals. Screw or ring shank nail t' on center 3/8" or 1.4" underlayment grade plywood using adhesive. Replace since mulding

to scal edges. Apply one cost of floor soumel.

Spac Number: Unit of Measure: SF Total Unit Cost: 2,8

9365

Spec Title: Spec:

FLOOR ENCLOSURE - UNDERLAYMENT & VCT

Mark "Lead Paint" at 4" intervals, install 3/8" underlayment grade plywood using adhesive and 7d screw thank or esment coated nails, 6" on center in all directions. Lay 12" x 12" x 18" wind composition tile, color group H as made by Armstrong or Arec per manufacturer's spece, fastall shoe molding sayond baseboard and metal edge stile at appearings. Owner's choice of in-stock subur/patisms.

Spec Number: Unit of Measure: BF Total Unit Cost: 3.05

9366

Spec Title: Spec:

FLOOR ENCLOSURE - UNDERLAYMENT/SHEET GOODS

Mark "Lead Paint" at 4' intervals. Install 5/16" underlayment grade plywood, using atherive and 7d acrew shank or common couted nails, 6" in all directions. Install .07 thick, banked vinyl sheet goods with minimum seams, per manufacturer's recommendations. Install metal edge strips in openings, show or vinyl base around

parameter. Owner's choice of in-stock colon/pettern.

Spec Number: Unit of Measure: SY

Total Unit Cost: 21.00 Spec Title:

FLOOR ENCLOSURE - UNDERLAYMENT, CARPET, PAD

Mark "Lead Paint" at 4' intervals, Install 5/16" underlayment grade plywood with 16" OC schesive beeds and 7d screw shock malls or screws, 6° on coater in all directions. Butt seems tight to perimeter well to contain feature lead dust. Lay 25 oz. nylon, plant carpet over 5/16" rebond polyurathane pad. Owner's choice of in-stock color/patters.

Spec Number: Unit of Measure: SF Total Unit Cost: 8.25

Spec Title:

FLOOR ENCLOSURE - OAK STRIP FLOOR

Spec:

Spec:

Remove all baseboards, thoe molding from jumb easings and trim at floor level. Store casings for reinstallation. Stoneil "Lead Paint" at 4" intervals on floor. Install 3/8" underlayment with 7d screw shauk nails or screws 6" OC in all directions. Install 2", #2

cak strip flooring per standard industry practices. Fill, sand and finish with I cost of sanding scaler and 2 coats of high gloss polyurethans varnish. Install pre-painted baseboard to metch original. Reinstall caring and trim doors.

Spec Number:

Unit of Measure: Total Unit Coat: 0.00

Spec Title:

STAIRWELL TREATMENTS

Spece

Spec Number: 9328

Unit of Measure: RI Total Unit Cost 20.00

Spec Title:

STABILIZE STAIRCASE - URETHANE

Spec:

Aggressively wet suraps all deteriorated paint with a draw suraper. Feather edges with a 100 grit sponge sasting block. De-glass, rises, HRPA vacuum and allow to dry. Prine and top cost with a premium polymethana deak ensuel from a single manufacturer.

Spec Number: Unit of Measure: EA Total Unit Cost: 35.00

Spec Title: Spec

REPLACE TREAD

Remove, package in 6 mil. plastic and dispose of stair treads. Install 5/4" need fir treads. Seat with 2 costs clear urethens.

10704

Spec Number: Unit of Measure: RI Total Unit Cost: 8.00

Spec Title:

ENCLOSE RISERS - PLYWOOD

Mark such riser "Lend Paint", Laminate riser with 1/4" BCX plywood attached with Spec

adhesive and finish units. Paint or stain to cover.

Spec Number: Unit of Measure: EA Total Unit Cast: 30.00

Spec Title; Space

ENCLOSE TREADS AND RISERS - WOOD

Mark "Lead Paint" at 4" intervals. Chinel nose off treads and apply \$4" pine stapping stock. Scoure treads with a full cost of adhesive and 7d acrew shank flooring mails or stainless steel finish screws. Laminate risers with 1/4" BCX plywood back oscilled and nailed with ring thank brack. Stain suctace walnut and apply 2 coats of high gloss prothern. Wet scrape, wash, ringe and allow stringer to dry. Frime and topcout stringer with acrylic latex commel

Spee Number: Unit of Measure: RI Total Unit Cost: 22,00

Spac Title:

ENCLOSE STAIRWELL - CARPET

Spec: Mark "Lead Paint" at 4' intervals. Protest treads and risess by wet scraping and HEPA

vacuuming. Install 25 oz. nylon phush carpet to enclose lend hazard.

Spac Number: Unit of Measure: LF Total Unit Cost: 2.00

Spac Title:

RAIL SYSTEM STABILIZE

9401

9397

Wet scrape deteriorated surface; feather edges with 100 grit wet sanding block; determent Spec wesh and de-gloss remainder of surface; risse; HEPA vacuum and spot prime bara

substrate. Apply a single, acrylic latex top cost of paint to emire surface.

Spec Number:

9404

Unit of Measure: RI Total Unit Cost: 40.00

Spec Title:

STRIP STAIRWELL - HEAT GUN

Spread a disposable, nonflammable drop cioth. Workers must wear organic solvent filter cartridges. Use a heat gun with a 1,100 F max, temperature to soften paint. Scrape to bare substrate. Minor residue may be cleaned with paint remover. Package paint residue as hazardous wests. Detargent wash, since and allow to dry. Prime and topcoat with a premium scrylic latha cramel.

Spec Number: Unit of Measure: RI Total Unit Cost: 40,00 9401

Spec Title: Spect

STRIP STAIRWELL - WET SCRAPE

Create a 6 mil plastic containment at top, sides and bottom of stairwell. While continuously misting surface, wet scuope all paint from all stances compensate with community mixing surnace, wer scrape in paint treat an attainant components was sharpened draw scrapes. HHPA vaction all whible dust and prime with acrylic later decision control. Using the spend, flat and curve scaleding draw scrapers, remove all subst white continuously mixing the surface. Minimize dust generation by covering scraper head with moistuned cloth. HEPA vacuum, detergent wash, rince and allow to dry. himse

and topcost with anylic cosmol.

Spec Number:

Unit of Measure: RI Total Unit Cost: 46.00 9405

Spec Title: Spect

STRIP STAIRWELL - CATISTIC

Workers must wear impervious pentective gloves, disposable fall body overalls and free shields. Protect all areas to be stripped, Apply countie pure and any recommended coversheet in accordance with manufacturer's speer. Collant residue and rings water in 55 gailon drams compatible with caustic. Neutraliza to below PH of 6.5 per a litures ext and ringo surface in accordance with manufacturer's directions. Prime and topcost with

owner's choice of fmish.

Spec Number:

Unit of Measure: RI Total Unit Cost: 22.00 9412

Spec Tiffe;

Speo:

RHPLACE STAIRWELL - BASEMENT

Remove package and dispose of all LCM. Rebuild stairs in code, match existing tries and materials as closely as possible.

Spee Number: Unit of Measure: LP Total Unit Cost: 56.00

Spec Title:

REPLACE RAIL AND BALUSTERS

Remove, peckage and dispose of lead-containing railing system. Construct stairway railing system using stock Morgan newel posts, handraits and birth behaster to match existing as closely as possible. Prime and top coat or stain and 2 coats of polyurations.

Owner's thoice of in-stock colors,

Spec Number: Link of Measure:

Spec Title:

Total Unit Cost: 0.00

WINDOW TREATMENTS

Spec:

9424

Spec Number:

Unit of Measure: EA Total Unit Cost: 12.00

Spec Title: Soac:

STABILIZE WINDOW : ACRYLIC

Wet scrape all interior and exterior wintlow components with curved draw scrapen. Fasther edges with 100 grit sponge sanding blocks. Re-giszs as required. Rinse, HEPA vacuum and allow to dry. Spot prime and top coat interior and exterior with premium

Spec Number: Unit of Measure: BA Total Unit Cost: 37.00 Spec Title:

WINDOW - FEX CLOSED/STABILIZE

Screw the meeting ralls together using two, #10, 2 1/2" screws. Caulit to aliminate ill air latitudination with 10 year elliconized acrylic. Wet sampe, wet sand, ringe, HEPA vacuum and allow to dry interior window components. Prime and top cost interior with premium acrylic lesex.

9434

9435

Spec Number: Unit of Measure: EA Total Unit Cost: 60.00 Spec Title:

Spec

Spac:

WINDOW WRAP WELL AND STABILIZE

Wet surpe all interior and exterior window components, Feather edges with 100 mil sponge sending block, detergent wash, rims and allow to dry. HEPA vacuum all vishle dust and chips. Spot prime hars wood with quick drying, water-based, clear scalant and top cost with white alkyd paint. Underout parting best and stool molding 1/4". Back coolic and nall .027 aluminum coll stock in window well area with ring abank brack, brill two M2" weep holes in storm such. Cralk perimeter of well with siliconized acrylic.

Spec Number: Unit of Messure: RA

Total Unit Cost: 135.00 Spec Title:

Spec:

WINDOW - STOOL, LINERS, STABILIZE

Remove, package in plastic and dispose of stool, stop and parting bead. Install PVC channels and spring ellip window controls. Install stool, stop and parting head and lantinate sill with .027 aluminum coil stock. Wet scrupe all interior and exterior window trim. HEPA vacuum all visible dost and chips. Clean with a lead-specific detergent.

Prime bare wood. Top cost with premium anylic later.

Spec Number:

Unit of Measure: EA Total Unit Cost: 195.00 Spec Title:

Space

REPLACE LOWER SASH, STOOL, LINERS

Remove, package and dispose of lower such, stool, parting beach and stop molding. Replace stool, single gizzed wood such and aluminum or viny! sash guides. Laminah well with back-caulted .032 shuminum or visyl coil stock. HEPA vacuum all visibledust

and chips. Wet scrape, prime and top cost with alkyd point.

Spec Number: 9450 Unit of Meanure: BA Total Unit Cost: 100.00

Sper Title:

WINDOW-STRIP, OFFSITE, REDISTALL Space

Remove window and package in plastic and send window to off-site stripper. Remove, package in plastic and dispose of all interior trim. Retrim opening to match existing as classly at possible. Repair damage to walls. Reinstall stripped window sash. Prop for

paint and prime entire window unit/trim with white actylic latex.

Spec Number:

9451

Unit of Messure: BA Total Unit Cost: 275.00

Spec Title: Spec

WOOD REPLACEMENT SASH - HISTORIC

Remove and dispose of such, parting bead and interior step. Strip jumb, interior still and seek side of szunior stop with heat gun or chamiosis. Wet surspe interior and exclusion trim and sill. TSP, HEPA vacuum, TSP. Prims and paint. Install custom-made wood replacement such with matching muntin pattern, double glazing, parting beed and learner stop. Repair and adjust window weights and hardware for smooth operation. Prims and paint. Clean glass.

Spec Number: Unit of Measure: EA Total Unit Cost: 275.00

Spec Title; Spec:

VINYL WINDOW WITH STORM

Remove, parings in plastic and dispose of entire window unit and interior trim. Field messure and install a PVC, I over I, double hung, single glassed, window with nignessis storm window and I/2 screen. Wrap exterior jamb and sill with almaninum cell stock. Ration opening with preprinted 1" x 6" casing, spron and pine stool. Top coat with

sorylin later and clean glass.

9453

9455

9456

Spec Number: Unit of Menure: EA Total Unit Cost: 340.00

Spec Title: Spec

VINYL DE, DG, LOW-E WINDOW

Remove peckage in plantic and dispose of entire window unit and interior trim. Field massure and install a PVC, I over 1, double hung, double placed, argun filled window with at least a R-4 rading and 1/2 screen. Wrap solution Jamb and sill with aluminum coil stock bank canlised and malled 6" O.C. Ratrim opening with 1" x 6" casing and apren and

pine stool. Prep for paint, castik edges and prime new wood. Clean gines.

Spec Number:

Unit of Manner; EA Total Unit Cost: 350.00

Spec Title: Spec

WINDOW - VINYL SLIDING/DUAL GLAZED

Remove coising wood window and parting bead and dispose. Wet scrape interior tol extendor casing, alli, stool frame and associated trim. Prime alli and top quality oil based primer. Prime and paint all scraped areas, color as selected by owner. Field measure, fabricate and install a dual glazed, thermal break, vinyl sliding replacement window including all necessary painting, caulk, trim and screen. Manufacturer to be Louising. Pacific or approved.

9459

Spec Number: Unit of Measure: EA Total Unit Cost: 245,00

Spec Title: Spec

WINDOW-ALUMINUM SLIDING, DG

Remove, package and dispose of window unit. Field measure, fabricate and install a white, duel giazad, thermal break, coameled, cliding, aluminum replacement window

storm window. Retrim opening with 1" x 6". Prep and prime wood for top cost.

including all necessary painting, caulk, trim and screen. Clean place.

Spec Number: Unit of Measure: EA Total Unit Cost: 225.00

Spen Title:

BASEMENT WINDOW VINYI.

Spec: Remove, package in plastic and dispose of begeneat window and jamb. Reframe opining with 2" x 8" and install an awning or slider type, single glazed window with a piggitack

Spec Number:

9487

Unit of Measure: BA Total Unit Cost: 345.00

Spec Title: Spac:

WINDOW-REMOVE, PATCH ENVELOPE

Remove, peologic and dispose of all interior and exterior window components. Sted opening with 2" x 4" insulate to R-13 and install an interior and exterior finish muching

the adjacent surface as clearly as possible. Prims new material.

Spec Number:

Unit of Messure: SF Total Unit Cost: 45.00

Spec Title: Spec;

WINDOW-REMOVE, GLASS BLOCK OPENING

Remove all wood window components. Install glass book per manufacturer's spen, tool joints, install expansion spacers around perference and mover to existing foundation or framing. Trim exterior and interior to match existing.

Spec Number:

Unit of Measure: Total Unit Cost: 0.00

Spec Title: Spec:

DOOR TREATMENTS

Spec Number: Unit of Measure: HA Total Unit Cost: 28.00

Spac Title:

Spec:

DOOR - STABILIZE

Wet scrape door, frame and trim with curved draw scrapers. Peather edges with a 160 grit spenge sanding block, HEPA vacuum, detergent wash, rinse and allow to dry. Spst prime and top coat with owner's choice of pramium acrylic intex.

Spec Number:

Unit of Measure: BA Total Unit Cost: 60,00

Spec Title: Spec

9495

9490

9491

DOOR - STABILIZE, PLANE, ADJUST
Remove door to a fully contained work alto. Plane door edges and adjust the hasp and
strike plane to minimize door/jamb friction and contact. Wet scrape door, jamb antinin. Clean and de-gloss door with detergant wash. Ringe to neutral, spot prime and topcoat with anylic latex.

Spec Number:

Unit of Measure: EA Total Unit Cost: 165.00

Spec Tide:

Spec

DOOR - STRIP, OFF-SITE, REHAND

Remove door at hinge pins, mark location at top edge and package in plastic. Package Active coor is sauge plus, mark measure at the cage and presented at pursue research and dispose of stops. Place plus in phasic beg on jumb. Sand parkenged door to off-size arripper. Strip paint on door jumb with heat gun, caustic or chamical stripper. Neutalize all striped components and sand smooth. Prime and top cost jamb. Stain and

polyurethane door, install bress finish bedroom lackset.

Spec Number:

950R

Unit of Measure: EA Total Unit Cost: 175.00

Spec Title:

DOOR - REPLACE 6 PANEL

Remove, package and dispose of deer, stop molding and hardware. Wet surape just and trim. Install a pine or fir δ panel 1-3/8" door on two 3" \times 3" but hinges. Provide befrom lockest. Spot prime here wood and top coat entire assembly with acrylic later.

Spec Number:

Unit of Measure: EA Total Unit Cost: 60.00 9500

Spec Title:

Sper

DOOR - REPLACE HOLLOW COBE

Remove, package and dispose of door, stop sanking and hardware. Wet scrape jumb and trim, install a hollow core, flush lunn door in two, 3" x 3" butt hinges. Provide bedoom lookset. Spot points bere wood and top cost entire assembly with actylic later.

Spac Number:

9514

Unit of Meanure EA Total Unit Cost: 42.00

Spec Title: Sneer

DOOR - REMOVE, PACKAGE AND DISPOSE Ramove, package and disposa of menscassivy door.

9519

Spec Number: Unit of Measure: RA Total Unit Cost: 165.00

Spec Title:

Spec:

DCOR-PRE HUNG HOLLOW CORB Remove, package and dispose of door, jumb and casing. lessall a hollow core, presed wood, 6 panel, preiung door including a badroom lockset. Retriat opening with 1": 6"

plue. Prime and top cost with scrylle latex.

Spec Number:

Unit of Measure: EA Total Unit Cost: 275.00

Spen Title:

DOOR - PREHUNG 6 PANEL - WOOD

Spec:

Remove, package and dispose of door jumb and sating. Install a plus or fir, 6 panel, 1-5/8" prehtug door including a bedroom lockest. Prime and top coat with owner's cinical

of paint or stain.

Spee Number:

Unit of Measure: EA

Total Unit Cost: 45.00

Spec Title: Spec:

STABILIZE AND ADJUST EXTERIOR DOOR Plans exterior door edges and adjust heap and strike plate to minimize doorfamb fileion. Wet scrape door jumbs and nim. Clean and de-gloss with lead-specific detargent. Blue

to neutral, spot prime and top cost with acrylic latex.

Spec Number:

Unit of Measure: EA

Spec Tiffe:

9527

Total Unit Cost: 215.00

EXTERIOR DOOR - REPLACE PANELED

Speed

Remove, package and dispose of door, Install a 1-5/8" pine or fit, paneled entrance four including spring bronze wenther sniping, peep site, dead boit and entrance lockset at times 3" x 3" but hinges. Prep, prime and top coat.

Spec Number: Unit of Measure: EA 9532

Total Unit Cost: 360,00

Spec Title: Spec:

EXTERIOR DOOR -- REPLACE METAL PREHUNG

Remove, package and dispose of door, frame and easing. Install a prehing, insulated 4 panel, metal skinned door including magnetic weather stripping, interlocking threshold, wide angle peep site, dead boit and entrance locksets. Retrim opening with 1" x 6" ening and brick molding. Prime and prep all wood.

Spec Number:

Unit of Measure: EA

Total Unit Cost: 290,00

Spec Title:

EXTERIOR DOOR - REPLACE PREHUNG FLUSH

Spac:

Remove, package and dispose of door, fiame and casing. Install a prehung, flush door including magnetic weather stripping, interiocking streshold, wide angle peep site, dead bolt and entrance locinets. Retries opening with 1" x 6" casing and brick molding. Prime

Spec Number:

Unit of Measure: RA Total Unit Cost: 30,00

Spon Title: Spac:

STRIP DOOR SILL

Remove paint from all using wat scraping, heat gen or chemical stripper. Neutraline if required. Prime here substrate with alicyd primer. Apply a minimum of 1 cont alicyd

enumal finish cost to provide proper and/or adequate coverage.

Spec Number:

Unit of Measure: Tetal Unit Cost: 0.00

Spec Title: Spec:

9545

9537

TRIM TREATMENTS

Spec Number: Unit of Measure: LF Total Unit Cost: 1.25

Spec Title:

9546

9547

Spec:

TRIM PAINT REPAIR Wat screpe deteriorated paint, spot prime and apat top coar.

Spec Number:

Unit of Mossure: LF Total Unit Cost: 0.80

Spec Titles

Spec:

TRIM-STABILIZE AND PAINT ACRYLIC

Mist defictive point area with water. Lightly scrape all loose paint. Feather edges with a spongs smoling block seturated with deglossing agent. Rince and HEPA vacours small visible chips. Allow surface to dry, spot prime and top coar with premium acrylic laser paint from a single manufacturer.

Spec Number:

Unit of Measure: LF Total Unit Cost: 2.25

Spec Title: Spec:

9567

TRIM - STRIP OFF-SITE

Remove decorative trim. Scribe opening number into back of trim, remove nails by pulling through the back of trim. After stripping, neutralize surface and fill all holes with vinyl specific. Back prims with alkyd primer and reinstall on same opening. Prep, prime and top cost with scrylic later.

Spec Number: Unit of Measure: LF

Total Unit Cost: 3.00

Spec Title: Spec:

9579

TRIM - REPLACE NEAREST AVAILABLE STOCK

Remove, puckage in 6 mil plastic and dispose of aim, Replace with nearest available stock wim components. Fully prime and apply a single top coat of paint or stain and

polystefinus - noice and sheen chuice of owner.

Spec Number:

Unit of Measure: PA Total Unit Cost: 40.00

Spec Title:

9586

STABILIZE RADIATOR

Spec:

Remove deteriorated paint by wel scraping. Spot prime bare metal with metal primer. Apply a minimum of I cost alloyd enunclimetal paint.

Spec Number:

9587

Unit of Measure: EA Total Unit Cost: 45.00

Spec Title: Spec:

STABILIZE FOOTED TUB

Remove deteriorated paint by wet scraping. Spet prime substrate with appropriate primer. Apply a minimum of I coat finish point.

Spac Number: Unit of Messure: LF Total Unit Cost: 26.00

STABILIZE CARINET

Spec Title: Spec

Remove deterioused paint by wet scraping. Feather edges with 100 grit form sanding block. Detargent wash, times and allow to dry. Rework doors and/or drawers and adjust handware to reduce friction. HEPA vacuum. Spot prime bare wood with alkyd-based primer. Apply a minimum of 1 cost of cannot finish cost.

Spec Number:

9610

9588

Unit of Measure:

Total Unit Cost: 0.00

Spec Title:

DESPOSAL

Spec

9611

Spec Number: Unit of Measure: EA Total Unit Cost: 40.00

Spec Title:

9612

Spec:

DISPOSAL OF CABINET Remove, package and dispose of lead-costsining exhibits.

Spec Number: Unit of Measure: BA

Total Unit Cost: 0.00

Spec Title:

DISPOSE OF LEAD FURNITURE

Spec

Remove, package and dispose of contaminated household furniture.

Spec Number:

Unit of Measure: BA Total Unit Cost: 90.00

Spec Title:

DISPOSE OF MANTLE/REPAIR WALL

Spec:

Remove, package in 6 mil polyethylesse and dispuse of mantel. Frame fireplace opening with two-by-fours, Laurinate wall with 1/2" drywall. Apply metal comer beads, 3 cost

finish ready for paint. Install 6" high baseboard and shoe molding.

Spec Number:

Unit of Measure:

Total Unit Cast: 0.00

Spec Title:

EXTERIOR TREATMENTS

Spec:

Spec Number. 9625

Unit of Measure:

Total Unit Cost: 0.36 Spec Title:

EXTERIOR PAINT REPAIR

Spec;

Wet scrape to remove loose paint. Wash, riuse and HEPA vacuum all visible chips and dust to prepare surface for painting. Spot prime and apply a premium scrylic latex top

Spec Number: Unit of Measure: SF Total Unit Cost: 0.75

9626

Spee Title: Some:

EXTERIOR STABILIZATION - LTD SURFACE

Mist defective point with water to the point of saturation. Aggressively wet sorape all loose paint, Festher edges with a 100 grit sponge sending block. Rinto and allow to dry. HEPA vacuum all chips and dust. Spot prime and apply a premium anylic latex top cont.

Spoc Number: Unit of Monsurer SF Total Unit Cost: 0.55

9627

Spec Title: Spec;

EXTERIOR - STABILIZE AND PAINT ACRYLIC

Aggressive wet sumpe all loose paint, coulding and glazing with corved and flat draw scrapers. Festier edges with a aponge sanding block assumed with de-glossing agest.
Riuse and HEPA vacuum all visible chips and dust. Allow surface to dry, spot prims and top cost with promium scrylic lains.

Spec Number: Unit of Measure: SF

9635

Total Unit Cost: 3.75 Spec Tide:

Spec:

EXTERIOR - ENCAP CEMENTITIOUS PLASTER

After steation of an exterior containment, prop, prime and apply an approved committious plaster encapsulate in accordance with manufacturer's specifications.

Spec Number: Unit of Mountre: RF Total Unit Cost: 3.45 Spec Title: Spec:

9640

ENCLOSE BARRIER/VINYL SIDING

Mark or stencil siding with "Lead Paint" 4" in all directions. Apply a nonwoven vapor bestries with taped seems and opening fleshing to enclose the lead paint or apply rigid or familied insulation as a print bearier and substrate for siding materials. Protect encloses with ASTMB-3679 vinyl siding. Backose all lead containing trim with vinyl or aluminum ventilating soffit panels, coll stock and field fabricated trim accordance with manufacturer's specifications. Osnik all joints and scams of lead containing tria with 20 year white cault. Owner's choice of siding pattern, color and embossing.

Spec Number: Unit of Measure: LF Total Unit Cost: 1.20

Spec Title:

EXTERIOR TRIM - REPAIR PAINT

Wet sompe all defective paint areas; rings and allow to dry. HEPA vacuum all visible chips and dust spot prime all here substrate; apply single top coat of acrylic latex print to entire purfice.

Spee Number: Unit of Measure: LF

Total Unit Cost: 0.55 Spec Title: Spec

Spec:

EXTERIOR TRIM - STABILIZE

Wet scrape all defective paint areas; feather edger; clean and de-gloss remainder with detergent and mesh pad. Rinse, Vacuum all visible chips and dust; spot prima bare substrate caulk with afficenized latest compound and apply single top cost of actylic latest

paint to antire surface.

Spec Number: Unit of Measure: LF Total Unit Cost: 2.60

Spec Title:

9657

Space

ENCLOSE TRIM - ALUMINUM

Mark "Lead Paint" every 10 finear feet. Enclose trim with .027 white aluminum breaker. stock with light joints and accurately fitted connections. Back coulk all seams with 22 year ciliconized acrylic, flack head joints to create a weather tight installation.

Spec Number: Unit of Measure: LF Total Unit Cost: 2.50 Spec Title:

Snon

ENCLOSE SOFFT!/ALUM

Mark "Lead Palet" every 10 linear feet. Enclose trim with .027 aluminum non vented suffit panels, color by owner. Back casilt all stams with siliconized scrylic to create a

Spac Number: Unit of Measure: SF Total Unit Cost: 1.75

Spec Title: Spec;

EXTERIOR - REMOVE PAINT - SCRAPERS Spread 6 mil plastic from foundation to 6" out from foundation. Using sharpened, flat and curved matching draw graspers, remove all paint after misting the surface. Minimize dest generation by covering somper head with negistance cloth. Prep and prime ready fortep

Spec Number: Unit of Measure: SF Total Unit Cost: 2.00 Spec Title:

Spec

9666

9665

EXTERIOR -- REMOVE PAINT -- HEFA BLAST

Remove point with compressed air and blusting media that is fully recupiured by a strong equipped with a HEPA vacuum local exhaust system. Follow the manufacturer's instructions for exhaust sictions rate and leagth of exhaust hose. The pressure drop most not exceed manufacturer's specification. Dispose of blast media in accordance with size and EPA guidelines.

Spec Number: Unit of Measure: SF Total Unit Cost: 1.75

Spec Title: Spac:

EXTERIOR - REMOVE PAINT - NEEDLB GUN

After completing containment, remove paint with a compressed air driven, fully chronded, acodic gun following equipment mamufacturer's instructions.

Spec Number: Unit of Measure: SF Total Unit Cost: 1.40

Spac Title: Spec:

9684

PORCH - COMPLETE STABILIZE

Subilize deteriorated paint by wet sersping all paint, caulking and glazing. HEPA vacuum all surfaces. Spot prime and apply a minimum of 1 coat of floor and dock ename!

Spec Number: Unit of Measure: SF Total Unit Cost: 1.65

Spec Title: Spec:

9690

ENCLOSE DECK-TREATED PLYWOOD

Stabiliza by wet scraping. Mark "Lead Paint" at 4' intervals. Apply 1/2", tongue and groove, BCK merine grade, treated plywood with stainless steel screws or strew shest sails, 8" o.c. and adhesive to deck. Trim edge with preservative treated molding to corer. Spec Number: Unit of Measure: SP Total Unit Cost: 3.75

9691

Spec Title: Spec

ENCLOSE DECK - T & G

Stabilize dook by wet soraping. Stencil "Lead Paint" at 4" intervals on painted float.

Staple down 50 lb. roofing felt. Install 3" or 4" tenger and grove, pinz or fir strip floating series should naile or power activated staples. Install ogeo molding at vertical stalls. Prime and cost with exterior high gloss dack enamel.

Spec Number: Unit of Message: SP Total Unit Cost: 2.50 Spec Title:

Space

9693

ENCLOSE PORCH CEILING - PLYWOOD

Stabilism ceiling by wet acraping. Mark ceiling "Load Paint" 4" on center. Apply a 18" BCK plywood ceiling with 7d server shank nails, 8" on center and B side exposed from permeter with 1/4 round and seams with 2" lattice. Prime and top coat with acrylichics.

Spec Namber: Unit of Measure: SF Total Unit Cost: 1.90

9695

Spec Title: Spen:

ENCLOSE PORCH CELLING - GYPSUM

install drop cloth to collect and dispose of lead point chips. Mark colling "Load Paint" 4" on ocator. Apply 1/2" exterior gypsum using adhesive and screw mails. Tape and faith scenus with sylon tape. Trim with 1/4 round. Prims and top cost with scrylic later.

Spec Number: Unit of Measure: LF 9697

Total Unit Cost: 45.00

Spec Title:

EXTERIOR - REPLACE RAILING SYSTEM

Ramove, package and dispose of railing system. Install a 36" high wood railing with 1" \times I" periods, 3" on center supported by preservative treated 4" x 4". Prep, prints and up cost with scrylin later.

Spee Number: Unit of Measure: LF

Total Unit Cost: 65,00 Spec Tide:

RAILING WITH BALUSTERS SE"

Spec:

Install a 2×4 beaded for top rail, 2×4 for bottom rail, 4×4 somer and intermediate posts and 1-1/3" fir balasters spaced 6" o.c. with hot-dipped galvanized nails. Prime and ap-cost acrylic latex or apply 2 coats of semi-transparent oil based smin preservative.

Spec Number:

9703

Unit of Measure: EA Total Unit Cost: 65.00

REPLACE COLUMN 4"X 4"

Spen Title: Spec:

Remove, package and dispose of lead-containing column. Install a preservative-trained 4 x 4 replacement column.

Spec Number: Unit of Measure: EA

Total Unit Cost: 270.00 Spec Title:

REPLACE COLUMN TURNED

Spec:

Remove, package and dispose of lead-containing column. Install a historically current turned column. Prep, prime and top cost with scrylic latex.

Spec Number: Unit of Measure: EA

9705

Total Unit Cost: 110.00 Spec Title:

Spec:

REPLACE COLUMN - DECORATIVE .

Install 4" x 6" pressure-treated wood column. Install 2" pressure-treated pine column base and oxpital. Install I" x 4" pine with 1-1/2" moldings around base and capital. Prime and top cost with scrylic letex.

Spec Number: Unit of Measure: SF Total Unit Cost: 12,00

Spec Title: Speer

REPLACE LANDING

Remove, penings and dispose of landing. Construct an early platform using pressuretreated 4" x 6" support posts on 12 x 12 poured frozers, 2" x 8" pressure-treated John 16" c.c., #1 fir 1" x 4" square edge flooring and 1" x 8" d-select sicinting, Install a 4" x 4" support posts, 2" x 4" baseded top rail and 2" x 4" bettom xill with 1-1/2 square beliefseen 4" on center along the open staircase and landing perimeter.

9700

Spec Number: Unit of Messure: LF Total Unit Cost: 55.00

Spec Title: Spec:

EXTERIOR - STAIR SYSTEM

As the time of the property o z 4". Prop. prime and top cost with sorylic latex to match existing as closely as possible.

Spec Number: Unit of Monsure: Total Unit Cost: 0.00

Spec Title: Spec:

SOIL TREATMENTS

Spec Number: Unit of Measure: SP

9751

Total Unit Cost: 0.45

Spec Title: Spec:

SEED AND TACK

Mow lawn using a happing mower and dispose of waste. Scratch surface with a steel rake, rototili established walidag paths. Fertifize with starter blend and re-seed with K-31 tail Source. Mulch with strew and water, Create a 3' high hearier with string, '1" x 1" attless and marking tape. Water twice a week until 2" stand of grass is established.

Spec Number: Unit of Measure: SF

Total Unit Cost: 4.00

REGRADE AT FOUNDATION AND SOD

Spec Title: Spec:

Mow yard 4' out from structure with a bagging mower as close to foundation as possible. Install S" of topcoll at foundation graded out 4" from foundation to 1." Pertilize and set area. Install 3' high barriends of string on 1" x 1" stakes to establish lawn.

Spec Number:

9755

Unit of Mensure: SF Total Unit Cost: 0.60

MULCH 4"

Spac Title: Spec:

Install a 4' wide, UV resistant, landscape barrier with 6" landscape steples, 1' on center, after mowing lawn as low as practical. Overful area with at least 4" of pine back or

shredded bardwood maich.

Spec Number: Unit of Measure: SP Total Unit Cost: 1.85

9756

Spec Title: Spec:

ENCAPSULATE PLAYUROUND WITH SAND

hotall a beavy duty, nylon rainforned, landscape oloft between 4" x 4" perimeter frame. Cover with at least 4" of clean play sand to protect landscape fabric.

Spec Number: Unit of Measure; SF Total Unit Cost: 4.00

Spec Title: Spac:

SOIL REPLACEMENT

Dampen dry soil. Remove and dispose of the top 4" of soil in the areas indicated on the plan or noted below. Spread 1" of peat and manure and dill into 4" depth. Bring in them topsoil and spread evenly to replace all removed coil. Families and sod area, Install 3' high barriet of marking tape or string on 1' x 1' stakes to establish lawn.

Spec Number: Unit of Measure: EA Total Unit Cost: 45.00

9765

Spec Trile:

FOUNDATION PLANTING

Spec:

Create a bearies to soil access by planting evergreen hashes with defensive brists or needles to climinate readom soccess. Sir William Burberry, Chinese holly or pachyundra is typical.

Spec Number: Unit of Measure: EA 976R

Total Unit Cost: 300.00

Spec Title: Spec:

PLAY AREA

Remove vegetation, starilize soil and level ground at play area. Install heart redwood perimeter frame with 2 x 8 sides supported by 4 x 4 posts. Secure with leg or carriage bolts countercosk without protrusions. Bevel top edge of post and embed at least I deep. Lay down filter fabric and 6° of tan basic. Dimensions as follows: 8 ft. x ft.

Spec Number: Unit of Measure: SF Total Unit Cost: 2.50

Spec Title: Spec:

DECOMPOSED GEANITE

Remove vegetation and till soil to 6" depth. Grads surface amouth and drain away from house. Wet down and compact soil. Install decomposed granite, 1/4" or less with flux, 3 layers of approximately 1-1/2" thickness each. Wet down and compact after each layer. 3" final minimum thickness. Fill in dips and cracks 3 - 7 days after installation. Color as

selected by owner from standard available colors.

Spec Number: 9777 Unit of Measura;

Total Unit Cost: 0.00 Spec Title: Spac:

OUTBUILDINGS

Spec Number:

Unit of Measure: EA Total Unit Cost: 800.00 Spec Title:

DISPOSE OF GARAGE/OUTEUILDINGS

Speci Cover adjacent ground and path to dumpster to capture lead paint chips. Remove and

package lead components in as large as practical piecos. Wet small debris with water. Transport debris to dumpster in scaled containers or by scaled chute to a scaled dumpster. Spec Number: Unit of Measure: EA Total Unit Cost: 960,00

Spec Title: Spec:

9779

EXTERIOR DOOR - OVERHEAD GARAGE DOOR Install a 2 to 10 zero paol style, hot-dipped galvanized steel front overhead door with a polyural score insulation. U-shaped bottom seal, balad on 2 cont polyester fields paint, hot-dipped galvanized stiles, and an automatic garage door opener (1/3 H.P.), one piece rail construction with automatic safety reversaldoor stop. All necessary hardware/framing included.

Certificate of Completion

Jeremy Bullins

Has completed the online, interactive training course

Hazmat: Safety Training

And achieved a score of 90 % on the Final Exam.

Corporate Safety Compliance

Company Name

9335 W 53rd St N

Company Address

Maize, KS 67101

City, State, Zip

Note: It is the responsibility of the trainer and the trainer's company (named as Company, above) to determine and verify a student's competency. Course completion certificates do not state or imply competency on any given subject, only that the student has completed the online training.

2/28/2022

Date of Completion



Certificate of Completion

Jeremy Bullins

Has completed the online, interactive training course

Hazmat: Security Awareness Training

And achieved a score of 100 % on the Final Exam.

Corporate Safety Compliance

Company Name

9335 W 53rd St N

Company Address

Maize, KS 67101

City, State, Zip

Note: It is the responsibility of the trainer and the trainer's company (named as Company, above) to determine and verify a student's competency.

Course completion certificates do not state or imply competency on any given subject, only that the student has completed the online training.

2/28/2022

Date of Completion



Certificate of Completion

Jeremy Bullins

Has completed the online, interactive training course

Hazmat: Highway Transportation Driver Training

And achieved a score of 100 % on the Final Exam.

Corporate Safety Compliance

Company Name

9335 W 53rd St N

Company Address

Maize, KS 67101

City, State, Zip

Course completion certificates do not state or imply competency on any given Note: It is the responsibility of the trainer and the trainer's company (named as Company, above) to determine and verify a student's competency.

subject, only that the student has completed the online training.

2/28/2022
Date of Completion



Certificate of Completion

Jeremy Bullins

Has completed the online, interactive training course

Hazmat: General Awareness Training

And achieved a score of 100 % on the Final Exam.

Corporate Safety Compliance

Company Name

9335 W 53rd St N

Company Address

Maize, KS 67101

City, State, Zip

Note: It is the responsibility of the trainer and the trainer's company (named as Company, above) to determine and verify a student's competency. Course completion certificates do not state or imply competency on any given subject, only that the student has completed the online training.

2/28/2022

Date of Completion





CERTIFICATE

Jeremy Bullins



Has successfully completed

~ Transport of Radioactive Sealed Sources in XRF Analyzers ~ Safety Training for



Supervisor Signature

2/14/2022

COMPLETION DATE

Jean Geslin

Jean Geslin, RSO Thermo Fisher Scientific



ERTIFICA This Certifies that

Jeremy Bullins



~ US Regulations for Handheld XRF Analyzers with Radioactive Sealed Sources ~ Safety Training for

Supervisor Signature

COMPLETION DATE 2/14/2022

Jean Geslin

Thermo Fisher Scientific Jean Geslin, RSO

ThermoFisher SCIENTIFIC

CERTIFICATE

Jeremy Bullins



Has successfully completed

Safety Training for ~ Sealed Source XRF - Radiation Safety~

COMPLETION DATE

Supervisor Signature

Jean Gestin

Jean Geslin, RSO Thermo Fisher Scientific

Kansas Department of Health and Environment

Be it known, that having properly fi Issue Date: epartment of Health and Environment, October 16, 2025

Lee A. Norman, M.D., Secretary

Kansas Department of Health and Environment



KANSAS DEPARTMENT OF HEALTH AND ENVIRONMENT

PAGE 1 OF 3 PAGES Amendment No. 10

RADIOACTIVE MATERIAL LICENSE

Pursuant to the Nuclear Development and Radiation Control Act (L. 1963, Ch. 290) and Kansas Annotated Regulations numbers 28-35-133 et. seq., and in reliance on statements and representations made to this agency by the licensee designated below, a license is hereby issued authorizing the licensee to transfer, receive, possess, and use the radioactive material or materials listed below; and to use the material for the purpose or purposes listed below. This license is subject to all applicable rules, regulations, and orders now in effect or placed in effect by the Department of Health and Environment and any conditions specified below.

1.	License South Central Kansas Econ District (SCKEDD)				4. Expiration Date: March 31, 2027			
2.	9730 E 50 St N Bel Aire, KS 67226-8804			: 22-B827 is renewed / to read as follows:	5. Docket No.: 030-00395 Reference No.:			
6.	Byproduct, source, 7 and/or special nuclear material	Chemical and/or physical fo	örm 6.	Maximum amount that licentary possess at any one time under this license				
A.	Cadmium-109 A	Sealed Sources (Isotope Products Laboratories, W XFB-3; QSA Global, Mod CUC.D1; CUC.P1; SEÉ Model XCd9.06)	lodei lei	6 source(s). No single source to exceed 40 mCl.	To be used as components of Niton XLp series X-ray fluorescence analyzers for lead analysis of samples.			
	CONDITIONS							

Radioactive materials shall only be used at the following location(s):
 9730 E 50th Street North, Bel Aire, Kansas, 67226

Radioactive material may be used at temporary job sites of the licensee anywhere in the State of Kansas where the department maintains jurisdiction for regulating the use of radioactive material.

NRC FORM 374A	KANSAS DEPARTMENT OF HEALTH AND ENVIRONMENT						PAGES
	License No.: 22-B827	Docket or Reference No.:					
MATERIALS LICENSE		030-00395					
SUPPLEMENTARY SHEET	Amendment No. 10	•					
Andrea College							

- The following shall be responsible for the licensees radiation protection program:
 Jeremy Bullins Radiation Safety Officer.
- 12. Radioactive material listed in Item 6 above is authorized for use by individuals for the materials and uses described as follows: Radioactive material shall be used by or under the supervision of an individual listed below:

Authorized Users
Jeremy Bullins

. Material and Use

Subitem(s) A

- 13. The licensee shall perform testing for leakage or contamination of sealed sources in accordance with K.A.R. 28-35-216a.
- 14. Sealed sources containing radioactive material shall not be opened or removed from their respective source holders by the licensee.
- 15. The licensee shall conduct a physical inventory every six (6) months to account for all sealed sources received and possessed under the license. The records of the inventories shall be maintained for three years from the date of the inventory for inspection by the department, and shall include the quantities and kinds of radioactive material, location of sealed sources and the date of the inventory.
- 16. The licensee may transport radioactive material or deliver radioactive material to a carrier for transport, in accordance with the provisions of K.A.R. 28-35-196a, "Preparation of Radioactive Material for Transport".
- 17. The licensee shall comply with the provisions of Kansas Radiation Protection Regulations, Part 4, "Standards for Protection Against Radiation" and Part 10, "Notices, Instructions and Reports to Workers; Inspections."
- 18. The licensee shall possess and use radioactive material described in Items 6, 7 and 8 of this license according to the most restrictive of, the Kansas Radiation Protection Regulations, this license or statements, representations, and procedures contained in the following documents.

NRC FORM 374A	C FORM 374A KANSAS DEPARTMENT OF HEALTH AND ENVIRONMENT						
MATERIALS LICENSE SUPPLEMENTARY SHEET	License No.: 22-B827	Docket or Reference No.: 030-00395		**************************************	PHERIODE AND		
	Amendment No. 10						

- A. The letter received December 28, 2021, signed by Jeremy Bullins, with attachments.
- B. The application dated February 24, 2022, signed by Jeremy Bullins, with attachments.

FOR KANSAS DEPARTMENT OF HEALTH AND ENVIRONMENT
Kimbell Atusa

By:

Kimberly Steves

Director, Radiation Control Program

Date: March 23, 2022



TEMPLE ENTERPRISES OF WICHITA 1320 E 2ND STREET N WICHITA, KS 67214 316-267-3629 Fax 316-267-5203

Invoice

INVOICE DATE	INVOIC	E NUMBER
07/25/2022	561-S10	0279783.001
REMIT TO:		PAGE NO.
JOHNSTONE SUPPLY P.O. BOX 470463 TULSA, OK 74147	•	1 of 1

BILL TO:

SHIP TO:

SOUTH CENTRAL KANSAS ECONOMIC DEVELOPMENT DISTRICT-9730 E 50TH STREET N BEL AIRE, KS 67226-8804 SOUTH CENTRAL KANSAS ECONOMIC DEVELOPMENT DISTRICT-9730 E 50TH STREET N BEL AIRE, KS 67226-8804

CUSTOMER NL	MBER	CUSTOME	ER PO NUMBER	JOB	NAME / RELEASE NUMBER	ORDE	RED BY
1711		S	PEAR			RYANI	HUGHES
W	/RITER		SHIP VIA		TERMS	SHIP DATE	ORDER DATE
JIM	WHITE		WILL CALL		NET 10TH PROX	07/25/2022	07/25/2022
ORDER QTY	SHIP QTY		DESC	RIPTIC	ON	UNIT PRICE	EXT PRICE
1ea	1ea	GOODM PHASE :	GSX140301 COI IAN 14SEER 12E 208/230V R410A 2206111907			1123.080/ea	1123.08
voice is due by	08/10/202	2				Subtotal	1123.08
ast Due invo	oices may	y be subj	ect to 1.50% late	char	ge.	S&H Charges	0.00
DENOTES TAXA	ARI E I INE	·S)				Tax	0.00
DEMOTES TAVA	HOLE LINE	,5)				Payments	0.00
By: ACCTING on 7/28						Amount Due	1123.08



TEMPLE ENTERPRISES OF WICHITA 1320 E 2ND STREET N WICHITA, KS 67214 316-267-3629 Fax 316-267-5203

INVOICE DATE	INVOIC	INVOICE NUMBER					
07/25/2022	561-S100	278779.001					
REMIT TO:		PAGE NO.					
JOHNSTONE SUPPLY P.O. BOX 470463 TULSA, OK 74147		1 of 2					

BILL TO:

SHIP TO:

SOUTH CENTRAL KANSAS ECONOMIC DEVELOPMENT DISTRICT-9730 E 50TH STREET N BEL AIRE, KS 67226-8804 SOUTH CENTRAL KANSAS ECON DEVELOPMENT DISTRICT-200 W DOUGLAS AVE STE 710 WICHITA, KS 67202

CUSTOMER NU	CUSTOMER NUMBER CUSTOME			JOB	NAME / RELEASE NUMBER	ORD	ERED BY	
2744		FLE	MMINGS			TY W	/ILLIAMS	
W	RITER		SHIP VIA		TERMS	SHIP DATE	ORDER DATE	
Keith	n Haydei	n	WILL CALL		NET 10TH PROX	07/25/2022	07/18/2022	
ORDER QTY	SHIP QTY	1	DESC	RIPTIC	DN	UNIT PRICE EXT PRICE		
1ea	1e	1STAGE CABINE		M WI	1810.000/ea	1810.00		
1ea	1e	a B78-976	1036487+MGG22 911969A CABINI ES TALL			135. 000/ea	135.00	
1ea	1e	a X83-099	904106 KIT FUR	NACE	EVENTING	66.000/ea	66.00	
1ea	1e	UNCASI	CM36A3F-177L- ED 3T R-22 PISTO F22-00021557			348.513/ea	348.51	
1ea	1e	GOODM PHASE	GSX140361 COM AN 14SEER 12E 208/230V R410A 2206083138			1260.840/ea	1260.84	
1ea	1e	a B15-152	4200 THERMAL .5T-3.5T 410A B			92.250/ea	92.25	
1ea	1e	1/2ID 5/8	30-3132-36 GAS 3OD 1/2FIP X 1/2I 36IN 125,000 BT	MIP T		24.750/ea	24.75	
1ea	1e	B92-534 32X32X3	EL3232-3 PAD E	QUIP	MENT	53.550/ea	53.55	
1ea	1e		6-12-6NM WHIP 6FT 10 GAUGE 3			15.913/ea	15.91	
1ea	1e	1	DDS-30 DISCON 0/240V METALLIC			20.125/ea	20.13	
						Subtotal		
						S&H Charges		
						Тах		
						Payments		
		*** A A 4				Amount Due		
By: ACCTING on 7/26	3/2022 8:15:5	7 AM					A	



TEMPLE ENTERPRISES OF WICHITA 1320 E 2ND STREET N WICHITA, KS 67214 316-267-3629 Fax 316-267-5203

INVOICE DATE	INVOIC	E NUMBER
07/25/2022	561-\$100	278779.001
REMIT TO:		PAGE NO.
JOHNSTONE SUPPLY P.O. BOX 470463 TULSA, OK 74147		2 of 2

BILL TO:

SHIP TO:

SOUTH CENTRAL KANSAS ECONOMIC DEVELOPMENT DISTRICT-9730 E 50TH STREET N BEL AIRE, KS 67226-8804

SOUTH CENTRAL KANSAS ECON DEVELOPMENT DISTRICT-200 W DOUGLAS AVE STE 710 WICHITA, KS 67202

CUSTOMER N	UMBER	CUSTOM	ER PO NUMBER	JOB NAME / RELEASE NUMBER ORDERED BY			RED BY
2744		FLE	MMINGS			TY W	ILLIAMS
\	WRITER	SHIP VIA			TERMS	SHIP DATE	ORDER DATE
Keit	h Hayden		WILL CALL		NET 10TH PROX	07/25/2022	07/18/2022
ORDER QTY	SHIP QTY		DESC	RIPTIC)N	UNIT PRICE	EXT PRICE
1ea 2ea		NON-PR CONVEI R54-245	T701 THERMOS COGRAMMABLE NTIONAL 1/1 HE/ 406-020 ELBOW I 40 SLIP X SLIP	PRO1	34.000/ea 2.318/ea	34.00 4.64	
		07-25-20-22-07-51-002797791	GA333 AM				
voice is due b						Subtotal	3865.58
Past Due invoices may be subject to 1.50% late charge.				ge.	S&H Charges	0.00	
DENOTES TAX	ARIFINE	(2)				Tax	0.00
DENOTES IAA	ADEL LINE	(0)				Payments	0.00
	.6/2022 8:15:57					Amount Due	3865.58

Invoice

*** DUPLICATE ***

UPC Vendor 000000

Invoice Date 08/02/2022

Order Number 47153544-00

Correspondence To Locke Supply Co.

PO Date 08/02/2022 PO Number Stock

Page # 1 of 1

Terms

7.05

P.O. BOX 24980

Oklahoma City, OK 73124

TEL: 405-631-9701

Cust # 34630

Selling Branch

130 PL WICHITA WEST

1031 S WEST ST

Locke Supply

WICHITA, KS 67213-1627

TEL: 316-942-2880

Ship To | SOUTH CENTRAL KS ECONOMIC DEV

9730 E 50TH ST. N. WICHITA, KS 67226 US

9730 E 50TH ST. N.

WICHITA, KS 67226 US

Character, Customer Service, Employee Owned

Bill To SOUTH CENTRAL KS ECONOMIC DEV

Instructions

Taken By

Currency

Ship Point

7174 Via

Shipped

Total Due

130 PL WICHITA WEST

Reference

Sales Rep In/Out

08/02/2022 5%10thNT25th Freight Terms Description

003 / 003

Line #	Product And Description	Quantity Ordered	Quantity B/O	Quantity Shipped	Qty UM	Unit Price	Amount (Net)
1	R0001 1/2 PT PURPLE PRIMER 8756S	1	0	1	each	6.56	6.56
1	Lines Total	Qty Ship	ped Total	1		Subtotal	6.56
						Taxes	0.49
						Down Payment	0.00

*** DUPLICATE ***

UPC Vendor 000000

Invoice Date 08/02/2022 PO Number

Invoice

Order Number 47153546-00 Page # 1 of 1

Correspondence To Locke Supply Co. P.O. BOX 24980

PO Date 08/02/2022

STOCK

Cust # 34630

Bill To

SOUTH CENTRAL KS ECONOMIC DEV 9730 E 50TH ST. N.

WICHITA, KS 67226 US

Character, Customer Service, Employee Owned

056 EL WICHITA WEST

1031 S WEST ST **Locke Supply**

WICHITA, KS 67213-1627

Oklahoma City, OK 73124 TEL: 405-631-9701

TEL: 316-945-7676

Ship To SOUTH CENTRAL KS ECONOMIC DEV 9730 E 50TH ST. N.

WICHITA, KS 67226 US

Instructions

Taken By

Currency

Ship Point

Selling Branch

4898 Via

Shipped Terms 08/02/2022 5%10thNT25th

056 EL WICHITA WEST

Reference

Sales Rep In/Out 003 / 003

Freight Terms Description

	1				005 / 005	
Line #	Product And Description P0728	Quantity Quantity Ordered B/O	Quantity Shipped	Qty ÜM	Unit Price	Amount
		500 0	500	anah	1100	(Net)
1 1	12 STR THHN BLACK 500R Lines Total		***	each	193.54	96.77
		Qty Shipped Total	500		Subtotal Taxes Down Payment Total Due	96.77 7.26 0.00 104.03

*** DUPLICATE ***

UPC Vendor 000000 PO Date 08/02/2022

Invoice Date | Order Number 08/02/2022 PO Number Stock

Invoice

47153636-00 Page # 1 of 1

Correspondence To Locke Supply Co.

Selling Branch

P.O. BOX 24980

Oklahoma City, OK 73124

TEL: 405-631-9701

130 PL WICHITA WEST 1031 S WEST ST **Locke Supply**

WICHITA, KS 67213-1627

TEL: 316-942-2880

Ship To SOUTH CENTRAL KS ECONOMIC DEV 9730 E 50TH ST. N.

SOUTH CENTRAL KS ECONOMIC DEV

Character, Customer Service, Employee Ormed

Cust # 34630

Bill To

WICHITA, KS 67226 US

9730 E 50TH ST. N. WICHITA, KS 67226 US

Instructions

Taken By 7174 Via

Currency

Ship Point 130 PL WICHITA WEST

Reference

Sales Rep In/Out

Shipped Terms 08/02/2022 5%10thNT25th Freight Terms Description

A tono	In. d					003 / 003	r teigill Terms	S Description
1	Product And Description L8154	Quantity Ordered	Quantity B/O	Quantity Shipped	Qty UM	Unit Price		Amount (Net)
1 [FROSTEX FLEXFIT PLUG KIT 9800 38247 Lines Total	0 382471-000 Qty Shippe		5		Ι	23.73 Subtotal Taxes Down Payment Total Due	118.65 118.65 8.90 0.00 127.55

*** DUPLICATE ***

Correspondence To Locke Supply Co.

Invoice UPC Vendor 000000

Invoice Date | Order Number 08/02/2022 PO Number STOCK

PO Date 08/02/2022

47154306-00 Page # 1 of 1

Cust # 34630

Bill To

SOUTH CENTRAL KS ECONOMIC DEV 9730 E 50TH ST. N.

WICHITA, KS 67226 US

Character, Customer Service, Employee Owned

Selling Branch

016 PL WICHITA EAST 1212 S WOODLAWN

Oklahoma City, OK 73124

P.O. BOX 24980

TEL: 405-631-9701

Locke Supply

WICHITA, KS 67218-3637

TEL: 316-267-1090

Ship To SOUTH CENTRAL KS ECONOMIC DEV 9730 E 50TH ST. N. WICHITA, KS 67226 US

Instructions

Taken By 7606 Via

Currency

Ship Point 016 PL WICHITA EAST Reference

Shipped Terms 08/02/2022 5%10thNT25th Freight Terms Description

Sales Rep In/Out 003 / 003

f ine	Product					003 / 003		
#	And Description L8151	Quantity Ordered	Quantity B/O	Quantity Shipped	Qty UM	Unit Price	Amou	
	FROSTEX 250ft REEL SOLD BY THE FOO	163	0	163	feet	247.71	(Net)
1]	Lines Total	Qty Ship	med Total	1.00		347.75	, 56	56.83
		49 omb	peu Itiai	163		Sub	total 56	66.83
							axes 4	2.51
						Down Payn	nent	0.00
						Total :	Due 60	9.34

Character, Customer Sorvice, Employee Owned

*** DUPLICATE ***

UPC Vendor 000000

Invoice Date 08/02/2022 PO Number

Order Number 47154380-00

Correspondence To Locke Supply Co. P.O. BOX 24980

TEL: 405-631-9701

PO Date 08/02/2022 stock Page # 1 of 1

Cust # 34630

Bill To SOUTH CENTRAL KS ECONOMIC DEV 9730 E 50TH ST. N.

WICHITA, KS 67226 US

Selling Branch

038 HC WICHITA EAST 1212 S WOODLAWN

Oklahoma City, OK 73124

Locke Supply

WICHITA, KS 67218-3637

TEL: 316-682-0909

Ship To SOUTH CENTRAL KS ECONOMIC DEV 9730 E 50TH ST. N. WICHITA, KS 67226 US

Instructions

Taken By 7843

Currency

Ship Point 038 HC WICHITA EAST

Reference

Via Shipped 08/02/2022

Terms 5%10thNT25th

Sales Rep In/Out 003/003

Freight Terms Description

ine Product	7				003 / 003		- 550/ipti0//
# And Description I T2087	Ordered	B/O	Quantity Shipped	Qty UM	Unit Price	***************************************	Amount (Net)
MSHXLC 6" 1/4"X5/16" REVERSIBLE/M. Lines Total	AG/NUT-DRIV Qty Shippe	/R d Total	1	each		18.20	18.20
			,			Subtotal Taxes	18.20
						Down Payment Total Due	1.37 0.00 19.57





City of Caldwell 2022 Community Development Block Grant

Contractor Guidelines

(General, Sub, Independent, and Prime Contractors included)

In order to be eligible to work on houses in the Caldwell Housing Rehabilitation program contractors must meet the following program requirements.

I. Contractor Eligibility

- A. Contractors are placed on the Bidders List through contact with the Caldwell City Hall.
- B. All contractors must obtain a minimum of a local residential permit as defined by the Caldwell City Code through the City of Caldwell.
- C. All plumbing, electrical, and mechanical subcontractors must be licensed and have qualifications information on file with the City and the Grant Administrators.
- D. Contractors must provide work and credit references.
- E. Contractors must have good references.
- F. Contractors must be in good standing, which means they will not appear on the Department of Labor's debarment list.

II. Contractor Requirements

- A. Contractors shall comply with all federal and state guidelines, rules, regulations, and orders issued by the U.S. Department of Housing & Urban Development, the U.S. Department of Labor, and the Kansas Department of Commerce governing the Caldwell Housing Rehabilitation program.
- B. Contractors will not be awarded more than two (2) rehabilitation houses in the City at one time, unless the dollar value of a housing rehabilitation contract is less than \$2,500; except under special exceptions granted by the City Commission. Contractors who have an open contract from a past round of houses can only have a total of three (3) contracts open. A rehabilitated house is deemed complete when a certificate of completion has been completed and issued by the City of Caldwell.



- C. Contractors shall provide, and shall require any subcontractors to provide, certificates or other evidence of insurance prior to signing a contract certifying that, for the period covered by any contract, all contractors and subcontractors carry:
 - Workmen's Compensation Insurance for all owners, employees, and employees of subcontractors engaged in work on the premises, in accordance with the Kansas Workmen's Compensation Laws.
 - 2. Manufacturers and Contractors Public Liability Insurance with limits of \$100,000/\$300,000, to protect the contractor, his subcontractors, and the owners, as their interest may appear, against claims for injury to, or death of, one or more person, due to accidents which may occur or result from operations under and contract; such insurance shall cover the use of all equipment, machinery, hoists, and motor vehicles used in the performance of work.
 - 3. Property damage insurance in an amount not less than \$25,000 pep to protect the contractor, his subcontractors and the owners, as their interests may appear, from claims for property damage that might arise from operations under any contract.
 - 4. Any and all additional insurance required by the laws of the State of Kansas.
 - 5. Lead-Based Paint Certification for themselves, all employees, and subcontractors, as applicable by laws.
 - Renovation Firm License through the Kansas Department of Health and Environment.
 - 7. Kansas Roofing Contractor Registration Certificate through the Kansas Attorney General's Office
- D. An invitation to bid will be sent to all contractors. Those contractors interested will be sent a bid package which will include:
 - 1. Instructions to bidders, which will include bid tour date and bid opening.
 - 2. The final bid specifications for each house.
 - 3. A required Bid Proposal form for each house.
 - 4. General and Material Specifications.
 - 5. A notice of where lead hazards have been identified.
 - 6. A copy of the Construction Contract (for informational purposes only).
- E. Contractors should send sealed bids to the City Clerk, Kristin Hutsler, with the City of Caldwell at 14 W Central, Caldwell, Kansas 67022.



- F. Bid selection will be determined by the following factors for each house:
 - 1. Lowest bid.
 - 2. Each contractor will only be allowed to have three (3) open CDBG housing contracts at one time.
 - 3. Low bid on individual line items that are selected for inclusion in the final contract document specifications.
 - 4. Quality of workmanship on previous projects.
 - 5. Performance on previous contracts with federal and state funds.
 - 6. References supplied by the contractor.
- G. City Commission approves the best eligible.
- H. Conference is held between the Grant Administrator and the contractor to finalize the contract specifications, contract terms and go over federal and state rules, regulations, and laws. Contract specifications may need to be revised due to a maximum allowable limit per house placed on grants to homeowners. The contract specifications will contain only the highest priority repairs on each house. Change orders must be approved by the inspector and city commissioner.
- I. Conference is held between the Grant Administrator, the contractor, and the homeowner to sign the contract and issue the Notice to Proceed.
- J. All contractors will be required to receive a City of Caldwell Building Permit prior to beginning any work on the project. Building permit fees shall be waived for all portions of the rehabilitation work funded with CDBG Funds. Contractors are required to receive all inspections that would otherwise be required.
- K. CDBG Projects are eligible for Sales Tax Exemptions filed through the Kansas Department of Revenue. Ultimate exemption is determined by the State of Kansas. For it to be sent for consideration to the State of Kansas, the following information will be required to be provided to the City Clerk:
 - 1. Start date of the project.
 - 2. Expected end date of the project.
 - 3. Cost of the project.
 - 4. Company's official name and address.
 - 5. Address of project where work is occurring.
 - 6. Scope of the work being completed at the project.



- 7. Notification must be provided upon completion of the project and a date shall be provided for completion. Final completion notification shall be sent to the City Clerk.
- L. In conjunction with signing a contract, the selected contractor is required to complete Part

 One of Lien Prevention Document.
- M. Terms of payment must be met for payment to be made by the City.
 - At 100% of work completion, contractor will submit and invoice to city hall. Work
 must pass inspection for the payment to be received. Checks will be issued after
 approval and signed at the commission meeting.
 - Certificate of Completion must be signed and submitted prior to final payment is issued.
 - 3. Part Two of the Lien Prevention Document must be completed and submitted prior to final payment being issued by the City of Caldwell.

City of Caldwe	eli, Kansas.	
APPROVED BY	/ :	DATE:
	Jamie York, Mayor	
ATTEST:		DATE:
	Kristin Hutsler, City Clerk	



City of Caldwell 2022 Community Development Block Grant (CDBG) Housing Rehabilitation Plan

The United States Department of Housing & Urban Development (HUD) allocates funds used by the Kansas Department of Commerce for the Community Development Block Grant (CDBG) Housing Rehabilitation program. The City of Caldwell has been awarded a CDBG grant from Commerce for the purpose of housing rehabilitation within the target area. The maximum amount of CDBG federal grant funds to be spent on rehabilitation is \$25,000 per unit. Private match is encouraged to fill the gap in financing if a rehabilitation will exceed this threshold (I.E. weatherization program). This program is designed to provide housing rehabilitation for low-to-moderate income individuals who own (or rent) a housing unit within the target area.

Applicants will be screened and rated in accordance with eligibility criteria as set out in this Housing Rehabilitation Plan.

- Total Area bounded by South Side of W. Ave. E, the West side of N. and S. Webb, the North side of W 1st Ave, and the East side of N. & S. Caldwell Blvd
 - South Side of W Ave. E bounded by the West side of N. Webb and the East side
 of N. Caldwell Blvd
 - West side of North & South Webb bounded by South Side of W Ave. E and North side of W. 1st Ave
 - North side of W. 1st Ave bounded by West side of South Webb and East side of South Caldwell Blvd
 - East side of North & South Caldwell Blvd bounded by the South side W. Ave E and North side of W. 1st Ave

APPLICATION SELECTION CRITERIA

First-Come/First-Served

A public meeting will be held to review and explain the application and grant program In Mid-June. Housing Applications are due to the Caldwell City Hall by Friday, July 29, 2022, at 4pm. Applications must be turned in to City Hall during business hours or by mail or will be taken at City Hall Monday through Friday between 9 a.m. – 12 p.m. and 1 p.m. - 4 p.m. Applications will be accepted on a first-come/first-served basis. Homeowners who turned in Pre-Applications will be contacted first. Applications received after this date will be processed only if grant funds are still available and will be selected by time/date stamp of received. Individuals having received a Housing Rehabilitation grant in the past are not eligible.

ELIGIBILITY REQUIREMENTS

Only property located within the target area is eligible for rehabilitation. To qualify, total household income for all individuals 18 years or older living in the home must be less than the low-to-moderate income guidelines set by HUD for Sumner County, Kansas. The eligible home must be the primary residence of the applicant for owner-occupied units. For rental units, the renter must be income qualified. If the owner of the rental unit is income-qualified, the City will pay 85% of the rehabilitation and the Owner will be responsible for 15%. If the owner is above income guidelines, he/she must contribute 25% of the rehabilitation cost. The owner of the unit must also sign a rent-freeze agreement for a three-year period.

The total household income (income from all sources of family members over 18 years of age) must be less than the following income limitations:

No. In	LMI Income	
Household		
1	\$43,200	
2	\$49,400	
3	\$55,550	
4	\$61,700	
5	\$66,650	
6	\$71,600	
7	\$76,550	
8	\$81,450	

Note: The LMI income limits will always use the most current income requirements as established by HUD.

- 1. The real property taxes and utilities must be current and up to date for all properties until project completion.
- Hazard insurance naming the City as an additional insured in at least the amount of the rehabilitation contract will be required. If repairs are necessary to obtain the hazard insurance, then evidence is required showing that coverage will be provided upon

completion of the rehabilitation. If applicable, grant funds can be used to purchase required hazardous insurance. Expense will be deducted from maximum award per unit.

3. The applicant must have owned the unit prior to the grant award date.

VERIFICATION OF ELIGIBILITY

All income information will be kept confidential. Applicants must qualify as low-to-moderate income (LMI) prior to the time the inspection for rehabilitation is conducted. Re-verification will be required is a new income tax return has been filed prior to inspection. Also, re-verification will be required if 6 months has lapsed, and rehabilitation has not yet begun.

Adjusted Gross Income from the latest years IRS 1040 will be used for income verification. All income tax returns will need to be included for anyone in the household over 18 that are not attending school. The most recent tax return must be used – NO EXCEPTIONS.

TYPES OF FINANCIAL ASSISTANCE

- Households who income-qualify will be awarded CDBG Housing Rehabilitation funds in the form of a soft or deferred loan for the full amount of the rehabilitation costs or the maximum allowed under CDBG guidelines, whichever is less, for a three-year period.
- 2. A soft loan may be forgiven and considered a grant if all contractual agreements are followed.
- 3. The homeowners are required under CDBG guidelines to enter into a contractual agreement with the City, which will place a lien against the rehabilitated property for a three-year period to meet the guidelines as set out by the Housing Rehabilitation Plan.
- 4. The agreement will also stipulate that the unit must be the homeowners' primary residence (unless a rental agreement has been signed), kept and maintained in a standard condition.
- 5. If within the three-year lien period the homeowner should move from the housing unit, it's allowable to sell to a low-to-moderate income person, who will occupy the unit as the primary residence and will assume the balance of the prorated lien. The City must verify the income of the person intending to purchase the home, or if the home is sold to someone other than a low-to-moderate income individual, the cost of the rehabilitation will be prorated and must be paid back into the City's Housing program by the homeowner. Proration example is shown below (6).

6. If a homeowner dies within the three-year lien period and has no spouse, the home may be sold or rented to a low-to-moderate income household. If sold or rented to a non-LMI family, the homeowner's estate must pay back the prorated amount on the lien. For example, if the home is sold in the 13th month following completion of the rehabilitation, then 12/36, or 1/3, of the loan would be forgiven and the homeowner's estate would repay 2/3 of the original amount.

STANDARDS FOR IMPROVEMENTS

This program does not consist or remodeling or cosmetic repairs. The goal of the Housing Rehabilitation program is to add twenty years to the useful life of the housing unit. Housing rehabilitation activities will include only the repairs necessary to meet the Housing Quality Standards (HQS) defined by the Housing Rehabilitation program as determined by the Housing Inspector. Housing units considered for rehabilitation must meet the definitions of a substandard unit and must be suitable for rehabilitation.

"Substandard" is defined as a housing unit that does not adequately meet Housing Quality Standards criteria set for the following: Building Exterior (roof, gutters, doors, windows, and insulation), Heating System, Plumbing System, Electrical Systems/Appliances, or Building Interior (ceilings, walls, floors, doors, ventilation, smoke detectors)

"Suitable for Rehabilitation" is defined as a substandard house for which it is technically and financially feasible to restore it to a standard condition, given the funding limits of the program. Emergency repairs and handicapped accessibility items may be addressed on a case-by-case basis at the discretion of the contractual consultants and City Commissioner following the CDBG guidelines. Emergency repairs must be verified by the City's Contracted Housing Inspector and must cause an immediate and overwhelming threat to the home's occupant. The emergency repair must be brought to code standards (2017 IBEC).

Only one grant per house may be awarded.

LIMITED/INELIGIBLE ACTIVITIES

The following activities are limited to the identified restrictions:

- Mobile Homes.
 Mobile homes will not be considered for rehabilitation under this program.
- 2. Rental units are eligible if:
 - a. Tenant is documented to be LMI.
 - b. If homeowner is documented to be LMI, an 85% grant may be allowed.

- If homeowner is documented to be non-LMI, homeowner must provide 15% matching funds.
- d. The homeowner must sign an agreement that all tenants renting this property within the 3 years from the date of this agreement will have an income that does not exceed the most recently published Department of Housing and Urban Development (HUD) LMI guidelines.
- e. The homeowner of the unit must also sign an agreement indicating that the monthly rental payment will not exceed the current amount, or the Fair Market Rents (FMR) as published annually by HUD for a three-year period after the rehabilitation is complete. Monthly rental amount can be adjusted for only cost of living adjustment (COLA).
- f. The homeowner of any rental unit receiving CDBG grant funds for rehabilitation also agrees to allow the City of Caldwell or its appointed representative access to the property to perform an annual HQS inspection, for a minimum of the 3 years after the rehab work is finished. Any HQS deficiencies discovered during the annual inspection will need to be brough into compliance at the landlord's expense.

3. Self-Help

a. The City will not allow self-help projects.

4. Living Trust

- b. Applicants meeting all other eligible criteria, and who currently reside on a property with a title held by a Living Trust, are eligible for a rehabilitation repayment agreement.
- c. Income eligibility is determined by the income of the person residing at the property.
- d. The holder of the deed will be required to sign all grant documents.
- e. A property held as a Living Trust must be considered as a tenant and handled as such.

The following activities are considered ineligible:

- 5. Homes located in a flood plain are not eligible.
- 6. Homes being purchased under a contract for deed are not eligible.
- 7. Homes held in life estates are not eligible.
- 8. Remodeling or work not required to meet CDBG standards.

"WALK-AWAY" POLICY

If the initial inspection and cost estimate for bringing the home up to Housing Quality Standards indicates that the cost of rehabilitation is expected to exceed the maximum allowable, the homeowner will be notified. The application will be considered a "walk away" until:

- 1. The homeowner has completed some of the repairs on their own and the estimate of the remaining work would be at or below the maximum allowable. The homeowner is responsible to notify the City when they have the work completed so the property can be re-inspected. All work must be approved by the contracted Housing Inspector.
- 2. If the homeowner is unable to make repairs, they may provide the necessary additional funds within 45 days after they are notified. If the funds have not been deposited at the City within the allotted time, the City will cancel the application, close the file, and "walk away" from the property.

If the original cost estimate is below the maximum allowable, the property will be included in the next bidding process. Homeowners will be notified within 15 days after the bid opening if the lowest contractor bid for their home exceeds the maximum allowable. In that event, the applicant will have the option to supply the additional funds. The applicant will be given 45 days to satisfy the requirements for all necessary additional funding. Additional funds must be received in full by the City prior to the execution of the construction contract. If the homeowner cannot provide the additional funds, the City shall "walk away" from that home. If the applicant does not respond in 30 days, the City will cancel the application, close the file, and "walk away" from the property.

Lead-based paint risk assessment inspections will be completed after the Housing Quality Standards inspection and if the estimated cost for repairs is below \$25,000. If the lead-based paint risk assessment shows lead and repairs cannot be done with containment, which allows a family use of restroom, cooking, and sleeping facilities, and the family must relocate to a lead safe housing unit for the duration of the remediation and until the dwelling passes the clearance test. Refusal to relocate will be grounds to "walk away".

Children, age six or younger, will be required to relocate if lead activity is necessary, even if containment is possible. Refusal to relocate will be grounds to "walk away".

LEAD-BASED PAINT REQUIREMENTS

The homeowner, contractor, City, Grant Administrator, and contracted Housing Inspector will be required to follow all regulations of all state and federal regulations regarding lead-based paint hazards. The appropriate regulations are hereby made a part of this plan.

Participation in the Housing Rehabilitation program is voluntary for all parties. All property proposed for rehabilitation, and built prior to 1978, will be inspected for lead-based paint. The City will require that children younger than 6 years of age living in a house built prior to 1978 be tested for an elevated blood lead level. If an applicant refuses to allow the child's blood to be tested, the City may elect not to rehabilitate the home (walk away policy).

The City is not required to pay any expenses for relocation of the household that may be required by lead-based paint activities during construction. However, the City recognizes that if relocation is required, it could produce a degree of hardship on the household. It will be the policy of the program and the approved city commissioner to provide the household with \$150 per day relocation expense allowance for a household of two persons, plus \$30.00 per day for each additional household member. This allowance will be paid for the actual days the members are required to be out of the home. If a family voluntarily relocates during rehabilitation, when relocations is not required, it will be the policy of the City to not pay any relocation expenses. Regardless of relocation status, the residents must relocate to a lead-safe housing unit built after 1978.

LEAD-BASED PAINT PRECAUTIONS

All occupants of property to be rehabilitated will be notified of the following:

- 1. All households will receive both the "Protect Your Family from Lead in Your Home" and "Renovation Right" brochures.
- 2. All households will receive a copy of the risk assessment report to sign within 15 days after the risk assessment is completed.
- 3. If lead-based paint is discovered in the assessment, households will receive a "Lead Hazard Reduction Notice" within 15 days after work is completed.
- All households, which have been identified as having lead-based paint, will receive a copy of the "Lead Hazard Clearance Notice".
- 5. Require any individual 6 years of age or younger, residing in the home, to have a blood test for elevated levels of lead.
- 6. Homeowners may sign a waiver to remain in their home if no child 6 or under lives in the house and the repairs can be completed with self-containment; and restroom, cooking, and sleeping facilities are available.

- 7. Relocation costs to a lead-free dwelling may be paid to a homeowner or tenant when the risk assessment shows elevated levels or lead in areas where repairs will be done with or without containment and a restroom, cooking, and sleeping facilities are not available.
- 8. Participation in the Housing Rehabilitation program is voluntary; therefore, temporary relocation expenses are not required.

ROLES AND RESPONSIBILITIES

Homeowner/Tenant

The homeowner/tenant must agree to abide by all the rules and regulations of the Housing Rehabilitation program and allow the rehabilitation work to be performed on his/her home in accordance with the Housing and Lead Hazard Control Plans, the Material Application Manual, procurement requirements, and/or the CDBG Housing Standards guidelines.

The homeowner/tenant must:

- 1. Complete a Property Owners' Repayment Agreement.
- 2. Remove all obstacles from inside and outside of the house in order to view and subsequently work on the dwelling. This may include removing any stored items from areas and cutting any weeds or saplings that may obscure the foundation or hauling away items stacked in or around the house, or homeowner/tenant must agree to allow debris to be removed from the premises by the contractor or resident.
- 3. Grant access to the dwelling for additional inspections, pre-bid conference inspections, rehabilitation work, ongoing inspections of work, and state monitoring visit.
- 4. Provide utility access to the contractor at no cost.
- 5. Sign a waiver or liability for the property identified in the application.
- 6. Provide proof of property insurance and must keep the dwelling insured for the threeyear repayment agreement period. The city will need to be listed as an additional insured on the homeowner policies for the three-year period. As additional insured, the City will receive official notification of any lapse or change in covered insurance.
- 7. Shall provide documentation of lead blood level for every child aged 6 and under if the home was constructed prior to 1978, prior to rehabilitation work proceeding.
- 8. Must agree to relocate should it become necessary in order to perform the lead hazard work.
- Maintain the rehabilitated property in good condition and repair so it will not become a substandard property.

- 10. Must fill out an application and supply income documentation for the Weatherization program.
- 11. The homeowner will be required to attend the final inspection and sign the final inspection certificate. If the homeowner has questions or comments on any of the rehabilitation work, it should be mentioned at this time and resolution agreed upon, prior to signing the certificate of completion.
- 12. If requested, the homeowner must make the home available at a CDBG monitoring visit.

GRIEVANCE POLICY

All grievances or concerns regarding civil rights, fair housing, the City Commission, the Grant Administrator, City Administrator, the contracted Housing Inspector, the contractor(s), the contractor's workmanship, the bid procedure(s), the awarding of the contracts, etc. shall follow the grievance policy included in this application. All grievances and concerns should first be made in writing to the City Clerk. The City Clerk will then observe the following procedure:

Level 1

The City Administrator receives a written complaint.

The City Administrator contacts the Grant Administrator if the controversy is regarding workmanship, client treatment or contractor misunderstandings. The Grant Administrator will contact the contracted Housing Inspector and contractor to meet on site and address the client or contractor concerns. A written resolution will be made to the complainant and a copy of the resolution will be forwarded to the City Administrator.

The City Administrator will immediately advance the complaint to level 2 if the complaint is on fair housing, civil rights, procurement, or an environmental issue.

The complainant has the right to appeal the decision and must do so in writing to the City Administrator within five days from the date of the written resolution.

Level 2

The written complaint concerning fair housing, civil rights, procurement, the environment, or an appeal of a previous decision will be reviewed by the Mayor, City Administrator, and City Clerk, with the assistance of the Grant Administrator and the City Attorney. If the complaint is a fair housing or civil rights concern, the City may submit the complaint to the Kansas Human Rights Commission, 300 W. Douglas, Suite 220, Kansas, 67202, for investigation and resolution. After review, a written decision will be made to the complainant and the City Commission.

The complainant has the right to appeal the decision and must do so in writing to the City Administrator within five days from the date of the written resolution.

Level 3

The City Administrator receives a written appeal from the complainant.

The City Commission will review the appeal with assistance from the City Attorney and Grant Administrator. All written evidence will be made available to the City Commission for their deliberation.

The City Commission shall present a written resolution to the complainant within 15 days of the date the appeal was received.

All grievances/concerns regarding this project should first be made in writing. The letter must be submitted to the City Administrator. The City Administrator will then refer the complaint to the appropriate party(ies) to resolve the dispute.

Written notice will be given to the complainant within 15 days. If the grievance remains unsolved after this action, the Grant Administrator, contracted Housing Inspector, contractor, and the homeowner will review the situation. Subsequently, a written recommendation or resolution will be forwarded to the City Commission.

If this problem still cannot be resolved, the City Commission will make disposition of the complaint from documentation that the complainant, contracted Housing Inspector, contractor and/or Grant Administrator have submitted. Any of the involved parties may be called to appear before the City Commission for clarification of the matter.

The City Commission will then review the complaint at the next City Commission meeting. The City Commission will determine at that meeting if the decision is acceptable or unacceptable. If it is unacceptable, the City Commission has the right to overturn the decision. At that time the final disposition will be made in writing to the complainant.

Final responsibility for the Housing Rehabilitation program rests with the City. The City will be involved with the Housing Rehabilitation program, perform duties as necessary and will have the final decision in local matters involving this grant.

CONFLICT OF INTEREST POLICY

The City will follow the Kansas Department of Commerce's Conflict of Interest Policy. Persons covered under this policy include: a city employee, elected or appointed official, agent, consultant, officer or any immediate family member or business partner of the above, of the recipient, or any designated public agencies or sub-recipients, which are receiving funds from

the CDBG program. A copy of this policy has been adopted and is available for review from the City. Amendments of these policies and procedures may be made by the City and must be submitted to the Kansas Department of Commerce for approval. When changes in the CDBG guidelines would adversely affect Housing Rehabilitation program applications already under review, such application will be evaluated under the CDBG guidelines in effect at the time of application.

City of Caldwell, Kansas

APPROVED BY


Jamie York, Mayor

ATTEST:

Kristin Hutsler, City Clerk

DATE: 4-6-2022

DATE: 4-10-1012

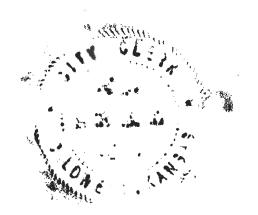

HOUSING REHABILITATION MATERIAL APPLICATION STANDARDS

IMPORTANT

Please read material, application and performance standards carefully.

Contractor will obtain and pay for all necessary licenses, permits and privileges required in his work, and perform all work in strict accordance with the laws and ordinances in force in the State of Kansas, and in the locality in which this work is to be performed. Contractor will investigate what Federal, State or Municipal laws and requirements are applicable and comply with all in an approved manner.

Lead Safe Work Practices will be implemented on all homes built prior to 1978 that receive CDBG Housing Rehabilitation funds.

SHOULD THERE BE ANY CONFLICTS BETWEEN THESE SPECIFICATIONS AND THE WORK WRITE-UP, THE PROJECT INSPECTOR SHOULD BE CONTACTED FOR A FINAL DETERMINATION.

3/4/2020

CARPENTRY SPECIFICATIONS

A. Concrete Work

- 1. The concrete mix shall be 3,000 pounds transit mix or with a 5 1/2 sack mix for both interior and exposed concrete.
- 2. No concrete shall be poured on frozen ground.
- 3. All concrete flat work must be over a 2" layer of gravel/sand on compacted earth and be reinforced properly.
- 4. All flat work concrete must be a minimum of 4" thick with 1/2" pre-molded asphalt or non-bituminous fiber-filled material expansion joints at entrance platforms, steps, intersections with driveways or walks, and in long runs at least every 50'.
- 5. Control joints must be provided at no more than 5' intervals for sidewalks and 20' intervals for floors, concrete drives, and parking slabs.
- 6. Footings must be below the freeze line, 8" thick, and reinforced properly with rebar.
- 7. Foundation walls must be 8" wide and reinforced properly with rebar.

CONTRACTOR MUST CALL FOR A SITE INSPECTION AFTER SITE IS READY FOR CONCRETE AND 24 HOURS PRIOR TO POURING. AFTER 24 HOURS HAS ELAPSED CONTRACTOR MAY PROCEED. NOTIFY THE PROJECT INSPECTOR.

B. Masonry Work

- 1. No masonry work shall be done when the temperature of the surrounding air is likely to cause freezing.
- 2. All joints must be completely filled with mortar.
- 3. All brick, stone, or block used should match, if possible, adjacent work. The owner(s) must approve samples before starting the work, unless the work is to be painted or covered.
- 4. Soft salmon type brick shall not be allowed.
- 5. Tuck-pointing shall only be done after the joints have been raked out to a minimum depth of 1/2" and wetted.
- 6. All damaged, loose, or salmon brick, in area to be rebuilt, must be removed until sound brickwork is encountered.
- 7. New brick patches must be toothed into and match in the existing work in site, joints, and bond.
- 8. Veneer brickwork must be tied to frame wall with galvanized wall ties on every third course, 32" on center, and shall conform to above specifications.
- 9. All new retaining walls over 24" high must have #4 steel dowels placed every 2' and be imbedded at least 6" into the footings.
- 10. Retaining wall footings shall be three times the thickness of the wall in width and 8" deep, containing three (3) #4 steel rebar.
- 11. All retaining walls over 24" high shall have weep holes at grade level at 8' intervals.
- 12. All block replacement foundation walls shall have a galvanized steel bed reinforcement (8" mesh) in 2nd course and 5th course of block. Concrete block or poured wall may be used for all foundation walls.

C. Grade

Shall mean backfill along foundation with topsoil and provide sufficient slope in finish grade to provide drainage away from house.

D. Framing Lumber

- 1. Must be No. 3 Southern Pine, SB, SPF, standard grade, or better.
- 2. Studs must be Stud Grade.
- 3. Allowable spans for floor, roof, and ceiling joists no greater than 24" centers.
- 4. Bearing partition stud walls may not be less than 2" x 4" studs with dimension perpendicular to the wall, 16" on center.
- 5. Floor joist spacing may be no more than 16" on center when 25/32" flooring is to be applied directly to the joist; or, 16" on center when any lesser thickness of finish flooring is to be laid over a sub-floor.
- 6. Gutting of structural members shall not be done without the approval of the Project Inspector.

E. Sub-Flooring

- 1. Plywood shall be Southern Yellow Pine (SYP), 1/2" minimum where 25/32" finished flooring is to be laid or 5/8" where resilient flooring is to be laid and joists are not over 16" on center.
- 2. Nail plywood sub-floor to joint at each bearing with No.8 cemented or galvanized, or No. 6 threaded nails spaced 6" on center along all edges, and 10" on center along intermediate members.
- 3. Install plywood with outer piles at right angles to the joists and staggered so that the end joists in adjacent panels bear on different joists.
- 4. Common boards used as sub-flooring shall not be over 11" wide or less than 3/4" thick when laid on joist spaced 10" on center, and shall be laid diagonally if hard wood flooring is laid.
- 5. Nail boards with No. 8 box nails or No. 6b threaded nails, as follows:
 - a. Two (2) nails in 3" boards.
 - b. Two (2) nails in 4" boards.
 - c. Three (3) nails in 6" boards.
 - d. Four (4) nails in 8" boards.
 - e. Five (5) nails in 12" boards.

F. Underlayment

- 1. Shall be 3/8" structural grade plywood or 1/4" underlayment.
- 2. Nail underlayment with cement coated, rosin coated, or ring shank nails placed on 4" centers on all edges and over the face of each piece.
- 3. Cement Board in high moisture area installed using Manufacturer Specifications

G. Finish Flooring

- 1. Strip Wood Flooring
 - a. Material must be softwood with 25/32" minimum thickness.

- b. Shall be 3 1/4" maximum width.
- c. Nails shall be as recommended by flooring manufacturer. Blind nail tongue and groove flooring, driving nail at an approximate angle of 50 degrees. Space nails every 10" to 12" on center.

2. Sheet Vinyl Flooring:

- a. Minimum 0.065" gauge overall thickness.
- b. Shall be 0.025" gauge wear layer, 10' wide rolls.
- c. The owner(s) shall be shown at least three (3) samples to select from a quality that will cost no more than \$20 per yard including installation.
- d. Mastic shall be as recommended by flooring manufacturer. (No gluing only along the edges will be allowed).
- e. All joints and cracks in base shall be filled, smoothed, and leveled.
- f. Where irregular floor conditions exist, install underlayment to receive vinyl flooring.
- g. Layout to minimize joints in vinyl flooring. Small strips or patching will not be allowed.
- h. Owner(s) shall sign color sample.

3. Carpeting and Padding:

- a. The owner(s) will select from at least three (3) carpet samples.
- b. Based on a specified allowance, not to exceed more than \$20 per yard including installation.
- c. Owner(s) shall sign color sample.
- d. Where irregular floor conditions exist, install underlayment to receive carpet.
- e. Carpet shall be stain and soil resistant treated, FHA approved, and installed in strict accordance with manufacturer's specifications.
- f. Padding shall be, FHA approved, and installed according to manufacturer's specifications.

CARPET WILL NOT BE ALLOWED IN BATHROOMS, KITCHENS, AND UTILITY ROOMS.

H. Finish Lumber

- 1. Shall be free from tool marks and other objectionable defects.
- 2. Solid lumber and miscellaneous trim for interior finish shall be vinyl or solid stock white pine, if stained. Finger joints, allowed if painted.
- 3. All exterior solid lumber and trim shall be sealed against the weather. Exterior porches and all wood meeting the ground shall be treated lumber.
- 4. Porches shall have a top, intermediate, and bottom railing.

I. Exterior Doors

1. Doors:

- a. Shall be new, wood flush, particle core, exterior grade, and standard entrance doors with window light. A pre-hung foam filled insulated steel door is preferred.
- b. Shall conform to the thickness of the doorjamb and be hung on three (3) 3 1/2 x 3 1/2" butt hinges, flush mounted.
- c. Shall have a glass window or peep hole (client to decide). If window is desired must be a minimum Low-E Argon gas filled, with a u-value of 0.32 or better as rated by NFRC, or approved equal.

- d. Replacement shall include weather stripping, installation of door sweeps, locksets, and hinges.
- e. After installation, doors are to be neat in appearance and operate smoothly to insure an airtight seal.
- f. Replacement doors are to be finished as per painting specifications.

2. Weather Stripping:

- a. All existing weather-stripping (W/S) is to be removed prior to the installation.
- b. W/S shall be installed on both sides and top of doorjamb and shall be Q-lon (Vinyl clad foam) with aluminum back or equivalent.
- c. The doorstop shall be caulked as needed to complete the airtight seal.
- d. Adjust door as necessary to insure airtight seal with the W/S.
- e. The installation is to be airtight, neat in appearance, without buckling or gaps, and installed in such a manner that it is considered permanent.

3. Sweeps:

- a. Sweeps are to be a metal strip with a vinyl or neoprene insert installed according to the manufacturer's instructions.
- b. Install on the inside of doors that open inward or on the exterior of doors that open outward, so as not to interfere with the smooth operation of the door.
- c. Must be installed with mounting screws no further than two inches (2") from each end.
- d. Bottom edge of the sweep is to touch the threshold for proper seal.

4. Locksets:

- a. Locksets to be installed on exterior doors must be of a keyed type.
- b. Install according to manufacturer's specifications.
- c. Two (2) working keys are to be supplied to the client when the new lockset is installed.

5. Thresholds:

- a. Shall saddle try type with door bottom.
- b. Are to fit snuggly between the jambs and fasten with screws, and form an airtight seal between door and threshold.

6. Garage Door:

- a. Must be a 25 gauge galvanized Door.
- b. Must be insulated Door

J. Storm Doors

- 1. Shall mean aluminum clad, solid core construction with baked-on finish, self-storing design to contain two glass panels and one, full-size screen panel. Similar in quality to the Cole Sewell "Solid Saver" Model 530.
- 2. Shall have closures and hardware including stop springs.
- 3. Adjust for proper tension and operation.
- 4. Shall have corner bracing for additional support.

K. Windows

- 1. Frames, sill, sash, trim, and hardware shall match existing work in design and dimension unless otherwise specified in the work write-up.
- 2. New windows shall be vinyl-wrapped single-hung Low-E Argon gas filled, with a u-value of 0.32 or better as rated by NFRC, or approved equal.
- 3. Positive locking devices ("cam action" sash locks) shall be provided on all windows, which are accessible from the exterior, and all existing interior finish hardware shall be made operative or replaced.
- 4. Finish per painting specifications.
- 5. Glass and Glazing (for glass replacement).
 - a. Windows shall be glazed or re-glazed, where required, with single strength clear grade B glass.
 - b. Window glazing shall be oil base and contain no asbestos or lead.
- 6. Putty shall consist of pure linseed oil, pure whiting, natural color, or standard commercial grade putty.
- 7. Prime all wood sashes before the placing of putty.
- 8. Glass shall be bedded in putty and secured in place with glazier points and face puttied. All excess putty shall be removed and all glass left clean.

L. Storm Windows

- 1. Are to be standard aluminum frames, self-storing, with removable sash and screen section similar in quality to the Columbia Series 400.
- 2. Adjust for proper tension and operation.
- 3. Shall have corner bracing for additional support.

M. Stucco

- 1. Mortar for all applications shall consist of one (1) part Portland cement to not less than three (3) or more than five (5) parts of damp loose aggregate by volume. Hydrate lime may be used but shall not exceed 10 percent by weight or more than 25 percent by volume of the cement used.
- 2. The temperature of the surrounding air shall not be less than 40 degrees F. during application and for at least 48 hours thereafter.
- 3. Surfaces to receive stucco shall be covered with 3.40 pounds per square yard metal lath lapped at end and sides a minimum of 1", and nailed 10" on center vertically and 6" on center horizontally.
- 4. Apply a minimum of two (2) or three (3) coats. The final coat shall not be applied sooner than seven (7) days after the preceding coat. Before applying the final coat, the surface shall be dampened evenly to obtain uniform suction.
- 5. Apply two (2) coats on masonry to a minimum thickness of 5/8".
- 6. Apply three (3) coats over wood surfaces to a minimum thickness of 7/8".
- 7. Prior to stucco being painted, it shall be washed down with 5 percent muriatic acid solution and rinsed clean with clear water.

8. Patching of stucco, when called for in the Work Write-Up, shall include the removal of all loose material encountered until sound construction is reached, including the removal of rotted or deteriorated lath.

N. Plastering

- 1. Gypsum plaster materials shall be standard commercial brands.
- 2. Mixing and application of gypsum plasters shall be in accordance with American Standard Specifications for Gypsum Plastering.
- 3. Apply plaster in three (3) coats and in two (2) coats double up work-minimum thickness 1/2".
- 4. Gypsum lath shall be applied with long dimension across supports and with end joints staggered.
- 5. Nail gypsum lath with 12 or 13 gauge lathing nails having approximately 3/8" heads spaced not more than 4" on center with a minimum of four (4) nails in each lath. Use six (6) nails for 24" wide lath. Length of nail shall be that which shall provide at least 1" penetration in horizontal supports and 3/4" penetration in vertical supports.
- 6. Gypsum lath shall not be used as a base for Portland cement plaster.
- 7. Wood lath shall be securely nailed and wetted down prior to applying plaster.
- 8. Metal lath shall be applied according to manufacturer's directions whether used for patching or new work.
- 9. Patching of plaster, when called for in the Work Write-Up, shall include the removal of all loose material encountered until sound construction is reached, including the removal of rotted or deteriorated lath. Crack repair in plaster walls shall be cut out to a depth of not less than 1/4" and a width of 1/4". All areas are to be wetted thoroughly before applying plaster filler.

O. Wallboard (Screws are the preferred method)

- 1. Shall be tape joint gypsum board, carefully fitted and sized prior to nailing in place. Minimum thickness is to be 1/2".
- 2. Water resistant gypsum board is to be installed on bathroom walls, or any high moisture area.
- 3. All joints are to be staggered.
- 4. Nails or sheetrock screws shall be driven with their shanks perpendicular to the face of the board and seated below the surface of the board without breaking the paper, in accordance with the following:

Thickness	Ceiling	Side Walls	Type of Nail
1/2"	5" O.C.	7" O.C.	No. 4 glue coated
5/8"	6" O.C.	7" O.C.	1-7/8 6d cement coated

5. Perforated Tape Mix:

a. Shall comply with the recommendation of the manufacturer. A minimum temperature of 55 degrees F. shall be maintained in the room where the work is done until the cement is completely dry. Follow manufacturer's directions for application.

- b. Over joints, the tape shall be embedded in cement and covered with a thin layer of cement. A second and third coat shall be applied. Each coat shall be dry before applying the next coat. Each coat shall be feather-edged and extended beyond the previous coat, approximately 2". The finish coat shall be sanded lightly and imperfections filled in prior to any painting or decorating.
- c. Check to see that all nails have been driven so that their heads are below the surface without breaking the paper. Cover nails with three (3) applications of cement, allowing time to dry between each coat painted or other decoration.
- d. The final coat shall be sanded lightly before application of inside corners and shall be reinforced with tape imbedded in cement and finished the same as b. over joints.
- e. Outside wood molding, metal molding, or metal corner reinforcement shall protect corners. Metal corner re-enforcement shall be finished with two (2) coats of cement, as specified.
- f. Provide metal edge trim where wallboard edge abuts dissimilar material.
- 6. Finish to match existing texture.

P. Ceilings

- 1. Acoustical tile or 2' x 4' drop grid ceilings may be used.
- 2. Furring strips, when called for, shall be a minimum of 3/4" x 2" and attached with #8 nails driven through to ceiling joists at 10" intervals.
- 3. Suspended Ceilings
 - a. Exposed T-Bar, as specified, installed in strict accordance with manufacturer's recommendations.
 - b. Unexposed T-Bar, as specified, installed in strict accordance with manufacturer's recommendations.

5. Plaster/Drywall

a. Use a heavy textured spray finish, when required, to repair cracked plaster and/or cracks in ceiling board.

Q. Siding Repairs/Replacement

- 1. Repairs of siding shall match material of existing siding.
- 2. Installation of siding shall be 12" lap hard board and/or Smart Siding, unless otherwise noted on the Work Write-Up. Paint as called for in the painting specifications.
- 3. Remove siding only when called for in Work Write-Up.
- 4. Vinyl Siding:
 - a. Shall be 46 mills (.046") thick or better.
 - b. Colored completely through.
 - c. Siding shall be installed over a minimum 1/4" fan fold foam core, and all seams must be sealed per manufactures specifications.
 - d. Shall carry a lifetime warranty for defects in material and color fading.
 - e. Warranty shall be placed in the owner(s) name and the contractor shall send all documentation to the company with a copy to the client.
 - f. Installation shall include wrapping all windows, soffit, fascia, porch ceiling, and pillars, et al.
 - g. Any exterior painted surfaces (including window sash) not wrapped shall be painted according to the painting specifications.

- h. Owner(s) shall pick one siding color and one trim color from samples of siding and a complimentary trim color.
- i. Owner(s) shall sign sample of color choice. No bright or "hot" colors allowed.
- j. Install according to vinyl siding institute. www.vinylsiding.org

R. Caulking

- 1. Caulk shall be appropriate for materials being sealed. All caulk shall have a material life of at least 15 years.
- 2. Fully caulk around the following areas:
 - a. Window and door frames all sides.
 - b. Where different materials meet.
 - c. Inside and outside corner trim boards.
 - d. Between foundation and wall plates or siding.
 - e. Around vents, fans, and window air conditioners.

S. Interior Doors

- 1. Shall be 1-3/8" hollow core.
- 2. Must be stained or painted to owner's option.
- 3. Complete with hardware and latch set.
- T. Wallpapering Not Allowed
- U. Water Resistant Paneling
 - 1. Install FRP paneling, per manufacturing specifications for high moisture areas.
 - 2. Secure to sound backing using adhesive as recommended by manufacturer.
 - 3. Owner(s) to select color and pattern from manufacturer's standard items. Owner(s) to sign sample selection.

V. Wood Paneling

- 1. Shall be 3/32" minimum thickness.
- 2. APA A-D interior paneling.
- 3. Furnish and install wood trim as required for a complete installation. Stain trim to match paneling.
- 4. Paneling to be selected by owner(s) based on specified allowance.
- 5. Owner(s) to sign sample of selection.

W. Kitchen Cabinets

- 1. Job Built:
 - a. Shall be 3/4" fir or birch plywood with solid wood band on all exposed edges.
 - b. Stain a minimum of two (2) coats of lacquer (selected by owner(s)).
- 2. Factory Built:
 - a. Residential grade, standard construction for wood cabinets.
 - b. Standard stain finish (selected by owner(s)).
 - c. Laminated (heat and stain resistant) counter top and edge trim with back splash.

3. Upper Cabinets:

- a. Two (2) adjustable shelves.
- b. Doors complete with hardware.

4. Base Cabinets:

- a. Continuous drawers with standard glides across top section of all cabinets except sink area.
- b. One (1) adjustable shelf behind doors all areas below drawer sections.
- c. Laminated (heat and stain resistant) counter top and edge trim with back splash.
- d. Cabinets complete with hardware.
- X. Insulation All insulation material shall be cellulose, unless otherwise specified in the Work Write-Up. All attics must be insulated to an R-38, where possible.

1. Insulation Barrier:

- a. Install insulation barriers specifically manufactured for use with the type of insulation installed.
- b. Installation is to be in accordance with manufacturer's recommendations.
- c. All chimneys, flues, recessed lights, and heat producing sources are to have insulation barriers around them.

2. Gable Vents:

- a. Openings are to be cut with close tolerance to insure a watertight fit.
- b. Vent is to be nailed or screwed into the frame.
- c. All damaged siding is to be repaired or replaced. Siding without sheeting behind it is to have the vent framed in and mounted on the frame to insure a tight fit.
- d. Ventilation ratio shall be not less than 1/300

3. Roof Vents:

- a. Roof vents are to be prepared and cut to close tolerance to insure a watertight fit.
- b. The hole in the roof shall be no smaller than the throat site of the vent being installed so as not to restrict airflow.
- c. Discarded materials are not to be dropped into the attic area. The Contractor shall remove discarded materials from the work site.
- d. Vents (galvanized or aluminum NAS) are to be sealed and nailed with galvanized or aluminum nails.
- e. If the high/low method is used in installing roof vents, 50 percent of the vents must be located in the upper portion to be ventilated at least 3' above lower vents, with the remaining 50 percent of the required ventilation provided by ease, soffit, or roof vents.
- f. In the case of the high/low method of ventilation, a ratio shall not use less than 1\150.
- g. Vents are to appear evenly spaced from the ground and be neat in appearance.

4. Soffit Vents:

- a. Vents are to be installed to insure free ventilation space to the attic area.
- b. Vents are to be evenly spaced and a uniform distance from the sidewall.
- c. Vents are to be screwed to the soffit.

Attic Access:

a. R-19 batt insulation is to be stapled or nailed to the top of the door.

- b. Insulated manufactured doors may also be used. Insulation dams are to be constructed from 1" x 10" or better and are to be used to hold back attic insulation.
- c. All attic accesses are to be weather-stripped using foam, tubular, or metal flap weather strip, nailed, or placed on the jamb.
- d. When rebuilding an attic access, use 1" x 4" for the jamb and doorstop to form the flange. The door itself can be made of 3/4" plywood and insulated with R-19 batt insulation. 1" x 4", or smaller, is to be used as casing. The door and surrounding area is to be airtight. Damaged ceiling area is to be repaired with like materials, all wood installed is to be sealed against moisture.

6. Floor Insulation:

- a. R-13 batt insulation is to be installed between floor joists, unless otherwise specified.
- b. Insulation is to be secured with nails, staples, or wire.
- c. The vapor barrier shall be towards the conditioned side.

7. Duct Insulation:

- a. All loose joints on hot air ducts (also air conditioning ducts in attics) shall be sealed to prevent air leakage.
- b. The ducts are to be wrapped using a standard R-5 or better vinyl wrapped fiberglass batt or standard duct wrap.
- c. Cellulose can be blown against the ductwork to hold the insulation.
- d. Duct insulation installed in a basement or crawl space is to have a vapor barrier installed to the outside.

8. Wall Insulation:

- a. Walls shall be insulated to a minimum of R-13.
- b. Building codes shall be considered regarding knob and tube wiring situations.
- c. All exterior walls are to be insulated.
- d. Siding is to be removed and replaced.
- e. Damaged siding is to be replaced.
- f. All sidewall insulation shall be densely packed cellulose.

9. Perimeter Insulation:

- a. R-13 faced fiberglass is to be securely fastened to the underside of the floor, extending down the boxing area, unless otherwise specified.
- b. Covers the inside foundation wall and then out into the crawlspace at least 2'.
- c. Vapor barrier, shall be 6 mil plastic with 2' overlapped seams.

10. Insulation Material (Mineral):

- a. Fiber Material or Product:
 - (1) Blanket batt conformance to F.5. HH-1-521E and ASTM C665-70.
 - (2) Board conformance to F.5. HH-1-526C and ASTM C612-70 or C726-72.
 - (3) Duct Material Conformance to F.5. HH-1-558B.

11. Insulation Material (Organic Fiber):

- a. Cellulose conformance to HH-1-515D dated April 1988.
- b. Block and Board conformance to F.S. LLL-12-525A and ASTM C208-72 and fire safety requirements.

12. Water Heater Blanket:

- a. Specifically manufactured for the purpose.
- b. Minimum R-5.
- c. Capable of meeting a flame spread classification not to exceed 150 (per ASTM E-84).

PLUMBING AND HEATING SPECIFICATIONS

A. Water Piping

- 1. Above ground shall be type L copper tubing with copper solder joint fittings made up with 95-5 solder as recommended by manufacturer or PEX.
- 2. Connections to valves shall be made with N.P.T. to solder adapters.
- 3. Schedule 40 PVC cold plastic water pipe may also be used for water piping and Schedule 40 CPVC for hot plastic water piping.
- 4. All plastic water pipe shall be supported every 4'.
- 5. The site of new pipes shall be in conformance with the Uniform Plumbing Code. Valves shall be 150# brass with ends similar to fittings. Valves shall be provided at each piece of equipment to permit removal without shutting off service. Unions will be provided to permit removal of equipment without cutting pipe.
- 6. Supply lines to faucets shall be flex lines or copper tubing.
- 7. Shut-offs is required on all supply lines.

B. Plumbing Fixtures

- 1. Trim shall be chrome plated and supplies to each water closet shall be provided with stop valves to permit removal without shutting off service.
- 2. All plumbing fixtures and trim called for in the Work Write-Up shall be of standard grade equal to American Standard, Crane, or Kohler.
- 3. Shower shall have a rod and shower curtain installed, at minimum.
- 4. Bath Fans
 - a. Maximum sone rating of 1.5.
 - b. Fans to be installed according to manufactures specs.
 - c. Ductwork shall be insulated. Short straight runs if possible.
 - d. Use hard duct elbows, sealed and insulated, if turns are 90 degree or greater.
 - e. All connections on ductwork shall be mechanically fasten and sealed.
 - f. Fans must vent to exterior through roof or wall cap with termination to keep animals

C. Kitchen Equipment

- 1. Sink shall be double compartment stainless steel or enameled steel with self-sealing edge.
- 2. Refrigerator shall be a minimum 18 cu. ft., self-defrosting, 2-door unit appliance. Must be energy star rated.
- 3. White, Black or Almond (major brand mid priced model).
- 4. Ranges shall be electric or gas, with oven and oven light, and timer. White, Black, or Almond (major brand mid-priced range).
- 5. Gas ranges shall be attached to the gas supply with a steel flex gas line and shut off.

- D. Heating Systems and Air Conditioners (AC)
 - 1. Every heater that is existing or installed must be equipped with the following:
 - a. One hundred percent safety.
 - b. Code approved, metalbestos vent.
 - c. Proper gas piping and stops, installed in accordance with recommendations of the Uniform Plumbing Code.
 - d. Shut-off valves.
 - e. All transite vents are to be removed.
 - f. Blower.
 - g. New Thermostat.
 - 2. If no local codes, must meet National Gas Code (NGC).
 - 3. All new heating and AC units shall be sized and installed to provide sufficient heating and proper distribution for the size using manual J or equivalent sizing procedure requirements of the individual house. HVAC systems shall not be oversized by more than 15 percent.
 - 4. New furnaces shall be a minimum of 92 or better percent efficient, sealed combustion. Must have five year warranty of parts and lifetime heat exchanger warranties.
 - 5. No outside units or attic units shall be installed or units in crawl space unless specified in the Work Write-Up.
 - 6. No flexible ductwork is allowed unless approved by inspector at the bid conference.
 - 7. No open return air is allowed. All ductwork is to be included in bid.
 - 8. All ductwork shall be sealed using mastic (example RCD #6).
 - 9. All ductwork in unconditioned spaces shall be insulated.
 - 10. Furnace and/or air conditioner shall be on separate circuits.
 - 11. All appliances must be installed in accordance with manufacturer's specifications.
 - 12. Must have easy access to filter.
 - 13. If furnace is in basement, it must be raised a minimum of 2".
 - 14. Plenum must be installed to receive future A-coil, if not doing AC.
 - 15. AC must be 14 seer with matching A-coil, cased.

NOTE: Installer must be Master Mechanical Certified and for AC must have EPA Approved Certification.

E. Water Heaters

- 1. Water heaters, existing or installed, shall have the following:
 - a. Pressure and temperature relief valve.
 - b. Proper vent, gas piping, and shut off.
 - c. All transite vents to be replaced with code approved vent.
 - d. Must have Energy Factor (EF) of .62 or greater.
- 2. Pressure and temperature relief valves shall be extended within 2' of the floor, but no closer than 6".

NOTE: All cutting of walls, floors, ceilings, partitions, etc., for the purpose of rehabilitation work and the air sealing of openings around same, including the removal of all debris caused thereby, shall

be performed by the contractor performing the work. Repairs shall match existing materials, be finished to a smooth condition, and painted. (Refer to applicable Specifications for details.)

ALL EQUIPMENT REPLACED WITH NEW MATERIALS MUST BE REMOVED FROM THE PROPERTY AND DISPOSED OF PROPERLY.

SHOULD THERE BE ANY CONFLICTS BETWEEN THESE SPECIFICATIONS AND THE WORK WRITE-UP, THE PROJECT INSPECTOR SHOULD BE CONTACTED FOR A FINAL DETERMINATION.

ELECTRICAL SPECIFICATIONS

All electrical work shall be in conformance with the National Electrical Code (NEC)

If work write-up includes; change breaker box, service entrance, re-wire house or electrical components exceed \$1,000 -ALL electrical work <u>must</u> be performed by licensed electrician.

A. Wiring Devices

- 1. Single pole room lighting switches and three-way and four-way switches shall be UL approved.
- 2. Plug-ins shall be standard grounded receptacles except for plug-ins within 6' from water source and shall be GFI.
- 3. Plates for all switches and receptacles shall be non-conducting type (including screws) and UL approved.
- 4. Dryer shall have separate 220 circuit.
- 5. Furnace, air conditioner, refrigerator, dishwasher, and stove shall have separate circuit.
- 6. Garbage disposal shall have separate circuit(s) and wall switched receptacle.

B. Lighting Fixtures

- 1. Contractor shall provide all lighting fixtures complete with lamps, glassware, mounting hardware, frames and trim, stems, ballasts, sockets, etc., to provide a complete operating UL approved fixture at each location, as called for in the Work Write-Up. Energy efficient compact fluorescents bulb(s) are required in all replaced fixtures.
- 2. Porcelain lamp-holders are prohibited unless approved by the Project Inspector.

C. Panel Boards

- 1. Shall be UL approved, with the minimum components as listed:
 - a. NEMA 1 enclosure for indoor and NEMA 3R for exterior use.
 - b. 200A mains (minimum) unless noted otherwise.
 - c. 200A 2-pole main breaker (minimum) unless otherwise noted.
 - d. Seven (7) 1-pole branch breakers (minimum).
 - e. 2-pole breakers as required.
 - f. Separate/Neutral.
 - g. Separate ground bar.
 - h. Additional equipment as required meeting the National Electrical Code (NEC).
- * Unless specified differently by inspector.

D. Wire

1. Wire and cables shall be copper.

- 2. All wire and cable shall comply with the standardization rules of the AIEE as to conductivity and shall be free from kinks, splices, and defects when installed. Conductors shall be in accordance with the requirements of IPCEA Publication's latest edition.
- 3. All wire used in this project shall be new and shall be identified by type and by manufacturer.
- 4. Branch circuit wiring shall be non-metallic sheath Type NM.
- 5. Service conductors shall be Type XHHW.
- 6. All wiring shall be concealed in wall, ceiling, or floor cavities. Wiring required to be exposed shall, be installed in intermediate grade metal conduct.
- 7. All receptacles and other electrical equipment, except light fixtures, shall have a separate equipment ground conductor bonded to their metal cases, frames, etc. (except as noted).

E. Lightning Arresters

- 1. 175 v., 2-pole lightning arresters shall be installed per NEC.
- 2. Rewiring of house shall meet NEC.

F. Smoke Alarms

- 1. Install a 10-year sealed Lithium battery smoke alarms unless rewiring house.
- 2. If rewiring, install hardwired smoke alarms.

Note: All cutting of walls, floors, ceilings, partitions, etc., for the purpose of rehabilitation work and the air sealing of openings around same, including the removal of all debris caused thereby, shall be performed by the contractor performing the work. Repairs shall match existing materials, be finished to a smooth condition and painted. (Refer to applicable Specifications for details.)

ALL EQUIPMENT REPLACED WITH NEW MATERIALS MUST BE REMOVED FROM THE PROPERTY AND DISPOSED UP PROPERLY.

PAINTING AND VARNISHING SPECIFICATIONS

Preparation and painting of all surfaces containing Lead Base Paint shall be completed in accordance with HUD's "Safe Work Practices".

A. Preparation of Surface

1. Exterior:

- a. Wood surfaces to be painted or varnished shall be prepared in accordance with HUD's Safe Work Practices in the removal of loose, chipping and peeling paint, rough spots, and any obvious oil and/or grease that may be covering existing wood or paint.
- b. All paint chips and residue from the preparation must be REMOVED from the site.
- c. Where previous coats have chipped and peeled, the edge shall be wet scraped and puttied to obtain a smooth surface before new paint is applied.
- d. Exterior painting shall include painting all doors and windows, removing all storm windows, repairing windows, replacing all broken or cracked glass, and re-glazing and caulking all joints and seams with paintable caulk. Clean and reinstall all storm windows upon completion.

e. All nail holes shall be puttied and all defects in the surface shall be eliminated by the repair or complete replacement of the defective part, this includes siding, sills, casings, etc.

2. Interior:

- a. Wood surfaces to be painted or varnished shall be prepared in accordance with HUD's Safe Work Practices in the removal of loose, chipping and peeling paint, rough spots, and any obvious oil and/or grease that may be covering existing wood or a paint.
- b. Plaster or wallboard surfaces shall be sound, smooth, and free from holes, cracks, or irregularities.
- c. All old wallpaper shall be entirely removed or covered with sheetrock, taped, then painted.
- d. No paint or varnish shall be applied until all nail holes have been puttied and all defects in woodwork have been eliminated by the insertion of dutchmen or complete replacement of the damaged part.
- B. Materials Lead based paint is in violation of HUD Lead-Based Paint Regulations and shall not be used.

1. Exterior:

- a. All exterior paint must meet or exceed Sherwin Williams 15 year # A-100 and shall be delivered to site in manufacturer's sealed containers.
- b. Each container shall be labeled giving type of paint color and application specification.
- c. Before proceeding with exterior painting, samples of colors shall be shown to the owner(s) for selection. The owner(s) is limited to one (1) base color and one (1) trim color. Owner(s) shall sign the chosen color sample. Color options will be in a neutral color rage, no bright or "hot colors" are allowed.
- d. The primer coat shall be Alkyd oil tinted to match topcoat, produced by the same manufacturer as the finish coat.

2. Interior:

- a. Interior paint shall meet or exceed Sherwin William's Classic #99 for flat, semigloss, or satin gloss, and shall be delivered to the site in the manufacturer's sealed containers.
- b. Primer for new sheetrock shall meet or exceed Sherwin William's Pro-Mar #400 latex primer.
- c. Before proceeding with painting or varnishing, color samples shall be shown to the owner(s) for selection. The owner(s) is limited to one (1) base color and one (1) trim color. Owner(s) shall sign the chosen color sample.
- d. Texture finish sample shall be submitted to the owner(s) for approval before application. Owner(s) shall sign sample choice.
- e. The finish coat in kitchens and bathrooms shall be semi-gloss enamel and provide a durable and washable surface.
- f. The primer shall be tinted to match topcoat, produced by the same manufacturer as the finished coat.
- g. Varnish shall be polyurethane varnish.

2. Application:

a. Exterior:

- (1) All paint, unless specifically approved otherwise, shall be applied by brush or roller.
- (2) Apply each material at manufacturer's recommended spreading rate.
- (3) Do not apply exterior paint when temperature is 50° F. and falling, or when temperature is below 40° F. and steady, or in rainy, damp, or frosty weather until surface is thoroughly dry. Contact the Project Inspector if considering the Sherwin Williams product "Low Temp 35".
- (4) The Contractor shall be responsible for protecting all areas and surfaces that are <u>not</u> to receive paint and shall clean and repair or replace any such areas, surfaces, or items so damaged.
- (5) Finish work shall be uniform, of approved color, smooth, and free from runs, sags, and defective brushing and rolling. Edges of paint adjoining other materials or colors shall be sharp and clean.

b. Interior:

- (1) New paint applied on walls that are painted with a glossy paint or has a shine must be first prepared to remove glossy surface and cleaned prior to painting.
- (2) The Contractor shall be responsible for protecting all areas and surfaces that are <u>not</u> to receive paint and shall clean and repair or replace any such areas, surfaces, or items so damaged.
- (3) Finish work shall be uniform, of approved color, smooth, and free from runs, sags, and defective brushing and rolling. Edges of paint adjoining other materials or colors shall be sharp and clean.
- (4) Ceiling paint will be allowed when applying to ceilings.

c. Required Coatings:

- (1) Exterior wood, etc. (previously painted).
 - i. One (1) coat of exterior wood primer, tinted same as topcoat.
 - ii. Two (2) coats exterior latex house paint.
 - iii. Warranty is void if not followed.
- (2) Exterior wood and hardboard (bare):
 - i. One (1) coat exterior wood primer; tinted same as topcoat.
 - ii. Two (2) coats exterior latex house paint.
 - iii. Warranty is void if not followed.
- (3) Interior drywall:
 - i. Two (2) coats latex satin-gloss enamel wall paint.
 - ii. New drywall (1) coat of latex primer, (2) coats of satin-gloss enamel wall paint.
- (4) Wood porch floors and wood steps:
 - i. Two (2) coats porch floor enamel.
 - ii. Redwood and CCA does not need to be painted.
- (5) Spray textured drywall ceilings:
 - i. One (1) coat latex flat wall paint.
 - ii. One (1) coat spray texture.

SHOULD THERE BE ANY CONFLICTS BETWEEN THESE SPECIFICATIONS AND THE WORK WRITE-UP, THE PROJECT INSPECTOR SHOULD BE CONTACTED FOR A FINAL DETERMINATION.

ROOFING SPECIFICATIONS

Replacement of roof, when called for on the Work Write-Up, shall be defined as removing all existing shingles, flashings, valley tin, drip edge, and felt; then providing all new felt, valley tin, flashing, metal drip edge, and shingles, et al. Damaged sheathing or areas without solid sheathing shall have 15/32" construction grade plywood or 7/16" OSB Louisiana Pacific Interseal installed for sheathing.

A. Sheathing

- 1. Shall be 15/32" construction (CDX) grade plywood or 7/16" OSB Louisiana Pacific Interseal, APA Exposure #1 criteria or equal (THIS PRODUCT IS NOT "NORBOARD").
- 2. Nail sheathing with cement coated, rosin coated, or ring shank nails placed on 4" centers on all edges and over the face of each piece.

B. Underlayment

- 1. Shall be asphalt saturated felt, minimum 30#, which has low vapor resistance. Coated felts or laminated waterproof papers, which act as vapor barriers, should not be used.
- 2. Underlayment should be applied over the entire roof as soon as the roof sheathing has been completed.
- 3. Underlayment should be lapped 1' from both sides over all hips and ridges.
- 4. Only sufficient fasteners are to be used to hold the underlayment securely in place until shingles are applied.
- 5. Shingles are not to be applied over wet underlayment.

C. Shingles

- 1. Shall be new Heritage (equal to or better than 30-year), asphalt shingle squares, (nominal) weight, installed according to manufacturer's specifications, using nails only.
- 3. Cut shingles at valleys (2" each side of valley center to expose a minimum of 4"). Woven valleys are not allowed.
- 4. Owner(s) to select shingle color by signing a sample of the chosen shingle. Contractor is to keep signed shingle until final completion certificate is signed.

D. Metal Roofing

- 1. Shall be 29 gauge painted metal roofing equal to or better than Metal Sales Pro Panel II.
- 2. All metal roofing shall be attached with the proper length metal to wood screws with seal washers.
- 3. Owners shall sign sample of color choice. Color options will be a neutral color range, no bright or "hot colors" are allowed.

E. Flashing

Shall be 30 nominal gauge galvanized steel securely fastened and tarred to watertight and water-shedding condition.

F. Gutters/Downspouts/Splash Blocks

- 1. Standard, 5" Ogee, galvanized, white, steel, or 26 gauge aluminum gutters, securely fastened at 4' maximum intervals. Owner(s) to choose color to compliment house.
- 2. Downspouts may be round or square, corrugated and anchored at top and bottom.
- 3. All joints are to be watertight.
- 4. Install 3' splash blocks at all downspout locations. If not concrete, the splash blocks shall be anchored. 3' gutter extensions, can be used.
- 5. Install blocking and/or fascia board where necessary between gutter and eaves to properly align gutter to receive run-off from roof.
- 6. Owner(s) shall sign sample of color choice. No bright or "hot" colors allowed.

NOTE: SHOULD THERE BE ANY CONFLICTS BETWEEN THESE SPECIFICATIONS AND THE WORK WRITE-UP. THE PROJECT INSPECTOR SHOULD BE CONTACTED FOR A FINAL DETERMINATION.

DEMOLITION SPECIFICATIONS

A. Structures, Trees, and Site Clearance

- 1. The removal and proper disposal of the dilapidated structure(s). Check with the landfill operator prior to beginning demolition for instructions on "proper disposal".
- 2. Cap off all sewer and waterlines.
- 3. The complete removal of all concrete, cement or blocks, back-fill any basement to grade. Level site to be mowed. Seeding is the responsibility of the property owner.
- 4. Only remove trees that are within 6' of structure to be demolished.

B. Abandoned Septic Systems

- 1. Remove all liquid contents and the top of the tank. If the pit begins to fill with water, puncture the floor.
- 2. Fill the cavity with earth, sand, or gravel. Pack the fill to 5' below the surface, knock down sides 2' below grade, and then complete the fill with subsoil, packing as fill is being installed. The structure is now ready for the plug.
- 3. A minimum of a 6" of bentonite clay or 24" reinforced cement plug is to be applied. The plug must extend beyond the lining of the original diameter of the hole.

C. Abandoned Wells

- 1. Remove any pumping equipment.
- 2. Disinfect the water prior to filling by adding 1 gallon of chlorine bleach for every 10' of water.
- 3. Fill the well with sand and gravel mix to the water level.
- 4. Fill the remainder of the well above the water level with natural clay material (subsoil low in organic matter) compacted to form a solid column.
- 5. Six feet from top of casing, pour a 3' plug of cement or neat cement or sodium bentonite clay.
- 6. Excavate around the casing to the top of the plug, cut off casing, and backfill the excavation with compacted earth material.

Note: Contractor may be instructed to cut the casing at 4' below grade to allow the plug to extend beyond the edge of the casing. This mushroom plug will help provide extra protection from water movement along either side of the casing.

SAFE WORK PRACTICES

All work must be conducted in a lead safe work practice manner according to HUD Approved Lead Safe Work Practices Training by someone who has received HUD Approved Lead Safe Work Practices Training, is a Kansas Department of Health & Environment certified Lead Based Paint Worker, or is supervised by a Kansas Department of Health & Environment Lead Based Paint Supervisor.

Reference Lead Paint Safety, A Field Guide for Painting, Home Maintenance, and Renovation Work, U.S. Department of Housing & Urban Development Office of Healthy Homes and Lead Hazard Control.

- A. Prohibited Methods of Lead Based Paint Removal
 - 1. Open flame burning or torching.
 - 2. Machine sanding or grinding without a high-efficiency particulate air (HEPA) local exhaust control.
 - 3. Abrasive blasting or sandblasting without a HEPA local exhaust control.
 - 4. Heat guns operating above 1100° F. or charring the paint.
 - 5. Dry sanding or dry scraping, except dry scraping in conjunction with heat guns or within 1' of electrical outlets.
 - 6. Paint stripping in a poorly ventilated space using a volatile stripper that is a hazardous substance in accordance with regulations of the Consumer Product Safety Commission.
- B. Occupant Protection and Worksite Preparation
 - 1. Occupants and their belongings shall be protected.
 - 2. The worksite must be prepared according to safe work practice standards.
- C. Cleaning for Clearance

After rehabilitation/hazard reduction activities have been completed, the worksite shall be cleaned using cleaning methods, products, and devices that are successful in cleaning up dust-lead hazards, such as a HEPA vacuum or other method of equivalent efficacy, and lead specific detergents or equivalent.

- D. Safe Work Practices Are Not Required
 - 1. On a home built after 1978.
 - 2. On housing exclusively for the elderly (62 years of age or older) or people with disabilities unless a child under six is expected to reside there.
 - 3. On zero-bedroom dwellings.
 - 4. On property that has been found to be free of lead-based paint by a certified lead-based paint inspector/risk assessor.
 - 5. On property where all lead-based paint has been removed.
 - 6. On unoccupied housing that will remain vacant until it is demolished.
 - 7. On non-residential property.
 - 8 On any rehabilitation or housing improvement that does not disturb a painted surface.

Glossary of Housing Terms

Air-Dried Lumber: Lumber that has been piled in yards or sheds for any length of time. For the United States as a whole, the minimum moisture content of thoroughly air-dried lumber is 12 to 15 percent and the average is somewhat higher. In the South, air-dried lumber may be no lower than 19 percent.

Airway: A space between roof insulation and roof boards for movement of air.

Alligatoring: Coarse checking pattern characterized by a slipping of the new paint coating over the old coating to the extent that the old coating can be seen through the fissures.

Anchor Bolts: Bolts to secure a wooden sill plate to concrete or masonry floor or wall.

Apron: The flat member of the inside trim of a window placed against the wall immediately beneath the stool.

Areaway: An open subsurface space adjacent to a building used to admit light or air or as a means of access to a basement.

Asphalt: Most native asphalt is a residue from evaporated petroleum. It is insoluble in water but soluble in gasoline and melts when heated. Used widely in building for waterproofing roof coverings of many types, exterior wall coverings, flooring tile, and the like.

Astragal: A molding attached to one of a pair of swinging doors, against which the other door strikes.

Attic Ventilators: In houses, screened openings provided to ventilate an attic space. They are located in the soffit area as inlet ventilators and in the gable end or along the ridge as outlet ventilators. They can also consist of power-driven fans used as an exhaust system. (See also Louver.)

Backbands: A simple molding sometimes used around the outer edge of plain rectangular casing as a decorative feature.

Backfill: The replacement of excavated earth into a trench around and against a basement foundation.

Balusters: Usually small vertical members in a railing used between a top rail and the stair treads or a bottom rail.

Balustrade: A railing made up of balusters, top rail, and sometimes bottom rail, used on the edge of stairs, balconies, and porches.

Barge Board: A decorative board covering the projecting rafter (fly rafter) of the gable end. At the cornice, this member is a facia board.

Base or Baseboard: A board placed against the wall around a room next to the floor to finish properly between floor and plaster.

Base Molding: Molding used to trim the upper edge of interior baseboard.

Base Shoe: Molding used next to the floor on interior baseboard. Sometimes called a carpet strip.

Batten: Narrow strips of wood used to cover joints or as decorative vertical members over plywood or wide boards.

Batter Board: One of a pair of horizontal boards nailed to posts set at the corners of an excavation, used to indicate the desired level, also as a fastening for stretched strings to indicate outlines of foundation walls.

Bay Window: Any window space projecting outward from the walls of a building, either square or polygonal in plan.

Beam: A structural member transversely supporting a load.

Bearing Partition: A partition that supports any vertical load in addition to its own weight.

Bearing Wall: A wall that supports any vertical load in addition to its own weight.

Bed Molding: A molding in an angle, as between the overhanging cornice, or eaves, of a building and the sidewalls.

Blind Nailing: Nailing in such a way that the nailheads are not visible on the face of the work - usually at the tongue of matched boards.

Blind Stop: A rectangular molding, usually 3/4 by 1-3/8 inches or more in width, used in the assembly of a window frame. Serves as a stop for storm and screen or combination windows and to resist air infiltration.

Blue Stain: A bluish or grayish discoloration of the sapwood caused by the growth of certain moldlike fungi on the surface and in the interior of a piece, made possible by the same conditions that favor the growth of other fungi.

Bodied Linseed Oil: Linseed oil that has been thickened in viscosity by suitable processing with heat or chemicals. Bodied oils are obtainable in a great range in viscosity from a little greater than that of raw oil to just short of a jellied condition.

Boiled Linseed Oil: Linseed oil in which enough lead, manganese, or cobalt salts have been incorporated to make the oil harden more rapidly when spread in thin coatings.

Bolster: A short horizontal timber or steel beam on top of a column to support and decrease the span of beams or girders.

Boston Ridge: A method of applying asphalt or wood shingles at the ridge or at the hips of a roof as a finish.

Brace: An inclined piece of framing lumber applied to wall or floor to stiffen the structure. Often used on walls as temporary bracing until framing has been completed.

Brick Veneer: A facing of brick laid against and fastened to sheathing of a frame wall of tile wall construction.

Bridging: Small wood or metal members that are inserted in a diagonal position between the floor joists at midspan to act both as tension and compression members for the purpose of bracing the joists and spreading the action of loads.

Buck: Often used in reference to rough frame opening members. Door bucks used in reference to metal door frame.

Built Up Roof: Roofing composed of three to five layers of asphalt felt laminated with coal tar, pitch, or asphalt. The top is finished with crushed slag or gravel. Generally used on flat or low-pitched roofs.

Butt Joint: The junction where the ends of two timbers or other members meet in a square-cut joint.

Cant Strip: A triangular-shaped piece of lumber used at the junction of a flat deck and a wall to prevent cracking of the roofing that is applied over it.

Cap: The upper member of a column, pilaster, door cornice, molding, and the like.

Casement Frames and Sash: Frames of wood or metal enclosing part or all of the sash, which may be opened by means of hinges affixed to the vertical edge.

Casing: Molding of various widths and thicknesses used to trim door and window openings at the jambs.

Cement, Keene's: A white finish plaster that produces an extremely durable wall. Because of its density, it excels for use in bathrooms and kitchens and is also used extensively for the finish coat in auditoriums, public buildings, and other places where walls may be subjected to unusually hard wear or abuse.

Checking: Fissures that appear with age in many exterior paint coatings at first superficial, but which in time may penetrate entirely through the coating.

Checkrails: Meeting rails sufficiently thicker than a window to fill the opening between the top and bottom sash made by the parting stop in the frame of double-hung windows. They are usually beveled.

Collar Beams: Nominal 1- or 2-inch thick members connecting opposite roof rafters. They serve to stiffen the roof structure.

Column: In architecture: A perpendicular supporting member, circular or rectangular in section, usually consisting of a base, shaft, and capital. In engineering, a vertical structural compression member that supports loads acting in the direction of its longitudinal axis.

Combination Doors or Windows: Combination doors or windows used over regular openings. They provide winter insulation and summer protection and often have self-storing or removable glass and screen inserts. This eliminates the need for handling a different unit each season.

Concrete Plain: Concrete either without reinforcement, or reinforced only for shrinkage or temperature changes.

Condensation: In a building: Beads or drops of water (and frequently frost in extremely cold weather) that accumulate on the inside of the exterior covering of a building when warm, moisture-laden air from the interior reaches a point where the temperature no longer permits the air to sustain the moisture it holds. Use of louvers or attic ventilators will reduce moisture condensation in attics. A vapor barrier under the gypsum lath or dry wall on exposed walls will reduce condensation in them.

Conduit, Electrical: A pipe, usually metal, in which wire is installed.

Construction Dry-Wall: A type of construction in which the interior wall finish is applied in a dry condition, generally in the form of sheet materials or wood paneling, as contrasted to plaster.

Construction Frame: A type of construction in which the structural parts are wood or depend upon a wood frame for support. In codes, if masonry veneer is applied to the exterior walls, the classification of this type of construction is usually unchanged.

Coped Joint: See Scribing.

Corbel Out: To build out one or more courses of brick or stone from the face of a wall to form a support of timbers.

Corner Bead: A strip of formed sheet metal, sometimes combined with a strip of metal lath, placed on corners before plastering to reinforce them. Also, a strip of wood finish three-quarters-round or angular placed over a plastered corner for protection.

Corner Boards: Used as trim for the external corners of a house or other frame structure against which the ends of the siding are finished.

Corner Braces: Diagonal braces at the corners of frame structure to stiffen and strengthen the wall.

Cut-in Brace: Nominal 2-inch inch members, usually 2 by 4's, cut in between each stud diagonally.

Cornerite: Metal-mesh lath cut into strips and bent to a right angle. Used in interior corners of walls and ceilings on lath to prevent cracks in plastering.

Cornice: Overhang of a pitched roof at the eave line, usually consisting of a facia board, a soffit for a closed cornice, and appropriate moldings.

Cornice Return: That portion of the cornice that returns on the gable end of a house.

Counterflashing: A flashing usually used on chimneys at the roofline to cover shingle flashing and to prevent moisture entry.

Cove Molding: A molding with a concave face used as trim or to finish interior corners.

Crawl Space: A shallow space below the living quarters of a basementless house, normally enclosed by the foundation wall.

Cricket: A small drainage-diverting roof structure of single or double slope placed at the junction of larger surfaces that meet at an angle, such as above a chimney.

Cross-Bridging: Diagonal bracing between adjacent floor joists, placed near the center of the joist span to prevent joists from twisting.

Crown Molding: A molding used on cornice or wherever an interior angle is to be covered.

D: See Penny.

Dado: A rectangular groove across the width of a board or plank. In interior decoration; a special type of wall treatment.

Decay: Disintegration of wood or other substances through the action of fungi.

Deck paint: An enamel with a high degree of resistance to mechanical wear designed for use on such surfaces as porch floors.

Density: The mass of substance in a unit volume. When expressed in the metric system, it is numerically equal to the specific gravity of the same substance.

Dewpoint: Temperature at which a vapor begins to deposit as a liquid. Applies especially to water in the atmosphere.

Dimensions: See Lumber dimension.

Direct Nailing: To nail perpendicular to the initial surface or to the junction of the pieces joined. Also termed face nailing.

Doorjamb Interior: The surrounding case into which and out of which a door closes and opens. It consists of two upright pieces, called side jambs, and a horizontal head jamb.

Dormer: An opening in a sloping roof, the framing of which projects out to form a vertical wall suitable for windows or other openings.

Downspout: A pipe, usually of metal, for carrying rainwater from roof gutters.

Dressed and Matched (Tongued and Grooved): Boards or planks machined in such a manner that there is a groove on one edge and a corresponding tongue on the other.

Drier Paint: Usually, oil-soluble soaps of such metals as lead, manganese, or cobalt, which, in small proportions, hasten the oxidation and hardening (drying) of the drying oils in paints.

Drip: (a) A member of a cornice or other horizontal exterior finish course that has a projection beyond the other parts for throwing off water. (b) A groove in the underside of a sill or drip cap to cause water to drop off on the outer edge instead of drawing back and running down the face of the building.

Drip Cap: A molding placed on the exterior top side of a door or window frame to cause water to drip beyond the outside of the frame.

Dry-Wall: Interior covering material, such as gypsum board or plywood, which is applied in large sheets or panels.

Ducts: In a house, usually round or rectangular metal pipes for distributing warm air from the heating plant to rooms, or air from a conditioning device or as cold air returns. Ducts are also made of asbestos and composition materials.

Eaves: The margin or lower part of a roof projecting over the wall.

Expansion Joint: A bituminous fiber strip used to separate blocks or units of concrete to prevent cracking due to expansion as a result of temperature changes. Also used on concrete slabs.

Facia or Fascia: A flat board, band, or face, used sometimes by itself but usually in combination with moldings, often located at the outer face of the cornice.

Filler (Wood): A heavily pigmented preparation used for filling and leveling off the pores in open-pored woods.

Fire-Resistive: In the absence of a specific ruling by the authority having jurisdiction, applies to materials for construction not combustible in the temperatures of ordinary fires and that will withstand such fires without serious impairment of their usefulness for at least 1 hour.

Fire-Retardant Chemical: A chemical or preparation of chemicals used to reduce flammability or to retard spread of flame.

Fire Stop: A solid, tight closure of a concealed space, placed to prevent the spread of fire and smoke through such a space. In a frame wall, this will usually consist of 2 by 4 cross blocking between studs.

Fishplate: A wood or plywood pieces used to fasten the ends of two members together at a butt joint with nails or bolts. Sometimes used at the junction of opposite rafters near the ridge line.

Flagstone (Flagging or Flags): Flat stones from 1 to 4 inches thick, used for rustic walks, steps, floors, and the like.

Flashing: Sheet metal or other material used in roof and wall construction to protect a building from water seepage.

Flat Paint: An interior paint that contains a high proportion of pigment and dries to a flat or lusterless finish.

Flue: The space or passage in a chimney through which smoke, gas, or fumes ascend. Each passage is called a flue, which together with any others and the surrounding masonry make up the chimney.

Flue Lining: Fire clay or terra-cotta pipe, round or square, usually made in all ordinary flue sizes and in 2-foot lengths, used for the inner lining of chimneys with the brick or masonry work around the outside. Flue lining in chimneys runs from about a foot below the flue connection to the top of the chimney.

Fly Rafters: End rafters of the gable overhang supported by roof sheathing and lookouts.

Footing: A masonry section, usually concrete, in a rectangular form wider than the bottom of the foundation wall or pier it supports.

Foundation: The supporting portion of a structure below the first-floor construction, or below grade, including the footings.

Framing, Balloon: A system of framing a building in which all vertical structural elements of the bearing walls and partitions consist of single pieces extending from the top of the foundation sill plate to the roof plate and to which all floor joists are fastened.

Framing, Platform: A system of framing a building in which floor joists of each story rest on the top plates of the story below or on the foundation sill for the first story, and the bearing walls and partitions rest on the subfloor of each story.

Frieze: In house construction; a horizontal member connecting the top of the siding with the soffit of the cornice.

Frost Line: The depth of frost penetration in soil. This depth varies in different parts of the country. Footings should be placed below this depth to prevent movement.

Fungi Wood: Microscopic plants that live in damp wood and cause mold, stain, and decay.

Fungicide: A chemical that is poisonous to fungi.

Furring: Strips of wood or metal applied to a wall or other surface to even it and normally to serve as a fastening base for finish material.

Gable: In house construction; the portion of the roof above the eaveline of a double-sloped roof.

Gable End: An end wall having a gable.

Girder: A large or principal beam of wood or steel used to support concentrated loads at isolated points along its length.

Gloss Enamel: A finishing material made of varnish and sufficient pigments to provide opacity and color, but little or no pigment of low opacity. Such an enamel forms a hard coating with maximum smoothness of surface and a high degree of gloss.

Gloss (Paint or Enamel): A paint or enamel that contains a relatively low proportion of pigment and dries to a sheen or luster.

Grain: The direction, size, arrangement, appearance, or quality of the fibers in wood.

Grain, Edge (Vertical): Edge-grain lumber has been sawed parallel to the pith of the log and approximately at right angles to the growth rings, i.e., the rings form an angle of 45 degrees or more with the surface of the piece.

Grain, Flat: Flat-grain lumber has been sawed parallel to the pith of the log and approximately tangent to the growth rings, i.e., the rings form an angle of less than 45 degrees with the surface of the piece.

Grain, Quartersawn: Another term for edge grain.

Grounds: Guides used around openings and at the floorline to strike off plaster. They can consist of narrow strips of wood or of wide subjambs at interior doorways. They provide a level plaster line for installation of casing and other trim.

Grout: Mortar made of such consistency (by adding water) that it will just flow into the joints and cavities of the masonry work and fill them solid.

Gusset: A flat wood, plywood, or similar type member used to provide a connection at intersection of wood members. Most commonly used at joints of wood trusses. They are fastened by, nails, screws, bolts, or adhesives.

Gutter or Eave Trough: A shallow channel or conduit of metal or wood set below and along the eaves of a house to catch and carry off rainwater from the roof.

Gypsum Plaster: Gypsum formulated to be used with the addition of sand and water for base-coat plaster.

Header: (a) A beam placed perpendicular to joists and to which joists are nailed in framing for chimney, stairway, or other opening. (b) A wood lintel.

Hearth: The inner or outer floor of a fireplace, usually made of brick, tile, or stone.

Heartwood: The wood extending from the pith to the sapwood, the cells of which no longer participate in the life processes of the tree.

Hip: The external angle formed by the meeting of two sloping sides of a roof.

Hip Roof: A roof that rises by inclined planes from all four sides of a building.

Humidifier: A device designed to increase the humidity within a room or a house by means of the discharge of water vapor. They may consist of individual room-size units or larger units attached to the heating plant to condition the entire house.

I-Beam: A steel beam with a cross section resembling the letter "I". It is used for long spans as basement beams or over wide wall opening, such as a double garage door, when wall and roof loads are imposed on the opening.

IIC: A new system utilized in the Federal Housing Administration recommended criteria for impact sound insulation.

INR (Impact Noise Rating): A single figure rating which provides an estimate of the impact sound-insulation performance of a floor-ceiling assembly.

Insulation Board, Rigid: A structural building board made of coarse wood or cane fiber in 1/2 and 25/32-inch thicknesses. It can be obtained in various size sheets, in various densities, and with several treatments.

Insulation, Thermal: Any material high in resistance to heat transmission that, when placed in the walls, ceiling, or floors of a structure, will reduce the rate of heat flow.

Interior Finish: Material used to cover the interior framed areas, or material of walls and ceilings.

Jack Rafter: A rafter that spans the distance from the wallplate to a hip, or from a valley to a ridge.

Jamb: The side and head lining of a doorway, window, or other opening.

Joint: The space between the adjacent surfaces of two members or components joined and held together by nails, glue, cement, mortar, or other means.

Joint Cement: A powder that is usually mixed with water and used for joint treatment in gypsum-wallboard finish. Often called "spackle".

Joist: One of a series of parallel beams, usually 2 inches in thickness, used to support floor and ceiling loads, and supported in turn by larger beams, girders, or bearing walls.

Kiln Dried Lumber: Lumber that has been kiln dried often to a moisture content of 6 to 12 percent. Common varieties of softwood lumber, such as framing lumber are dried to a somewhat higher moisture content.

Knot: In lumber, the portion of a branch or limb of a tree that appears on the edge or face of the piece.

Landing: A platform between flights of stairs or at the termination of a flight of stairs.

Lath: A building material of wood, metal, gypsum, or insulation board that is fastened to the frame of a building to act as a plaster base.

Lattice: A framework of crossed wood or metal strips.

Leader: See Downspout.

Ledger Strip: A strip of lumber nailed along the bottom of the side of a girder on which joists rest.

Let-in Brace: Nominal 1-inch thick boards applied into notched studs diagonally.

Light: Space in a window sash for a single pane of glass: Also, a pane of glass.

Lintel: A horizontal structural member that supports the load over an opening such as a door or window.

Lookout: A short wood bracket or cantilever to support an overhang portion of a roof or the like, usually concealed from view.

Louver: An opening with a series of horizontal slats so arranged as to permit ventilation but to exclude rain, sunlight, or vision. See also Attic ventilators.

Lumber: Lumber is the product of the sawmill and planing mill not further manufactured other than by sawing, resawing, and passing lengthwise through a standard planing machine, crosscutting to length, and matching.

Lumber Boards: Yard lumber less than 2 inches thick and 2 or more inches wide.

Lumber, Dimension: Yard lumber from 2 inches to, but not including, 5 inches thick and 2 or more inches wide. Includes joists, rafters, studs, plank, and small timbers.

Lumber, Dressed Size: The dimension of lumber after shrinking from green dimension and after matching to size or pattern.

Lumber, Matched: Lumber that is dressed and shaped on one edge in a grooved pattern and on the other in a tongued pattern.

Lumber, Shiplap: Lumber that is edge dressed to make a close rabbeted or lapped joint.

Lumber, Timbers: Yard lumber 5 or more inches in least dimension. Includes beams, stringers, posts, caps, sills, girders, and purlins.

Lumber, Yard: Lumber of those grades, sizes, and patterns, which are generally intended for ordinary construction, such as framework and rough coverage of houses.

Mantel: The shelf above a fireplace. Also used in referring to the decorative trim around a fireplace opening.

Masonry: Stone, brick, concrete, hollow-tile, concrete-block, gypsum-block, or other similar building units or material or a combination of the same, bonded together with mortar to form a wall, pier, buttress, or similar mass.

Mastic: A pasty material used as a cement (as for setting tile) or a protective coating (as for thermal insulation or waterproofing).

Metal Lath: Sheets of metal that are slit and drawn out to form openings. Used as a plaster base for walls and ceilings and as reinforcing over other forms of plaster base.

Millwork: Generally all building materials made of finished wood and manufactured in millwork plants and planing mills are included under the term "millwork." It includes such items as inside and outside doors, window and doorframes, blinds, porchwork, mantels, panelwork, stairways, moldings, and interior trim. It normally does not include flooring, ceiling, or siding.

Miter Joint: The joint of two pieces at an angle that bisects the joining angle. For example, the miter joint at the side and head casing at a door opening is made at a 45° angle.

Moisture Content of Wood: Weight of the water contained in the wood, usually expressed as a percentage of the weight of the ovendry wood.

Moldings: A wood strip having a curved or projecting surface used for decorative purposes.

Mortise: A slot cut into a board, plank, or timber, usually edgewise, to receive tenon of another board, plank, or timber to form a joint.

Mullion: A vertical bar or divider in the frame between windows, doors, or other openings.

Muntin: A small member that divides the glass or openings of sash or doors.

Natural Finish: A transparent finish that does not seriously alter the original color or grain of the natural wood. Natural finishes are usually provided by sealers, oils, varnishes, water-repellent preservatives, and other similar materials.

Newel: A post to which the end of a stair railing or balustrade is fastened. Also, any post to which a railing balustrade is fastened.

Nonbearing Wall: A wall supporting no load other than its own weight.

Nosing: The projecting edge of a molding drip. Usually applied to the projecting molding on the edge of a stair tread.

Notch: A crosswise rabbet at the end of a board.

O.C. on Center: The measurement of spacing for studs, rafters, joists, and the like in a building from the center of one member to the center of the next.

O.G. or Ogee: A molding with a profile in the form of a letter "S", having the outline of a reversed curve.

Outrigger: An extension of a rafter beyond the wall line. Usually a smaller member nailed to a larger rafter to form a cornice or roof overhang.

Paint: A combination of pigments with suitable thinners or oils to provide decorative and protective coatings.

Panel: In house construction, a thin flat piece of wood, plywood, or similar material, framed by stiles and rails as in a door or fitted into grooves of thicker material with molded edges for decorative wall treatment.

Paper Building: A general term for papers, felts, and similar sheet materials used in buildings without reference to their properties or uses.

Paper Sheathing: A building material, generally paper or felt, used in wall and roof construction as a protection against the passage of air and sometimes moisture.

Parting Stop or Strip: A small wood piece used in the side and head jambs of double-hung windows to separate upper and lower sash.

Partition: A wall that subdivides spaces within any story of a building.

Penny: As applied to nails, it originally indicated the price per hundred. The term now serves as a measure of nail length and is abbreviated by the letter "d".

Perm: A measure of water vapor movement through a material (grains per square foot per inch of mercury difference in vapor pressure).

Pier: A column of masonry, usually rectangular in horizontal cross section, used to support other structural members.

Pigment: A powdered solid in suitable degree of subdivision for use in paint or enamel.

Pitch: The incline slope of a roof or the ratio of the total rise to the total width of a house, i.e., an 8-foot rise and 24-foot width is a one-third pitch roof. Roof slope is expressed in the inches of rise per foot of run.

Pitch Pocket: An opening extending parallel to the annual rings of growth that usually contains, or has contained, either solid or liquid pitch.

Pith: The small, soft core at the original center of a tree around which wood formation takes place.

Plaster Grounds: Strips of wood used as guides or strike-off edges around window and door openings and at base of walls.

Plate: Sill plate: A horizontal member anchored to a masonry wall. Sole plate: bottom horizontal member of a frame wall. Top plate: Top horizontal member of a frame wall supporting ceiling joists, rafters, or other members.

Plough: To cut a lengthwise groove in a board or plank.

Plumb: Exactly perpendicular; vertical.

Ply: A term to denote the number of thicknesses or layers of roofing felt, veneer in plywood, or layers in built-up materials, in any finished piece of such material.

Plywood: A piece of wood made of three or more layers of veneer joined with glue, and usually laid with the grain or adjoining plies at right angles. Almost always an odd number of plies are used to provide balanced construction.

Pores: Wood cells of comparatively large diameter that have open ends and are set one above the other to form continuous tubes. The openings of the vessels on the surface of a piece of wood are referred to as pores.

Preservative: Any substance that, for a reasonable length of time, will prevent the action of wood-destroying fungi, borers of various kinds, and similar destructive agents when the wood has been properly coated or impregnated with it.

Primer: The first coat of paint in a paint job that consists of two or more coats; also the paint used for such a first coat.

Putty: A type of cement usually made of whiting and boiled linseed oil, beaten or kneaded to the consistency of dough, and used in sealing glass in sash, filling small holes and crevices in wood, and for similar purposes.

Quarter Round: A small molding that has the cross section of a quarter circle.

Rabbet: A rectangular longitudinal groove cut in the corner edge of a board or plank.

Radiant Heating: A method of heating, usually consisting of a forced hot water system with pipes placed in the floor, wall, or ceiling; or with electrically heated panels.

Rafter: One of a series of structural members of a roof designed to support roof loads. The rafters of a flat roof are sometimes called roof joists.

Rafter, Hip: A rafter that forms the intersection of an external roof angle.

Rafter Valley: A rafter that forms the intersection of an internal roof angle. The valley rafter is normally made of double 2-inch thick members.

Rail: Cross members of panel doors or of a sash. Also, the upper and lower members of a balustrade or staircase extending from one vertical support, such as a post, to another.

Rake: Trim members that run parallel to the roof slope and form the finish between the wall and a gable roof extension.

Raw Linseed Oil: The crude product processed from flaxseed and usually without much subsequent treatment.

Reflective Insulation: Sheet material with one or both surfaces of comparatively low heat emissivity, such as aluminum foil. When used in building construction the surfaces face air spaces, reducing the radiation across the air space.

Reinforcing: Steel rods or metal fabric placed in concrete slabs, beams, or columns to increase their strength.

Relative Humidity: The amount of water vapor in the atmosphere, expressed as a percentage of the maximum quantity that could be present at a given temperature. (The actual amount of water vapor that can be held in space increases with the temperature.)

Resorcinol Glue: A glue that is high in both wet and dry strength and resistant to high temperatures. It is used for gluing lumber or assembly joints that must withstand severe service conditions.

Ribbon (Girt): Normally a 1- by 4-inch board let into the studs horizontally to support ceiling or second-floor joists.

Ridge: The horizontal line at the junction of the top edges of two sloping roof surfaces.

Ridge Board: The board placed on edge at the ridge of the roof into which the upper ends of the rafters are fastened.

Rise: In stairs, the vertical height of a step or flight of stairs.

Riser: Each of the vertical boards closing the spaces between the treads of stairways.

Roll Roofing: Roofing material, composed of fiber and saturated with asphalt that is supplied in 36-inch wide rolls with 108 square feet of material. Weights are generally 45 to 90 pounds per roll.

Roof Sheathing: The boards or sheet material fastened to the roof rafters on which the shingle or other roof covering is laid.

Rubber-Emulsion Paint: Paint, the vehicle of which consists of rubber or synthetic rubber dispersed in fine droplets in water.

Run: In stairs, the net width of a step or the horizontal distance covered by a flight of stairs.

Saddle: Two sloping surfaces meeting in a horizontal ridge, used between the back side of a chimney, or other vertical surface, and a sloping roof.

Sand Float Finish: Lime mixed with sand, resulting in a textured finish.

Sapwood: The outer zone of wood, next to the bark. In the living tree it contains some living cells (the heartwood contains none), as well as dead and dying cells. In most species, it is lighter colored than the heartwood. In all species, it is lacking in decay resistance.

Sash: A single light frame containing one or more lights of glass.

Sash Balance: A device, usually operated by a spring or tensioned weather-stripping designed to counterbalance double-hung window sash.

Saturated Felt: A felt that is impregnated with tar or asphalt.

Scratch Coat: The first coat of plaster, which is scratched to form a bond for the second coat.

Screed: A small strip of wood, usually the thickness of the plaster coat, used as a guide for plastering.

Scribing: Fitting woodwork to an irregular surface. In moldings, cutting the end of one piece to fit the molded face of the other at an interior angle to replace a miter joint.

Sealer: A finishing material, either clear or pigmented, that is usually applied directly over uncoated wood for the purpose of sealing the surface.

Seasoning: Removing moisture from green wood in order to improve its serviceability.

Semigloss Paint or Enamel: A paint or enamel made with a slight insufficiency of nonvolatile vehicle so that its coating, when dry, has some luster but is not very glossy.

Shake: A thick handsplit shingle, resawed to form two shakes; usually edge-grained.

Sheathing: The structural covering, usually wood boards or plywood, used over studs or rafters of a structure. Structural building board is normally used only as wall sheathing.

Sheathing Paper: See Paper, sheathing.

Sheet Metal Work: All components of a house employing sheet metal, such as lashing, gutters and downspouts.

Shellac: A transparent coating made by dissolving lac, a resinous secretion of the lac bug (a scale insect that thrives in tropical countries, especially India), in alcohol.

Shingles: Roof covering of asphalt, asbestos, wood, tile, slate, or other material cut to stock lengths, widths, and thicknesses.

Shingles Siding: Various kinds of shingles, such as wood shingles or shakes and nonwood shingles that are used over sheathing for exterior sidewall covering of a structure.

Shiplap: See Lumber, shiplap.

Shutter: Usually lightweight louvered or flush wood or nonwood frames in the form of doors located at each side of a window. Some are made to close over the window for protection and others are fastened to the wall as a decorative device.

Siding: The finish covering of the outside wall of a frame building, whether made of horizontal weatherboards, vertical boards with battens, shingles, or other material.

Siding, Bevel (Lap Siding): Wedge-shaped boards used as horizontal siding in a lapped pattern. This siding varies in butt thickness from 1/2 to 3/4 inch and in widths up to 12 inches. Normally used over some type of sheathing.

Siding, Dolly Varden: Beveled wood siding that is rabbeted on the bottom edge.

Siding, Drop: Usually 3/4 inch thick and 6 and 8 inches wide with tongued-and-grooved or shiplap edges. Often used as siding without sheathing in secondary buildings.

Sill: The lowest member of the frame of a structure, resting on the foundation and supporting the floor joists or the uprights of the wall. The member forming the lower side of an opening, as a door sill, window sill, etc.

Sleeper: Usually, a wood member embedded in concrete, as in a floor, that serves to support and to fasten subfloor or flooring.

Soffit: Usually the underside of an overhanging cornice.

Soil Cover (Ground Cover): A light covering of plastic film, roll roofing, or similar material used over the soil in crawl spaces of buildings to minimize moisture permeation of the area.

Soil Stack: A general term for the vertical main of a system of soil, waste, or vent piping.

Sole or Sole Plate: See Plate.

Solid Ridging: A solid member placed between adjacent floor joists near the center of the span to prevent joists from twisting.

Span: The distance between structural supports such as walls, columns, piers, beams, girders, and trusses.

Splash Block: A small masonry block laid with the top close to the ground surface to receive roof drainage from downspouts and to carry it away from the building.

Square: A unit of measure--100 square feet--usually applied to roofing material. Sidewall coverings are sometimes packed to cover 100 square feet and are sold on that basis.

Stain Shingle: A form of oil paint, very thin in consistency, intended for coloring wood with rough surfaces, such as shingles, without forming a coating of significant thickness or gloss.

Stair Carriage: Supporting member for stair treads. Usually 2-inch plank notched to receive the treads, sometimes called a "rough horse."

Stair Landing: See Landing.

Stair Rise: See Rise.

STC (Sound Transmission Class): A measure of sound stopping of ordinary noise.

Stile: An upright framing member in a panel door.

Stool: A flat molding fitted over the window sill between jambs and contacting the bottom rail of the lower sash.

Storm Sash or Storm Window: An extra window usually placed on the outside of an existing one as additional protection against cold weather.

Story: That part of a building between any floor and the floor or roof next above.

Strip Flooring: Wood flooring consisting of narrow, matched strips.

String, Stringer: A timber or other support for cross members in door or ceilings. In stairs; the support on which the stair treads rest also, stringboard.

Stucco: Most commonly refers to an outside plaster made with Portland cement as its base.

Stud: One of a series of slender wood or metal vertical structural members placed as supporting elements in walls and partitions. (Plural: studs or studding.)

Subfloor: Boards of plywood laid on joists over which a finish floor is to be laid.

Suspended Ceiling: A ceiling system supported by hanging it from the overhead structural framing.

Tail Beam: A relatively short beam or joist supported in a wall on one end and by a header at the other.

Termites: Insects that superficially resemble ants in size, general appearance, and habit of living in colonies; hence, they are frequently call "white ants." Subterranean termites establish themselves in buildings not by being carried in with lumber, but by entering from ground nests after the building has been constructed. If unmolested, they eat out the woodwork, leaving a shell of sound wood to conceal their activities, and damage may proceed so far as to cause collapse of parts of a structure before discovery. There are about 56 species of termites known in the United States; but the two major ones, classified by the manner in which they attack wood, are ground-inhabiting or subterranean termites (the most common) and dry-wood termites, which are found almost exclusively along the extreme southern border and the Gulf of Mexico in the United States.

Termite Shield: A shield, usually of noncorrodible metal, placed in or on a foundation wall or other mass of masonry or around pipes to prevent passage of termites.

Terneplate: Sheet iron or steel coated with an alloy of lead and tin.

Threshold: A strip of wood or metal with beveled edges used over the finished floor and the sill of exterior doors.

Toenailing: To drive a nail at a slant with the initial surface in order to permit it to penetrate into a second member.

Tongued and Grooved: See Dressed and matched.

Tread: The horizontal board in a stairway on which the foot is placed.

Trim: The finish materials in a building, such as moldings, applied around openings (window trim, door trim) or at the floor and ceiling of rooms (baseboard, cornice, and other moldings).

Trimmer: A beam or joist to which a header is nailed in framing for a chimney, stairway, or other opening.

Truss: A frame or jointed structure designed to act as a beam of long span, while each member is usually subjected to longitudinal stress only, either tension or compression.

Turpentine: A volatile oil used as a thinner in paints and as a solvent in varnishes. Chemically, it is a mixture of terpenes.

Undercoat: A coating applied prior to the finishing or top coats of a paint job. It may be the first of two or the second of three coats. In some usage of the word it may become synonymous with priming coat.

Under Layment: A material placed under finished coverings, such as flooring, or shingles, to provide a smooth, even surface for applying the finish.

Valley: The internal angle formed by the junction of two sloping sides of a roof.

Vapor Barrier: Material used to retard the movement of water vapor into walls and prevent condensation in them. Usually considered as having a perm value of less than 1.0. Applied separately over the warm side of exposed walls or as a part of batt or blanket insulation.

Varnish: A thickened preparation of drying oil or drying oil and resin suitable for spreading on surfaces to form continuous, transparent coatings, or for mixing with pigments to make enamels.

Vehicle: The liquid portion of a finishing material; it consists of the binder (nonvolatile) and volatile thinners.

Veneer: Thin sheets of wood made by rotary cutting or slicing of a log.

Vent: A pipe or duct that allows flow of air as an inlet or outlet.

Vermiculite: A mineral closely related to mica, with the faculty of expanding on heating to form lightweight material with insulation quality. Used as bulk insulation and also as aggregate in insulating and acoustical plaster and in insulation concrete floors.

Volatile Thinner: A liquid that evaporates readily and is used to thin or reduce the consistency of finishes without altering the relative volumes of pigments and nonvolatile vehicles.

Wane: Bark, or lack of wood from any cause, on edge or corner of a piece of wood.

Water-Repellent Preservative: A liquid designed to penetrate into wood and impart water repellency and a moderate preservative protection. It is used for millwork, such as sash and frames, and is usually applied by dripping.

Weather-Strip: Narrow or jamb-width sections of thin material or other metal to prevent infiltration of air and moisture around windows and doors. Compression weather stripping prevents air infiltration, provides tension, and acts as a counter balance.

Wood Rays: Strips of cells extending radially within a tree and varying in height from a few cells in some species to 4 inches or more in oak. The rays serve primarily to store food and to transport it horizontally in the tree.

SAMPLE BID TABULATION

Name:	
Address:	
Phone:	

1.	Kitchen: Install (2) GFCI in outlets.
2.	Kitchen: Prepare and paint interior of window and trim on (2) doors.
3.	Bathroom: Install GFCI outlet.
4.	Bathroom: Prepare and paint interior of window.
5.	Bathroom: Install new toilet.
6.	SW Bedroom: Install smoke detector in hall.
7.	NW Bedroom: Repair and finish holes in floor.
8.	NW Bedroom: Install new door and finish.
9.	SE Storage Room: Repair and finish ceiling.
10.	SE Storage Room: Install entry door and storm door.
11.	SE Storage Room: Install (4) storm windows.
12.	SE Storage Room: Repair and finish walls.
13.	Heating Equipment: Install forces air furnace and ductwork.
14.	Hot Water Heater: Install drop leg on T & P Valve.
15.	Basement Utility Room: Install cover on open junction box.
16.	Building Exterior: Install vinyl siding to specifications.
17.	Building Exterior: Install gutters on entire house.
18.	Attic: Insulate all attics to R-38, including east storage.
19.	Electric: Rewire house to specifications.
	SUB – TOTAL:
	Cost of LSWP and Clearance
	TOTAL:

CDBG Housing Quality Standards

I. Introduction

These physical guidelines for the rehabilitation of existing residential properties have been developed to provide minimum design and construction criteria on a statewide basis. The provisions are extended to serve as an important aid in carrying out the objectives of state and local programs for neglected and run-down properties. These objectives seek the large-scale physical, social and economic regeneration of neighborhoods, which have, in general, seriously deteriorated. These Housing Quality Standards are divided into three parts: a) minor rehabilitation (health and safety standards/weatherization), b) Moderate/Substantial Rehabilitation (livability standards), and c) abatement. The first outlines minimal basic standards to address health and safety issues, which includes weatherization for the residents of the unit. The goal of the moderate/substantial rehabilitation standards is to add 20 years to useful life to the housing unit, addressing issues beyond those considered a health or safety threat. All housing units receiving CDBG assistance must comply with the minimum standards.

The purpose and intent of the guidelines are threefold:

- To assure improved housing that is livable, healthful, safe and physically sound, and at the same time is low enough in cost for present neighborhood residents to afford.
- To provide an acceptable minimum level for residential rehabilitation based on performance, which has maximum flexibility to meet local conditions.
- To encourage innovation and improved technology, which give the promise of reduced construction costs.

A. Contrast with New Construction Standards

These guidelines for rehabilitation are significantly different from standards for new construction. These deteriorating buildings were built many years ago by standards quite different from those practiced today. Former patterns of living and the use of space are now likely to be considered inefficient or inconvenient. Properties, in many cases, will have become substandard because of overcrowding, lack of sanitary conditions and general neglect.

B. Other Codes and Regulations

These guidelines, while setting forth basic objectives and provisions specifically related to rehabilitation, shall not be construed as relieving the property owner, project sponsor or their builder of his/her responsibility for compliance with local ordinances, codes and regulations, including established requirements of health officers or other authority having jurisdiction.

1. Local Codes - Where a local code, regulation or requirement is incomplete or does not fulfill the purpose and intent of these guidelines, this document or local standards derived from these guidelines shall apply.

2. Fire Administration Authorization Act of 1992 - This Act requires all dwelling units to be equipped with either hard-wired or battery-operated smoke detectors. Refer to this Act for additional guidelines for all housing other than single family dwellings.

II. CDBG Standards

A. Minor Rehabilitation

These Standards were developed to provide guidelines for the general well-being of the individuals residing in the home.

- 1. Utilities: Utilities shall be provided for each property or project, including water sewer, and electrical utilities. Approvable utilities include:
 - a. State approved city/Rural Water District (RWD) or county supplied water, sewer, electrical and gas utilities.
 - b. Privately owned water, sewer, electrical and gas utilities that have been approved by the state and local public institutions for use for residential dwellings.
 - c. For structures connected to an on-site water well, water must be tested and meet water quality standards for drinking water as required by the Kansas Department of Health & Environment (KDHE) for public water supplies; or water supply must be connected to an on-site package disinfecting facility and water must not contain toxic substances determined, in the concentrations present, to be harmful to human health by the KDHE or the Environmental Protection Agency.
 - d. For structures connected to existing on-site septic systems, the design of the system shall ensure that effluent from the septic system and disposal field is not discharging into public and private drinking water supplies, stagnating in pools on the surface or backing up into the residences. For septic systems installed, grantees are required to obtain a permit from the applicable state agency involved. Construction specifications shall follow guidelines established by the applicable state agency.
 - e. For structures connected to on-site propane tanks, propane lines connecting the tank to the building shall conform to Building Officials and Code Administrators (BOCA) codes.
 - f. Structures connected to gas, propane, water, electrical or sewer shall be connected with piping or conduit that is not corroded, does not leak, or is otherwise not allowed by these standards. Bare steel gas lines must be inspected for safety by a local gas company and repaired, if necessary. The inspection report must be in each file.

- 2. Structural: All floors, stairs, ceilings or other load bearing structural members shall be free of hazards that would indicate a potential for the building or individual members of the building to collapse.
- 3. Roofs: Roofs shall be repaired or replaced if they have serious defects indicating the potential for structural collapse or if they allow the infiltration of significant amounts of water or air. If repaired, all critical joints in exterior roof construction shall be protected by appropriately installed sheet metal, flashing material or rubberized roofing membrane.
- 4. Weatherization: All water piping in non-insulated spaces shall be insulated so as to keep them from freezing. All foundation and mobile home crawl spaces shall be enclosed to prevent pipes from freezing in the winter. Pipes shall not be insulated with asbestos material. All asbestos insulating material shall be replaced with non-asbestos material or encapsulated with high-temperature paint or other Environmental Protection Agency (EPA) approved material.
- 5. Lead-Based Paint: The issue of lead-based paint must be addressed in **every** house built prior to 1978 receiving rehabilitation assistance in all HUD programs. See Attachment 20 herein for the regulations. These lead-based paint regulations are a part of the health and safety CDBG housing standards and are applicable as to the amount of dollars spent on the housing rehabilitations activity.
- 6. Heating Appliances: All mechanical equipment shall be inspected for faulty operation, fire and other hazards. Repairs and replacement shall be made as needed and necessary to eliminate the hazard. Heating facilities shall be provided for each living unit. All new installations of heating appliances shall comply with the manufacturer's recommendations for installation and placement. All gas, propane, liquid and solid fuel burning appliances must be vented to the outer air.

Existing masonry chimneys or metal flues shall not have cracks or holes that permit smoke or fumes to be discharged. Deteriorated pipes or chimneys that have been determined by the inspector or the grantee to constitute a potential threat to the safety of the occupant shall be replaced. Existing unlined masonry chimneys which permit flames or fumes to be discharged should be removed and replaced with corrosion-resistant pipe, or, if not replaced, shall be lined with corrosion-resistant pipe one inch less in diameter than the interior of the chimney, or shall be lined with terra cotta. Vent pipes shall slope upward not less than 1/4" per foot.

Any asbestos-containing materials wrapped around vent pipes shall be removed or encapsulated with high temperature paint. Asbestos removal procedures shall conform to EPA regulations.

All heating applications shall be located in unconfined spaces that will provide adequate combustion air as recommended by the manufacturer of the appliances.

- Located in a confined space, adequate ventilation between the confined area and unconfined space shall be provided to allow adequate combustion air to enter the confined space.
- 7. Solid Fuel Burning Appliances: All existing chimneys and vents for solid fuel burning appliances shall be cleaned as part of the rehabilitation process. All chimneys and vents for solid fuel burning appliances shall terminate at least two feet above any part of the roof located horizontally with ten feet of the chimney or vent.
 - a. Metal Flues: (1) Solid fuel burning appliances (wood, coal, etc.) shall be vented so that single walled pipe shall have at least 16" clearance from combustible material; (2) double walled pipe shall have at least 8" clearance from combustible material; and (3) triple walled pipe shall have at least 2" clearance from combustible material. Double walled insulated stainless steel pipe shall have at least 3" clearance from combustible material. All pipe-venting solid fuel-burning appliances shall have been approved by Underwriters Laboratories to withstand heat of 1,500 degrees or more for three hours. All galvanized pipe shall be of #10 thickness or of superior fire resistance.
 - b. Masonry Chimneys: Existing masonry chimneys being used to vent solid fuel burning appliances shall be constructed of at least 8" of solid masonry around the vent below the roof line and 4" of solid masonry around the vent above the roof line. Combustible material above the roofline shall have at least a 2" clearance from a flue built of less than 8" of solid masonry. All such chimneys shall be lined with terra cotta or firebrick.
 - c. Placement: Solid fuel burning heaters shall not be placed within 36" of any unprotected walls or within 18" of an unprotected floor. Protection of walls and floors may be provided with or without ventilated spaces between the protection and the wall. Ventilated spaces shall consist of one-inch space between a listed noncombustible material and the wall. Spacers and ties between the material and the wall shall be noncombustible and shall be resistant to heat conduction. Spacers shall not be placed between the appliance and the wall. With wall protection and ventilated space, clearance between the appliance and the wall may not be less than 12". With wall protection and no ventilated space, clearance between the appliance and wall may not be less than 24" unless more than 4" of solid masonry is used as the protection.
- 8. Plumbing: Plumbing systems shall operate free of clogging and shall not have cross connections that permit contamination of water supplies or back siphoning between fixtures.
 - a. Water and sewer lines shall be free of major leaks that cause serious and persistent levels of rust or contamination of the water, or which damage

- other elements of the building. All water lines in unheated areas shall be insulated so as to keep them from freezing.
- b. All natural and liquid propane gas piping shall be free of leaks. Pipes feeding each individual gas fueled appliance shall have a shut-off valve. Gas lines shall be free of corrosion that potentially could cause a gas leak soft copper piping and other non-rigid piping shall not be used in replacing and installing natural gas lines. Soft copper piping used in installing or replacing propane gas lines shall not be located in areas where it is accessible to tampering by children or located in passageways where it can be potentially kicked, stepped on or bent, so as to cause leakage of gas around flange connections.
- 9. Electrical: Existing wiring and electrical equipment, where its continued service is contemplated, shall not be a potential source of electrical hazard or ignition of combustible materials. Wherever potential hazards are determined to be present, replacement of existing wiring or equipment shall be made. Existing facilities that are inadequate to meet anticipated demand shall be replaced to meet that demand. Inadequate facilities include the use of power strips if more than two appliances are used regularly by that outlet. Hazards such as broken wiring, non-insulated wiring, frayed wiring, a light fixture hanging from an electrical wire without other visible means of support, missing cover plates on switches, outlets and junction boxes exposed to the occupants of the dwelling or which are covered with combustible material, knob and tube, aluminum or obsolete wiring systems, badly corroded outlets, exposed fuse box connections, and overloaded circuits evidenced by frequently blown fuses, shall be eliminated.
 - a. New electrical work shall be installed using the appropriate provisions of the National Electrical Code as it has existed within the last ten years. Not less than two general lighting circuits (15 amp.) and one appliance circuit (20 amp.) shall be provided.
- 10. Bathroom: Commode: Bathrooms must have a working commode for the exclusive use of the occupant. The commode must be connected to a water supply and sewer. The commode must not leak, have clogged water lines or have a sewer line that is clogged or backs up.
 - a. Lavatory: Bathrooms must have a fixed wash basin or lavatory that is permanently and securely fastened to the wall. The lavatory must be equipped with hot and cold running water and have a working drain with a gas trap.
 - b. Bathtubs and Showers: Bathrooms must be equipped with a working tub or shower with hot and cold running water and have a working drain with a gas trap.
- 11. Termite Treatment: Chemicals applied as a termite treatment shall only be applied to a house by a person that is a licensed commercial applicator. Persons who are licensed shall not assign persons who are not licensed responsibility for

- treating a house. Grantees shall keep documentation showing that the person chosen to undertake termite treatment is a licensed applicator. EPA has banned use of chlordane; therefore it is also not allowed on CDBG-funded rehabilitation projects.
- 12. Materials: All materials shall be installed in locations and for purposes that are recommended by the manufacturer of the materials.
- 13. Smoke Detectors: All units shall be equipped with at least one hard-wired operating smoke detector (if the unit is being rewired) or a battery-operated smoke detector located near the sleeping quarters, and on each level of the house, including basement.
- 14. Weatherization: All houses shall be equipped with the following weatherizing improvements:
 - a. Windows: All windows shall be equipped with two layers of glass (storm windows count as one layer) and glass panes shall be intact.

 Windows shall not allow the significant entry of air or water into the structure from around the windows, sashes, or window casings. Window casings that are replaced shall be filled with insulation.
 - b. Doors: All exterior doors shall be weather-stripped. Weather-stripped doors that allow the significant entry of air or water into the structure shall be replaced or repaired to eliminate this problem.
 - c. Ceiling Insulation: Ceiling insulation shall be provided over all habitable areas. Combustible materials, such as beadboard or styrofoam, shall not be used for attic insulation. All ceilings shall be insulated to at least R-30 or as can be determined for a particular structure using HUD's Cost Effective Energy Conservation Standards for Rehabilitation Projects.
 - d. Side Wall Insulation: All side walls shall be insulated to R-11 or better or as can be determined for a particular structure using HUD's Cost Effective Energy Conservation Standards for Rehabilitation Projects. Walls in spaces heated with solid fuel-burning heating appliances are exempt from this requirement. Sidewall insulation shall not be installed using beadboard, styrofoam or other combustible materials. When exterior walls are repaired by, removing existing sheathing or interior wall covering, insulation shall be provided to the exposed portion of the wall cavity; a vapor barrier shall be provided on the warm side of the cavity or furring when insulation is added.

B. Moderate/Substantial Rehabilitation

The following standards apply to the units in the funded project awarded to this level. These standards include all of the provisions listed as "minor standards" and all of the provisions listed under this section.

1. Access to the Unit

- a. Where access to the structure is outdoors and more than 12" above grade, steps shall be provided for all-weather access to the building and constructed so as to provide safety and reasonable durability.
- b. Where access to the unit is on the interior of the structure, each unit shall not have its only access through another unit.
- c. A primary entrance readily accessible to the handicapped in accordance with the provisions on ANSI A117.1 shall be provided to any residential structure intended for occupancy by the physically handicapped.
- 2. Dilapidated Elements: All dilapidated portions of existing properties which are not economically repairable or which are not of historic significance and which pose safety hazards to the occupants of the dwelling shall be removed from the building.
- 3. Dirt and Debris: Properties that are rehabilitated shall be free of dirt, debris or other unsightly elements that are the result of the rehabilitation process.
- 4. Space Standards: Each living unit shall be provided with space necessary for suitable sleeping, cooking, dining, storage and sanitary facilities and provide space of such size and dimensions so as to permit placement of furniture and essential equipment. There shall be at least one bedroom for every two residents, a kitchen, living room and bathroom. Minimum sizes for these rooms are as follows:

Room Dimension	<u>Space</u>
Living Room	120 sq. ft.
Bedroom	70 sq. ft.
Bathroom	24 sq. ft.
Kitchen	30 sq. ft.

Total area required:

400 sq. ft. Minimum average ceiling height for all rooms: 7' 2 "

5. Light and Ventilation

a. Ventilation: Natural ventilation of spaces such as attics, enclosed basements and crawl spaces, shall be provided by openings of sufficient sizes to overcome dampness and minimize the effect of conditions to

- decay and deterioration of the structure, and prevent excess heat in attics. Exterior openings shall be effectively screened where needed.
- b. Ventilation of utility spaces: Utility spaces which contain solid, liquid or gas-burning heat-producing or air conditioning equipment shall be ventilated to allow adequate combustion air.
- c. Windows: There shall be at least one operable window in the living room and bedrooms. Kitchens and bathrooms not having an operable window shall have a working ventilation system.

6. Doors and Access Openings

- a. Exterior Doors: Exterior doors installed with the use of CDBG funds shall have safety locks.
- b. Stairways: All stairways shall provide for safety of ascent and descent and shall be equipped with handrails at an appropriate height for the owner of the residence. Risers shall not be more than 12" in height and not less than 10" in width, unless conditions make the installation of risers less than 12" in height impossible.
- 7. Structural Components: All structural components of the building shall be in sound condition and considered serviceable for the expected full life of the rehabilitated buildings. Individual structural members in seriously deteriorated condition shall be replaced.
 - a. Ceilings: Ceilings shall not have large cracks or holes that allow significant entry of air into the unit. Ceilings shall not buckle or bulge, have missing parts or have loose surface materials other than paper.
 - b. Interior Wall Conditions: Interior walls shall not have loose structural members, large holes (over 1" X 1" in size), or allow the significant infiltration of air or water into the structure.
 - c. Floor Conditions: Floors shall not have threats to safety (e.g. tripping) or large cracks or holes that allow substantial drafts to enter the structure. Floors shall not significantly move under walking stress and shall not have damaged or missing parts such as: floor joists, band joists, plates and sub-flooring.
 - d. Foundations: Foundations shall provide for the adequate support of structural members and loads placed upon them. Foundations shall prevent the entrance of water or excessive moisture. Serious defects shall be repaired and cracks effectively sealed. Foundation walls shall not allow the significant entry of ground water. "Significant" means that the majority of the basement floor or crawl space area is covered with ground water. Any new footings installed shall provide for subsurface drainage away from the foundation.

- e. Drainage: Any deficiencies in proper grading, guttering or paving adjacent to the building shall be corrected to assure surface drainage away from the basement or crawl space.
- f. Exterior Walls: Exterior walls shall provide safe and adequate support for all loads placed upon them and shall prevent the excessive infiltration of air or moisture. Serious defects shall be repaired and cracks effectively sealed.
- g. Roofs: All roofs shall have suitable watertight and reasonably durable covering free of holes, cracks, excessively worn surfaces or other defects that would indicate the potential for significant infiltration of air, water or excessive moisture. Repairs to roofs shall be completed in accordance with new construction standards unless the area to be repaired is less than 1/10 of the surface of the roof. If gutters, soffits, fascia or other elements allow the significant entry of water or air into the structure, they shall be replaced to eliminate this problem. Roofs should not need replacement for at least a five-year period.

8. Kitchens and Baths

- a. Kitchens: Kitchens must be supplied with a sink that has hot and cold running water. Sinks should have a working drain with a gas trap and must be securely fastened to the wall. Kitchens must have a stove or a range with an oven. Top burners and oven must be operable. A refrigerator must be present and working, and it must maintain a temperature low enough so that food does not spoil over a reasonable period of time.
- b. Bathrooms: Bathtub and shower bases shall be appropriately sealed to prevent water from damaging the floor. Bathroom floors shall be covered with a waterproof covering. Showers or tubs installed in housing for the elderly and handicapped shall be provided with two grab bars installed to sustain a dead weight of 250 pounds for five minutes. Tub or shower bottom surfaces shall be slip resistant. Shower enclosure areas shall be tiled or covered with a waterproof surface from the floor to five feet above the floor. Barriers shall exist between all drains and water supplies on bathroom fixtures to ensure that wastewater does not flood water supply systems.

9. Plumbing

a. Domestic Hot Water Heating and Storage: Each building or unit within the building shall have domestic hot water in quantities sufficient for the needs of the occupants. Existing water heating and storage equipment shall be in good serviceable condition. Water heaters shall not be installed in rooms designed and used for sleeping purposes. All fuel-burning water heaters shall be connected to a vent leading to the exterior of the building. As required for venting of heating equipment, vents

- shall not have cracks or holes that allow fumes to be discharged. All water heaters shall have a shutoff valve on the water supply line close to the heater. All water heaters shall have a temperature/pressure relief valve and discharge pipe.
- b. Water and Sewer Lines: All water and sewer lines that have the potential for major leaks that could cause serious and persistent levels of rust or contamination of the water, or which potentially could damage other elements of the building, should be replaced. Sewer lines servicing a building shall be equipped with a clean-out screw. Building wastewater shall be appropriately vented to the outside air to prevent the buildup of gases in the sewer lines. When using CDBG funding, all water supply lines feeding toilets, sinks, showers, lavatories, hot water heaters and other plumbing fixtures shall be installed with shutoff valves. All lead water and waste disposal lines shall be replaced with non-lead material. Lead-based solder shall not be used to connect copper water supply lines. Gas traps will be provided for washing machine waste disposal lines unless airtight connections have been made.
- 10. Mechanical: Heating facilities shall be provided for each living unit, which are safe to operate, economical to operate and are free from objectionable drafts. Flue connections shall not allow exhaust gases to enter the living areas. Fuel tanks shall not be in close proximity to heat sources (at least 10 feet, or the standard recommended by the manufacturer or regulating code). Combustible materials shall not be stored in close proximity to heat sources and flues.
- 11. Electrical: All habitable rooms and other spaces requiring electrical service shall be provided with a system of wiring, wiring devices, and equipment to safely provide electrical energy for proper illumination, appliances, resident security and other electrical equipment. There shall be at least two working outlets or one working outlet and one light switch in kitchens, corridors, bathrooms, bedrooms, utility rooms and living rooms. At least 100 amp. service shall be provided for houses that have 220-volt receptacles.

LEAD SAFE HOUSING RULE

LICENSING KANSAS LEAD PROFESSIONALS - The Renovation, Repair and Painting Rule (RRP)

The U.S. Department of Housing and Urban Development's Lead Safe Housing Rule (HUD's LSHR, which is found in HUD's regulations at 24 CFR Part 35, Subparts B through M), generally applies to work performed in target housing units receiving HUD housing assistance, such as rehabilitation.

The grantee who accepts HUD funds becomes responsible for compliance with the LSHR and becomes the designated party (or DP). The rule requires renovation firms (contractors) to be licensed by the Kansas Department of Health and Environment (KDHE), workers to be trained and certified and requires the use of lead safe work practices on the job. The term "rehabilitation" is used by HUD to describe residential renovation work.

Common renovation activities like sanding, cutting and removal can create hazardous lead dust and chips by disturbing lead-based paint, which can be harmful to adults and children.

On April 22, 2008, the Environmental Protection Agency (EPA) issued a rule requiring the use of lead safe practices and other actions aimed at preventing lead poisoning. Under the rule, beginning in April 2010, contractors performing renovation, repair and painting projects that disturb lead-based paint in homes, childcare facilities and schools built before 1978 must be certified and must follow specific work practices to prevent lead contamination.

There are some differences between the EPA/KDHE, RRP Rule and the HUD Lead Safe Housing Rule. A major difference is that the LSHR requires clearance examinations. All housing receiving federal assistance must still comply with the LSHR and KDHE.

All renovators should follow these three simple procedures:

- Contain the work area.
- Minimize dust.
- Clean up thoroughly.

From December 2008, the rule has required that contractors performing renovation, repair and painting projects that disturb lead-based paint provide to owners and occupants of child care facilities and to parents and guardians of children under age six that attend child care facilities built prior to 1978 the lead hazard information pamphlet Renovate Right: Important Lead Hazard Information for Families, Child Care Providers, and Schools. Starting on April 22, 2010, the rule will affect paid renovators who work in pre-1978 housing and child-occupied facilities, including:

- Renovation contractors.
- Maintenance workers in multi-family housing.
- Painters and other specialty trades.

Under the rule, child-occupied facilities are defined as residential, public or commercial buildings where children under age six are present on a regular basis. The requirements apply to renovation, repair or painting activities. The rule does not apply to minor maintenance or repair activities where less than two square feet of lead-based paint is disturbed in a room or where less than 20 square feet of lead-based paint is disturbed on the exterior. Window replacement is <u>not</u> minor maintenance or repair.

Exemptions under the LSHR are residential structures built after January 1, 1978, emergency action activities, rehabilitation that does not disturb paint, unoccupied units that will be demolished and elderly and disabled housing that are for the sole use of such persons.

The major types of requirements under the LSHR are identification and notification of defective paint surfaces, treatment of defective paint surfaces, response to Elevated Blood Level (EBL) in children and other lead-based paint requirements, such as: Occupant Protection, Worker Protection, Work Area Containment and Document Maintenance/Clearance.

NOTE: CDBG does not allow any owner, whether an owner-occupant or landlord, to opt out of the use of lead safe work practices at any time.

In order to comply with HUD and KDHE, the CDBG program is implementing the following instructions to assist the implementation of the RRP rule.

Notifications

<u>Four types of notifications are required in the CDBG program.</u> These notifications are to be given to both the occupants and landlords, when applicable.

- 1. Two brochures require distribution to all units built before 1978 and before starting renovation work. The required brochures are found as attachments and titled: "Protect Your Family From Lead In Your Home" and "Renovate Right: Important Lead Hazard Information for Families, Child Care Providers, and Schools". The family occupying the property and in the case of a rental unit both the landlord and renter must be provided the brochures. The documentation of this action must be present in the file.
- 2. <u>RISK ASSESSMENT/NOTICE OF EVALUATION</u>. This notice informs the occupants that paint has been evaluated to determine if it is LBP. After the CDBG/HQS inspection and the work write up have been completed, the Lead Hazard Risk Assessor will perform this task. Only a certified risk assessor may test to determine whether LBP is present. Test kits cannot be used to identify LBP. The risk assessor must notify the homeowner/occupant within 15 calendar days of receiving the evaluation report. The <u>summary</u> of this report should be provided to all contractors bidding on this property. At a minimum, the notice of evaluation results must include a) the date of the notice;

- b) a summary of the nature and scope of the evaluation; c) a contact name, address and phone number for more information; d) the results of the evaluation; and e) a contact name, address and phone number to obtain the actual report.
- 3. NOTICE OF CLEARANCE. This notice informs the homeowner/tenant that clearance has been achieved and it is safe for them to reoccupy the construction area. This should be given as soon as clearance has been achieved. If the first clearance testing fails, it will be the contractor's responsibility to pay for all additional clearance testing until a passing clearance can be obtained.

The unit, or, where the work is contained, (the work area and an area just outside the containment) must pass clearance, and must not have any remaining lead hazards. If clearance fails at either the visual assessment step or the dust-testing step, cleaning has to be redone. The failed part of the work area is the specific area that was tested, as well as any areas that were not tested, and any other areas that are being represented by the sampled areas. For example: just one bedroom was tested because it was to represent all bedrooms in the housing unit; it failed. Therefore, all of the bedrooms in the unit have to be re-cleaned and re-cleared.

4. NOTICE OF LEAD HAZARD REDUCTION/CLEARANCE REPORT. This notice describes the hazard reduction work completed and gives the contact information for occupants to get more information. The risk assessor must notify the homeowner/occupant within 15 calendar days of completion of the lead hazard reduction work or activities. At a minimum, this report must include:

a) a summary of the nature, scope and results of the hazard reduction activities, including the clearance results; b) a contact name, address and phone number for more information; and c) available information on the location of remaining lead-based paint on a surface-by-surface basis.

NOTE: The homeowner should be educated that if they decide to sell or rent the home, <u>disclosure</u> of lead presence must be provided at the time of sell/rental.

Required notifications at renovation site

- 1. Describe the nature, locations and dates of the renovation;
- 2. Be posted where they will be seen;
- 3. Be in the primary language of the occupants.

Occupant Protection

When a child is known to have an environmental intervention blood lead level present, the designated party must take additional steps to assess the situation and respond to potential lead hazards. An environmental intervention blood lead level is a reading in a child under six years old of 20 micrograms per deciliter of blood (20 ug/dL), or two reading of 15 to 19 ug/dL at least 3 months apart. All persons participating in such work should have appropriate training and qualifications.

Appropriate actions must be taken to protect occupants from lead-based paint hazards associated with lead hazard reduction activities.

- Occupants may not enter the worksite during lead hazard reduction activities. Reentry is permitted only after lead hazard reduction activities are completed and the dwelling has passed a clearance examination.
- Occupants of the unit must be temporarily relocated to a suitable unit that is decent, safe, sanitary
 and free of lead-based paint hazards during lead hazard reduction activities. Relocation must be
 done before lead hazard reduction activities begin.
- Property owners must protect occupants' belongings from lead contamination during lead hazard reduction activities by relocating or covering and sealing them and ensure that the worksite is secured against entry during non-working hours until the unit passes a clearance examination.

Under certain conditions, occupant relocation is not required. These conditions are:

- 1. Treatment will not disturb lead-based paint or lead contaminated dust.
- 2. Treatment of the interior will be completed within one period in eight daytime hours, the site will be contained and the work will not create other safety, health or environmental hazards.
- 3. Only the building's exterior is treated; the windows, doors, ventilation intakes and other openings near the worksite are sealed during hazard reduction activities and cleaned afterward; and a lead-free entry is provided.
- 4. Treatment will be completed within five calendar days; the work area is sealed; at the end of each day, the area within 10 feet of the containment area is cleared of debris; at the end of each day, occupants have safe access to sleeping areas, bathrooms and kitchen facilities; treatment does not create other safety, health or environmental hazards.

Worker Protection/Work Area Containment

The worksite for lead hazard reduction activities must be prepared to prevent the release of leaded dust and debris.

- Workers must use safe work practices that minimize the spread of leaded dust, paint chips, soil and debris.
- Warning signs are required at each entry to a room where lead hazard reduction activities are conducted when occupants are present; at the main and secondary entryways to a building from which occupants have been relocated; and at exterior worksites at a size and type readable from 20 feet (six meters) from the edge of the worksite. Signs need to be in the occupants' primary language to the extent practicable.

Training, Certification and Work Practice Requirements

- 1. Rehabilitation work can only be awarded to KDHE Licensed Renovation Firms. Construction firms can visit the KDHE website at http://www.kdheks.gov/lead/index.html to obtain certification.
- 2. All workers and supervisors on the job site must have completed an approved LSWP training and received a certification confirming completion.
- 3. Lead safe work practices must be followed. Examples of these practices include:
 - a. Work-area containment to prevent dust and debris from leaving the work area.
 - b. Prohibition of stated work practices.
 - c. Thorough clean up followed by a clearance report.
- 4. A Certified Risk Assessor, not the renovation firm, must conduct clearance.

Additional HUD Requirements for the Renovator:

- 1. Training is required for workers and supervisors performing interim controls.
 - a. If the supervisor (in HUD terms) or Certified Renovator (in EPA terms) is certified as a lead-based paint abatement supervisor or has successfully completed an accredited abatement supervision or abatement workers course, that person must complete a 4-hour RRP refresher course.
 - b. Workers must successfully complete either a one-day RRP course, or another lead safe work practices course approved by HUD and EPA. HUD/EPA has approved the one-day Renovation, Remodeling and Repair course.
 - c. The 4-hour RRP refresher course is not sufficient on its own to meet either the EPA or HUD training requirement.
- 2. The certified renovation firm and the certified renovator must take additional precautions to protect residents from lead poisoning beyond those in EPA's RRP Rule. Depending on type and amount of CDBG assistance, it is required that lead hazards be treated using "interim controls" or "ongoing lead-based paint maintenance."
 - a. Renovators must use lead safe work practices in work exempt from the RRP Rule that:
 - Disturbs between 2 and 6 ft² of paint per room, the LSHR's *de minimus* threshold and the RRP's minor repair and maintenance activities threshold, respectively.

 NOTE: Window replacement, window sash replacement and removal of painted surface areas are always considered to disturb more paint than the LSHR's *de minimus* threshold.
 - Disturbs more than 10 percent of a component type with a small surface area (such as windowsills, baseboards and trim) or 2 sq. ft. per room. NOTE: The square foot and percent thresholds above apply to all work performed within in a thirty-day period.
 - b. Prohibited Methods of Paint Removal:
 - Heat guns operating above 1,000 degrees Fahrenheit or those that operate high enough to char the paint.
 - Dry sanding or dry scraping.
 - Paint stripping in a poorly ventilated space using a volatile stripper that is a
 hazardous substance in accordance with regulations of the Consumer Product
 Safety Commission at 16 CFR 1500.3, and/or a hazardous chemical in accordance
 with the Occupational Safety and Health Administration at 29 CFR 1010.1200 or
 1926.59, as applicable to the work. NOTE: Methylene chloride paint strippers
 may cause cancer and should be avoided. Use of these strippers is prohibited by
 some jurisdictions.
 - Open flame burning or torching.
 - Machine removal without HEPA vacuum attachment.

Worksite Cleanup

Worksite cleanup removes dust and debris from the work area. Good cleanup is critical to passing clearance and leaving the unit safe for habitation. Worksite cleanup must be done using methods, products and devices that are successful in cleaning lead contaminated dust, such as vacuum cleaners

with HEPA filters or equivalent equipment, and household or lead specific detergents or equivalent products.

Exemptions

Safe work practices are not required:

- If paint has been tested and found to be lead-free; or
- If maintenance or lead hazard reduction activities disturb a total surface area that is less than the following standards:
 - 20 ft. square (2 m square) on exterior surfaces;
 - 2 ft. square (0.2 m square) on any one interior room or space; or
 - 10 percent of the total surface areas on an interior or exterior type of component with a small surface area like windowsills, baseboards and trim.

Clearance is not required:

- If maintenance or a lead hazard reduction activity at a worksite does not disturb painted surfaces; or
- If the total area disturbed does not exceed the footage listed above under exemptions to safe work practices.

When HUD funds pay for renovation, funding often flows from HUD to states, to cities, and addressing lead-based painted surfaces becomes a routine part of the job. "CDBG requirements" are identified as those rehabilitation projects costing between \$5,000 and \$25,000. However, should a grantee expend federal monies below or above those amounts on any one housing rehabilitation project, the requirements of the activities for those amounts would be applicable.

- 1) Up to \$5,000 per unit: "Do no harm" approach. Lead safety requirements cover only the surfaces being disturbed. Program participants can either test these surfaces to determine if they contain lead-based paint or presume they contain lead-based paint. Work which disturbs painted surfaces known or presumed to contain lead-based paint is done using lead safe work practices, and clearance of the worksite is performed at the end of the job (unless it is a very small "de minimis" scale project) to ensure that no lead dust hazards remain in the work area. Training that meets the EPA's RRP Rule requirements is sufficient for this work.
- 2) Greater than \$5,000 and up to \$25,000 per unit: Identify and control lead hazards. Identify all lead hazards at the affected units and common areas servicing those units by performing a lead-based paint risk assessment. Control the hazards using interim controls. Training that meets the EPA's RRP Rule requirements and HUD/EPA RRP curriculum is required for renovators and workers.
- 3) Greater than \$25,000 per unit: Identify and abate lead hazards. Identify all lead hazards at the property by performing a risk assessment and then abate all the hazards. This approach requires certified abatement contractors perform the abatement part of the job.

Depending on the type and amount of housing assistance provided, HUD generally requires that identified LBP hazards be treated. Treatments may include LBP hazard abatement, interim controls or ongoing LBP maintenance. Interim controls include the following activities which are required if the

amount of work is above HUD's *de minimis* threshold; for work below the *de minimis* threshold, any deteriorated paint must be repaired. Although strongly encouraged, the work need not be done using lead safe work practices.

- 1. Deteriorated LBP must be stabilized. This means that physical defects in the substrate of a paint surface or component that is causing the deterioration of the surface or component must also be repaired.
- 2. Friction surfaces that are abraded must be treated if there are lead dust hazards nearby.
- 3. Friction points must be either eliminated or treated so the LBP is not subject to abrasion.
- 4. Impact surfaces must be treated if the paint on an impact surface is damaged or otherwise deteriorated and damage is caused by impact from a related building component (such as a doorknob that knocks the wall or door that rubs against its doorframe).
- 5. LBP must be protected from impact.
- 6. Chewable LBP surfaces must be made inaccessible for chewing by children of less than six years of age if there is evidence that such a child has chewed on the painted surface.
- 7. Horizontal surfaces that are rough, pitted or porous must be covered with a smooth, cleanable covering or coating.

"LEAD SPEAK" A BRIEF GLOSSARY

COMMON LEAD-BASED PAINT TERMS

Lead-Based Paint: Paint that contains at least 1 milligram per centimeter square (mg/cm) of lead. Also measured as greater than 0.5 percent lead or has 5,000 parts per million (ppm) lead by dry weight.

Lead-Based Paint Hazards: Housing conditions that cause human exposure to unsafe levels of lead from paint. These conditions include deteriorated lead-based paint; friction, impact or chewable painted surfaces; lead contaminated dust; or lead contaminated soil.

Lead Hazard Evaluation

Visual Assessment: A visual evaluation of interior and exterior painted surfaces to identify specific conditions that contributes to lead-based paint hazards. A certified risk assessor or Housing Quality Standards (HQS) inspector trained in visual assessment performs the assessment.

Paint Testing: Testing of specific surfaces, by XRF (x-ray fluorescence) or lab analysis, to determine the lead content of these surfaces, performed by a certified lead-based paint inspector or certified risk assessor.

Risk Assessment: A comprehensive evaluation for lead-based paint hazards that includes paint testing, dust and soil sampling and a visual evaluation. The risk assessment report identifies lead hazards and appropriate lead hazard reduction methods. A certified risk assessor must conduct the assessment.

Lead Hazard Screen: A limited risk assessment activity that can be performed instead of a risk assessment in units that meet certain criteria (e.g. good condition). A certified risk assessor must perform the screen. If the unit fails the lead hazard screen, a full risk assessment must be performed.

Clearance Examination: Clearance is performed after hazard reduction, rehabilitation or maintenance *activities to determine if a unit is safe for occupancy. It involves a visual assessment analysis of dust and soil samples, and preparation of a report. A certified risk assessor, paint inspector or clearance technician (independent from entity/individual conducting paint stabilization or hazard reduction) conducts clearance.

Lead Hazard Reduction

Paint Stabilization: An interim control method that stabilizes painted surfaces and addresses the underlying cause of deterioration. Steps include repairing defective surfaces, removing loose paint and applying paint.

Interim Controls: Set of measures to temporarily control lead-based paint hazards. Qualified workers using safe work practices must complete interim control methods. Follow-up monitoring is needed.

Visual Assessment: A visual assessment for deteriorated paint consists of a visual search for cracking, scaling, peeling or chipping paint. Visual assessments must be conducted by persons trained to identify deteriorated paint.

Paint Testing: Paint testing entails testing painted surfaces to determine if it contains lead-based paint using methods such as an XRF analyzer or laboratory analysis. Paint testing differs from a lead-based paint inspection, which is a surface-by-surface investigation to determine the presence of lead-based paint. Typically, the XRF analyzer is used for an inspection. It is presumed in the Kansas CDBG program at this stage that laboratory analysis will be more prevalent due partially to the cost of the XRF analyzer. Because an inspection evaluates all painted surfaces, it is more comprehensive than lead-based paint testing. Certified paint inspectors or risk assessors must conduct paint testing.

Risk Assessment: A risk assessment is a comprehensive investigation of a dwelling to identify lead-based paint hazards that includes paint testing, dust and soil sampling, and a visual evaluation. Risk assessment results are summarized in a written report with recommendations for action.

Lead Hazard Screen: A lead hazard screen is similar to a risk assessment. The sampling is less extensive, but the requirements are more stringent.

Treatment of Defective Paint Surfaces

There are four approaches to implementing lead hazard evaluation and reduction:

Approach 1 - Do No Harm: This approach is intended to allow low-cost repairs and other work to proceed without costly lead-based paint requirements yet, at the same time, to prevent lead-based paint hazards from being created while that work is being done. It does not determine if a whole dwelling unit or property is "lead safe" because clearance is conducted only for the worksite.

Approach 2 - Identify and Stabilize Deteriorated Paint: This approach provides assurance that lead-based paint has been stabilized and the unit is "lead safe" because clearance is conducted for the whole unit. However, it does not prevent the reappearance of lead-based paint hazards. Thus, ongoing maintenance is required when there is an ongoing relationship with HUD. (This is usually related to multi-unit housing receiving ongoing funding from a HUD program such as Section 8 subsidy.)

Approach 3 - Identify and Control Lead-Based Paint Hazards: This approach provides assurance that lead-based paint hazards have been eliminated. As in Approach 2, clearance is conducted for the whole unit. Ongoing maintenance is still required when there is an ongoing relationship with HUD because interim controls are not permanent.

Approach 4 - Identify and Abate Lead-Based Paint Hazards: This approach is used when Federal funds are used to make a substantial investment in the property. Long-term hazards control measures (abatement) are implemented to help ensure that the unit remains lead safe.

You will note that Approach 3 is the applicable approach to the majority of CDBG projects.

According to the Approach required, there are four reduction methods for lead-based paint: Method 1 - Paint Stabilization: This lead hazard reduction method reduces exposure to lead-based paint by addressing deteriorated paint on exterior and interior surfaces through repairs, safe paint removal and repainting or abatement.

Method 2 - Interim Controls: Interim controls temporarily reduce exposure to lead-based paint hazards through repairs, painting, maintenance, special cleaning, occupant protection measures, clearance and education programs. Interim control methods require safe practices and include:

- Paint Stabilization: All deteriorated paint on exterior and interior surfaces must be stabilized through repairs, safe paint removal and repainting.
- Treatment for Friction and Impact Surfaces: If lead-based paint is found and exceeds acceptable levels or is presumed, the conditions creating friction or impact with surfaces with lead-based paint such as those that rub, bind or crush must be corrected. Examples of this work include rehanging binding doors, installing doorstops or reworking windows.
- Treatment for Chewable Surfaces: If a child under age six has chewed surfaces known to contain lead-based paint or if lead-based paint is presumed, these surfaces must be enclosed or coated so they are impenetrable.
- Lead Contaminated Dust Control: All horizontal surfaces that are rough, pitted or porous such as bare floors, stairs, window sills and window troughs must be covered with a smooth, cleanable covering or coating such as metal coil stock, plastic, polyurethane or linoleum. Carpeting must be vacuumed or rugs must be removed and vacuumed on both sides. Vacuuming must be done using HEPA vacuums.
- Lead Contaminated Soil Control: If soil is lead contaminated, interim controls that may be used include permanent surface coverings such as gravel, bark and sod as well as land use controls such as fencing, landscaping and warning signs.

Method 3 - Standard Treatments: In some cases, standard treatments may be conducted in lieu of interim controls on all applicable surfaces, including soil, to control lead-based paint hazards that may be present. All standard treatment methods must follow the same safe work practice and clearance requirements that apply to interim control activities. These methods include:

- Paint Stabilization: All deteriorated paint on exterior and interior surfaces must be stabilized through repairs, safe paint removal and repainting or abatement.
- Smooth and Cleanable Horizontal Surfaces: All horizontal surfaces that are rough, pitted or porous such as bare floors, stairs, window sills and window troughs must be covered with a smooth, cleanable covering or coating such as metal coil stock, plastic, polyurethane or linoleum.
- Correcting Dust Generating Conditions: All conditions that generate lead contaminated dust such as those that rub, bind or crush surfaces with lead-based paint must be corrected. Examples include re-hanging doors, installing doorstops or reworking windows.
- Bare Residential Soil: Soil is addressed using interim control methods including impermanent surface coverings such as gravel, bark and sod as well as land use controls such as fencing, landscaping and warning signs.

Method 4 - Abatement: Abatement permanently removes lead-based paint and lead-based paint hazards by removing lead-based paint and its dust, or permanently encapsulating or enclosing the lead-based paint, replacing components with lead-based paint, and removing or permanently covering lead contaminated soil. Encapsulation and enclosure require ongoing maintenance to check their effectiveness.

Interim Controls is the applicable method to the majority of CDBG projects.

Clearance Standards

If the test results equal or exceed the designated standards, the dwelling unit, worksite or common area fails the clearance examination. The clearance standards are:

	Floors, (ug/ft.sq.)	Interior Window	Window Troughs,
		Sills, (ug/ft. sq.)	(ug/ft. sq.)
Lead in Dust (as	40	250	400
measured by a dust			
wipe sample)			

Report

The clearance examiner must prepare a clearance report. If lead hazard reduction activities other than abatement are performed, a clearance report must be prepared as described in the table below. If abatement is conducted, a certified supervisor or project designer must prepare an abatement report as described below.

Clearance Report	Abatement Report
Property address:	Property address:
 Date of clearance examination. Name, address and signature of each person performing the clearance examination including certification number. Visual assessment results. Dust sample analysis, in ug/sq.ft., by location. Name and address of each laboratory that conducted the dust sample analysis, including their identification number. 	 Date of clearance testing. Name, address and signature of each certified risk assessor or inspector conducting clearance sampling. Clearance testing results and all soil analyses (if applicable) and the name of each recognized laboratory that conducted the analyses.
Hazard reduction or maintenance information: - Start and completion dates of hazard reduction of maintenance activity. -Name and address of each firm or organization conducting the hazard reduction or maintenance activity, and the name of each supervisor assigned. - A detailed, written description of the hazard reduction or maintenance activity, to include: Methods used: locations of exterior surfaces or soil; interior rooms, common areas; and/or components where the hazard reduction activity occurred, and any suggested monitoring of encapsulates or enclosures.	Abatement information: - Start and completion dates of abatement Name and address of each certified firm conducting the abatement, and the name of each supervisor assigned to the abatement project Occupant protection plan A detailed, written description of the abatement, to include: Methods used: locations of rooms; and/or components where abatement occurred, the reason for selecting particular abatements methods for each component and any suggested monitoring of encapsulates or enclosures.

Unit Fails Clearance

If a unit fails a clearance examination, the unit must be re-cleaned and re-tested until clearance v is achieved.

	<\$5,000	\$5,000 - \$25,000	>\$25,000
Approach to Lead Hazard Evaluation and Reduction	1. Do no harm	2. Identify and control lead hazards	3. Identify and abate lead hazards
Notification	Yes	Yes	Yes
Lead Hazard Evaluation	 Paint testing of surfaces to be distributed by rehabilitation 	Paint testing of surfaces to be distributed by rehabilitationRisk assessment	 Paint testing of surfaces to be distributed by rehabilitation Risk assessment
Lead Hazard Reduction	 Repair surfaces distributed during rehabilitation Safe work practices Clearance of work site 	Interim controlsSafe work practicesClearance of unit	AbatementSafe work practicesClearance of unit
Ongoing Maintenance	For HOME rental properties only	For HOME rental properties only	For HOME rental properties only
EIBLL	No	No	No
Options	 Presume lead-based paint Use safe work practices on all surfaces 	 Presume lead-based paint and/or hazards Use standards treatments 	 Presume lead-based paint and/or hazards Abate all applicable surfaces

FOUR APPROACHES TO IMPLEMENTING LEAD HAZARD EVALUATION AND REDUCTION


APPROACH 1. DO NO HARM				
Lead Hazard Evaluation	Lead Hazard Reduction	Options		
Paint testing performed on surfaces to be disturbed.	Repair surfaces disturbed during work.	Presume lead-based paint is present and use safe work practices on all surfaces being disturbed.		
	Safe work practices used when working on areas identified as lead-based paint.			
	Clearance performed on work site.			
APPROACH 2. II	DENTIFY AND STABILIZE DETER	IORATED PAINT		
Lead Hazard Evaluation	Lead Hazard Reduction	Options		
Visual assessment performed to identify deteriorated paint.	Paint stabilization of identified deteriorated paint.	Perform paint testing on deteriorated paint. Safe work practice requirements only apply to leadbased paint.		
	Safe work practices used.			
	Clearance performed unit-wide.			
APPROACH 3. IDENTIFY AND CONTROL LEAD HAZARDS				
Lead Hazard Evaluation	Lead Hazard Reduction	Options		
Paint testing performed on surfaces to be disturbed.	Interim controls performed on identified hazards.	Presume lead-based paint and/or lead-based paint hazards are present and perform standard treatments.		
Risk assessment performed on entire dwelling.	Safe work practices used.			
	Clearance performed unit-wide.			
APPROACH 4. IDENTIFY AND ABATE LEAD HAZARDS				
Lead Hazard Evaluation	Lead Hazard Reduction	Options		
Paint testing performed on surfaces to be disturbed.	Abatement performed on identified hazards.	Presume lead-based paint and/or lead-based paint hazards are present and perform abatement on all		
	Interim controls performed on identified hazards on the exterior that are not disturbed by rehabilitation.	applicable surfaces.		
Risk Assessment performed on entire dwelling.		Deteriorated, impact, friction, chewable surfaces and surfaces to be disturbed.		
	Safe work practices used.			
	Clearance performed unit-wide.			

IMPORTANT!

Lead From Paint, Dust, and Soil in and Around Your Home Can Be Dangerous if Not Managed Properly

- Children under 6 years old are most at risk for lead poisoning in your home.
- Lead exposure can harm young children and babies even before they are born.
- Homes, schools, and child care facilities built before 1978 are likely to contain lead-based paint.
- Even children who seem healthy may have dangerous levels of lead in their bodies.
- Disturbing surfaces with lead-based paint or removing lead-based paint improperly can increase the danger to your family.
- People can get lead into their bodies by breathing or swallowing lead dust, or by eating soil or paint chips containing lead.
- People have many options for reducing lead hazards.
 Generally, lead-based paint that is in good condition is not a hazard (see page 10).



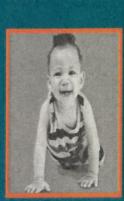



Your Family From Lead in Your Home

Protect



United States Environmental Protection Agency




United States
Consumer Product
Safety Commission



United States
Department of Housing
and Urban Development

For the complete brochure click here: Protect Your Family From Lead In Your Home Brochure

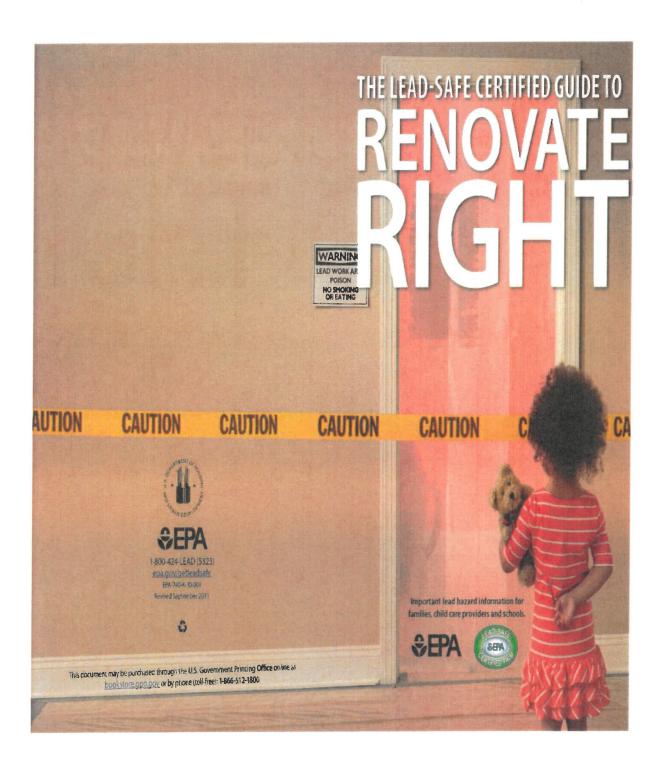

For the complete brochure click here: Renovate Right Brochure

RRP WORK PRACTICES STANDARDS CERTIFICATION

I certify hat KDHE RRP Work Practice Standards were utilized while performing renovation work activities at the address listed below. I also certify that copies of our Lead Renovation Firm and Certified Renovator licenses/certificates were on site and signs were posted at entrance to work area warning occupants and other persons not involved in renovation activities to remain outside of the work area. Signs were posted before beginning the renovation and remained in place until the renovation is completed.

Client Name:			
Street Address:			
City:			
State:			
Zip Code:			
How many workers on	site?		
flow many workers on a			
Renovation Firm Name		Firm License Number	
Printed Name of Certified Reno	avotor.	Certification Number	
Printed Name of Certified Rend	JValui	Certification (vanioe)	
Signature of Certified Renovator	or	Date	